



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/07/2024		M57 Pretoria Road - 1619
Inspection Date	08/07/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	VOLKSWAGEN	Registration Number	ZLH924GP
Model	POLO	Register Number	
VIN	AAVZZZ6RZAU066193	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2020
Color	GREY	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	210,079 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Engine Wiring Defective	Repair
Caps Missing	Replace
Hoses Defective	Replace
Radiator Defective	Repair
Power Steering Pump / Electronic Unit Leak	Repair
Central Air Vent Damaged	Replace
Hooter Damaged	Replace
Switch Electrical Window Winder front left Defective	Repair
Windscreen Wiper Missing	Replace
Air Conditioner Insufficient	Replace
Indicator Light Front Right Damaged	Replace
Fog Light Front Left Defective	Replace
Fog Light Front Right Defective	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Defective	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Sun Visor Right Damaged	Replace
Hood Lining Damaged	Replace
Door Panel Front Left Defective	Repair
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Right Torn / Cut	Replace
Parcel Tray Missing	Replace
Gear Lever Dust Boot Damaged	Repair
Steering Wheel Trim Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZAU066193

1 / 24



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Damage	Repair Way
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Bonnet slam plate (Shock tower/ Inner tray) Dented	Repair
Front Fender Left Damaged	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Left / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Rocker Panel Left Damaged	Repair
Rocker Panel Right Damaged	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Brake Piping Defective	Repair
Steering Rack Defective	Repair
Shock Absorber Front Left Defective	Replace
Stabilizer Mounting Front Left Defective	Replace
Stabilizer Mounting Front Right Damaged	Replace
Wheel bearing Rear Left Damaged	Replace
Alignment Poor Alignment	Repair
Control Arm Bush(es) Front Axle Left Damaged	Replace
Control Arm Bush(es) Front Axle Right Damaged	Replace
Tyre Front Left Damaged	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Rim Front Left Dented	Repair
Rim Front Right Defective	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Dented	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Sub Frame Dented	Repair
Engine to silencer pipe Damaged	Repair
Belly plates Damaged	Replace
CV Joint(s) Front Right (inner/outer) Defective	Repair
Radiator Cradle Damaged	Replace
Steering Insufficient	Repair
Warning lights illuminated on dashboard	Repair
Interior	Vehicle interior dirty and some panels scratched
Interior	Handbrake lever dust cover damaged
Electrical instruments and components	Drivers electrical switch mechanism damaged
Engine	Engine bay dirty
Engine	Engine cover strapped with cable ties
Road test	Play on gear lever
Undercarriage	Center exhaust cross member bracket dented
Undercarriage	Vehicle undercarriage dirty
Body and Exterior	Boot does not open
Body and Exterior	Signs of impact damage to front of vehicle
Body and Exterior	Dents and scratches on some body panels
Axle and suspension	Front and rear suspension noisy



CONDITION REPORT

VIN: AAVZZ76PZAJ066102
Report No: 2016445842
2 / 24
DATE
08/07/2024

Brakes
Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.57	2.29	-	
Rear	1.91	2.21	-	
Emergency / Parking	1.23	1.2	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842
VIN: AAVZZZ6RZAU066193
DATE
08/07/2024

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60 R15	84H	Continental	Contipremuim	V	1517	0 mm
Front Right	185/60 R15	84H	Bridgestone	Turanza	V	2917	0 mm
Rear Left	185/60 R15	84H	Bridgestone	Turanza	V	1918	1 mm
Rear Right	185/60 R15	84H	Bridgestone	Potenza	V	1915	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	16684:000	RANDOM/MULTIPLE CYLINDER MISFIRE DETECTED	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

Report No: 2016445842

VIN: AAVZZZ6RZAU066193
DATE: 08/07/2024
4 / 24

[illegible]

Brake and shock absorber repor

[illegible]

Diagnostic report page 1

Author(s)	Year	Journal	Volume	Page(s)
Wang, Y. & J. H. Wang	1995	Acta Zool. Sin.	21	1-5
Wang, Y. & J. H. Wang	1996	Acta Zool. Sin.	22	1-5
Wang, Y. & J. H. Wang	1997	Acta Zool. Sin.	23	1-5
Wang, Y. & J. H. Wang	1998	Acta Zool. Sin.	24	1-5
Wang, Y. & J. H. Wang	1999	Acta Zool. Sin.	25	1-5
Wang, Y. & J. H. Wang	2000	Acta Zool. Sin.	26	1-5
Wang, Y. & J. H. Wang	2001	Acta Zool. Sin.	27	1-5
Wang, Y. & J. H. Wang	2002	Acta Zool. Sin.	28	1-5
Wang, Y. & J. H. Wang	2003	Acta Zool. Sin.	29	1-5
Wang, Y. & J. H. Wang	2004	Acta Zool. Sin.	30	1-5
Wang, Y. & J. H. Wang	2005	Acta Zool. Sin.	31	1-5
Wang, Y. & J. H. Wang	2006	Acta Zool. Sin.	32	1-5
Wang, Y. & J. H. Wang	2007	Acta Zool. Sin.	33	1-5
Wang, Y. & J. H. Wang	2008	Acta Zool. Sin.	34	1-5
Wang, Y. & J. H. Wang	2009	Acta Zool. Sin.	35	1-5
Wang, Y. & J. H. Wang	2010	Acta Zool. Sin.	36	1-5
Wang, Y. & J. H. Wang	2011	Acta Zool. Sin.	37	1-5
Wang, Y. & J. H. Wang	2012	Acta Zool. Sin.	38	1-5
Wang, Y. & J. H. Wang	2013	Acta Zool. Sin.	39	1-5
Wang, Y. & J. H. Wang	2014	Acta Zool. Sin.	40	1-5
Wang, Y. & J. H. Wang	2015	Acta Zool. Sin.	41	1-5
Wang, Y. & J. H. Wang	2016	Acta Zool. Sin.	42	1-5
Wang, Y. & J. H. Wang	2017	Acta Zool. Sin.	43	1-5
Wang, Y. & J. H. Wang	2018	Acta Zool. Sin.	44	1-5
Wang, Y. & J. H. Wang	2019	Acta Zool. Sin.	45	1-5
Wang, Y. & J. H. Wang	2020	Acta Zool. Sin.	46	1-5
Wang, Y. & J. H. Wang	2021	Acta Zool. Sin.	47	1-5
Wang, Y. & J. H. Wang	2022	Acta Zool. Sin.	48	1-5
Wang, Y. & J. H. Wang	2023	Acta Zool. Sin.	49	1-5
Wang, Y. & J. H. Wang	2024	Acta Zool. Sin.	50	1-5

Diagnostic report page 2

Address: 123 Main St, Suite 100, New York, NY 10001		Phone: (212) 555-1234	
Fax: (212) 555-5678		Email: info@company.com	
Website: www.company.com		Report ID: RPT-2024-001	
Technician Notes: The technician visited the site on 2024-01-01 at 10:00 AM. The issue was identified as a software bug. The technician performed a series of tests and found that the problem was caused by a recent update. The technician has recommended a rollback to the previous version of the software. The client has agreed to the recommendation and will schedule the rollback for 2024-01-02 at 11:00 AM. The technician will be on-site for the rollback and will provide a status report upon completion.		Customer Name: _____ Technician: _____ Date: _____ Note: Print and keep a copy of this report for your records.	

Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016445842

DATE

08/07/2024

VIN: AAVZZZ6RZAU066193

5 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

VIN: AAVZZZ6RZAU066193

6 / 24



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

VIN: AAVZZZ6RZAU066193
7 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

VIN: AAVZZZ6RZAU066193
9 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024




LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

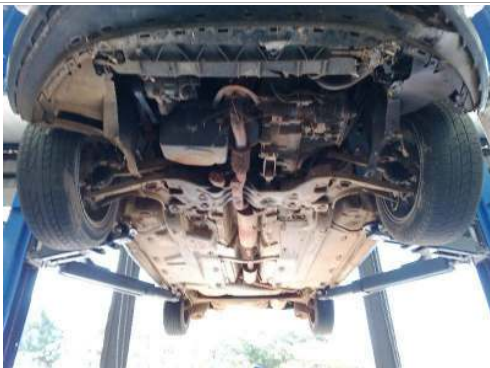

Front chassis



Rear chassis



Center exhaust cross member br



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

VIN: AAVZZZ6RZAU066193
11 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Oil cap and dipstick



Drivers electrical switch mech



Handbrake lever dust cover



Gear Lever Dust Boot



Steering Wheel Trim



Sun Visor Right



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

VIN: AAVZZZ6RZAU066193
13 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Hood Lining



Central Air Vent



Steering Wheel Trim



Side Mirror Right



Door Front Right



Seat Front Right



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

VIN: AAVZZZ6RZAU066193
15 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Door Sealing Rubber Front Right

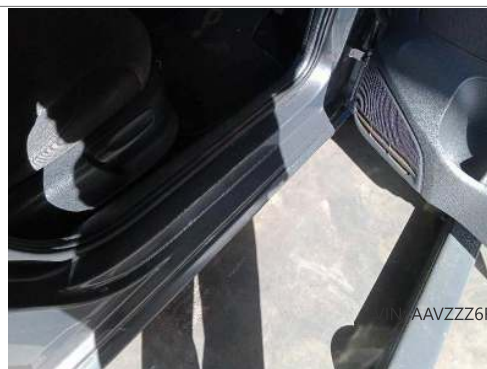

Sill Panel Right



Sill Panel Right



Door Sealing Rubber Rear Right



Seat Rear



Door Rear Right



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

VIN: AAVZZZ6RZAU066193
17 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Rear Fender Right



Front Fender Right

VIN: AAVZZZ6RZAU066193

18 / 24



Windscreen



Front Bumper



Front Bumper



Bonnet



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

VIN: AAVZZZ6RZAU066193
19 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Headlight Right



Headlight Left



Engine



Hoses



Engine Wiring



Caps



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024


VIN: AAVZZZ6RZAU066193
21 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

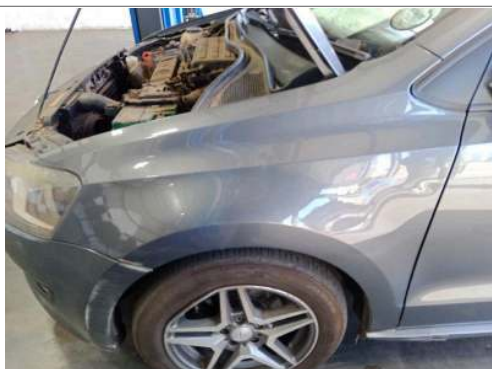DATE
08/07/2024

Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Side Mirror Left



Sill Panel Left



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

VIN: AAVZZZ6RZAU066193
23 / 24

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024



Sill Panel Left



Seat Front Left



Door Panel Front Left



Rear bumper



Rear bumper



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016445842

DATE
08/07/2024

Windscreen Wiper



Roof

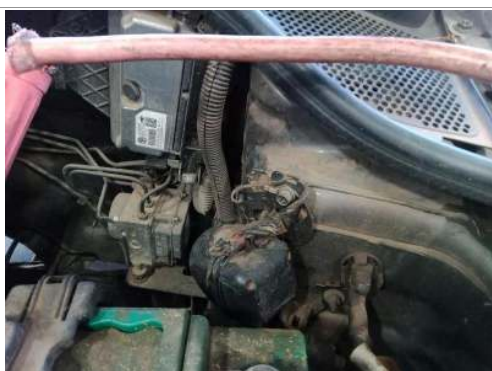

Engine Wiring



Fog Light Front Right



Fog Light Front Left



Rocker Panel Right



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Bolt(s) / Nut(s) Front Wheel Right



Rim Front Right



Control Arm Bush(es) Front Axle Right



Front Bumper



Control Arm Bush(es) Front Axle Left



Shock Absorber Front Left



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Front Fender Left / Inner Tray



Rim Front Left



Bolt(s) / Nut(s) Front Wheel Left



Rocker Panel Left



Rim Rear Left



Bolt(s) / Nut(s) Rear Wheel Left



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Wheel bearing Rear Left



Bolt(s) / Nut(s) Rear Wheel Right



Rim Rear Right



Tyre Rear Right



Tyre Rear Left



Tyre Rear Right



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Belly plates



Tyre Front Left



Tyre Front Right



Power Steering Pump / Electronic Unit



Radiator Cradle



Radiator



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

CV Joint(s) Front Right (inner/outer)

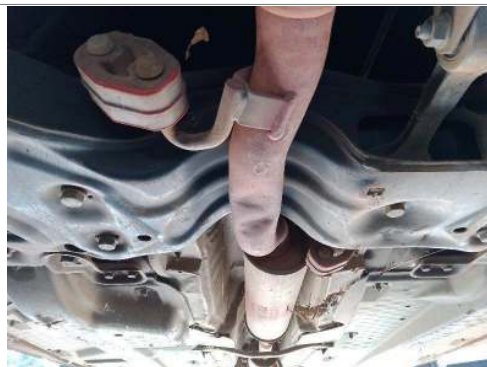

Engine to silencer pipe



Sub Frame



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Brake Piping



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Steering Rack



Indicator Light Front Right



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Switch Electrical Window Winder front left



Hooter



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

Parcel Tray



Air Conditioner



CONDITION REPORT

Report No: 2016445842

DATE
08/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za