



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
GautengDEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/12/2023		M57 Pretoria Road - 1619
Inspection Date	08/12/2023		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	FXF556L
Model	POLO VIVO	Register Number	
VIN	AAVZZZ6RZNU017670	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2023
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	30,019 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

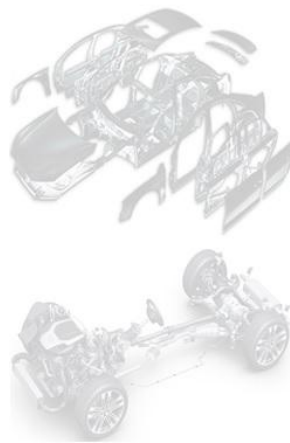

Damage	Repair Way
Engine Oil Leak	Repair
Indicator Light Front Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Sun Visor Left Dirty	Repair
Sun Visor Right Dirty	Repair
Hood Lining Dirty	Repair
Parcel Tray Missing	Replace
Steering Wheel Trim Defective	Repair
Number Plate Front Defective	Repair
Number Plate Rear Defective	Repair
Front Bumper Damaged	Repair
Bonnet Dented	Repair
Front Fender Left Defective	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Right / Inner Tray Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Damaged	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Paintwork • Scratched	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Rocker Panel Left Damaged	Repair
Rocker Panel Right Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZNU017670

1 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023

Damage	Repair Way
Roof Paintwork • Chipmarks	Repair
Windscreen Cracked	Replace
Tie Rod End right Defective	Replace
Shock Absorber Front Right Defective	Replace
Rear Axle Defective	Repair
Control Arm(s) Front Axle Right Defective	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Rear Left Torn / Cut	Replace
Spare Tyre Damaged	Replace
Rim Spare Wheel Scratched	Repair
Chassis Damaged	Repair
Sub Frame Dented	Repair
Belly plates Damaged	Replace
Fuel Lines Defective	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Defective	Replace
Radiator Cradle Damaged	Replace
Gearbox Oil Sweat	Repair
Jack Missing	Replace
Tyre pressure warning light illuminated on dashboa	Repair

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.84	2.27	-	
Rear	1.62	1.77	-	
Emergency / Parking	1.35	1.46	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/40 R17	87V	Continental	Contipremuim	V	2422	4 mm
Front Right	215/40 R17	87V	Continental	Contipremuim	V	2422	4 mm
Rear Left	215/40 R17	87V	Continental	Contipremuim	V	2422	3 mm
Rear Right	185/60 R15	84H	Continental	Contipremuim	V	1714	6 mm
Spare	215/40 R17	87V	Continental	Contipremuim	V	2422	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE 1	U041600	INVALID DATA RECEIVED FROM VEHICLE DYNAMICS CONTRO	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: FRONT AND REAR NUMBER PLATES INSIDE BOOT OF VEHICLE.
Engine Compartment: Engine bay dirty. Brake fluid level ok. Radiator dented.
Interior: Vehicle interior dirty and some interior panels scratched.
Body • Exterior: Dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels.
Signs of impact damage to front of vehicle.
Brakes: Front right brake disk dust plate damaged.
Axle and Suspension: Signs of new suspension parts fitted to front of vehicle. Excessive noise coming from front and rear suspension
Tyres and Rims: Alloy rims scratched. Rear left and right tyre sizes different.
Undercarriage: Vehicle undercarriage dirty. Center exhaust bracket dented. Fuel tank scratched. Exhaust heat shields dented.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6RZNU017670
2 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE
ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

VIN: AAVZZZ6RZNU017670


3 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT


Report No: 2016194485

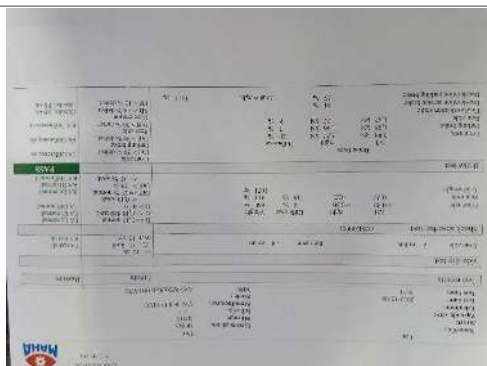DATE
08/12/2023

Brake and shock absorber report

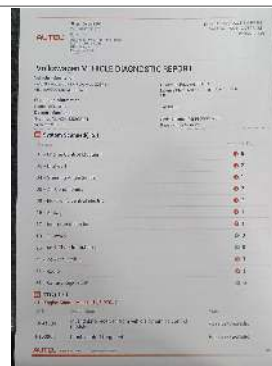

Diagnostic report page 1

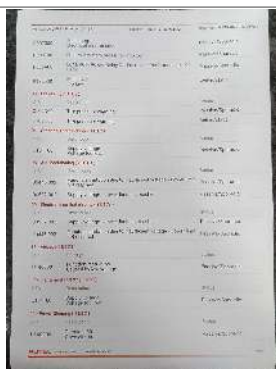

Diagnostic report page 2



Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER

VIN: AAVZZZ6RZNU017670

4 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023

INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

VIN: AAVZZZ6RZNU017670

5 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

VIN: AAVZZZ6RZNU017670
6 / 18

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



VIN PLATE OR STICKER



ADDITIONAL 9



ENGINE 1



Front chassis



Rear chassis



Manual Transmission

VIN: AAVZZZ6RZNU017670

7 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023

Oil cap and dipstick



Front Bumper



Front Bumper



Bonnet



Windscreen



Front Fender Left

VIN: AAVZZZ6RZNU017670

8 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023

Door Front Left



Door Rear Left



Rear Fender Left



Seat Front Left



Sill Panel Left



Sill Panel Left

VIN: AAVZZZ6RZNU017670

9 / 18



Seat Rear



Rocker Panel Left



Spare Tyre



Rim Spare Wheel



Inner Boot Floor Pan and Spare Wheel Well



Number Plate Front

VIN: AAVZZ6RZNU017670

10 / 18



Number Plate Rear



Parcel Tray



Boot Lid / Hatch door



Rear bumper



Rear bumper



Seat Rear

VIN: AAVZZZ6RZNU017670

11 / 18



CONDITION REPORT


Report No: 2016194485

DATE
08/12/2023

Rear Fender Right



Door Rear Right

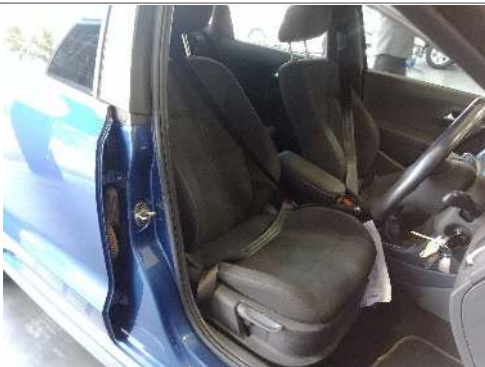

Seat Front Right



Sill Panel Right



Sun Visor Right



Sun Visor Left

VIN: AAVZZZ6RZNU017670

12 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023

Hood Lining



Door Front Right



Front Fender Right



Indicator Light Front Right



Water level



Control Arm Bush(es) Front Axle Right

VIN: AAVZZ6RZNU017670

13 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023

Rocker Panel Right



Tyre Rear Left



Control Arm Bush(es) Front Axle Left



Radiator Cradle



Engine



Tie Rod End right VIN: AAVZZZ6RZNU017670

14 / 18



Gearbox



Shock Absorber Front Right



Control Arm(s) Front Axle Right



Chassis



Belly plates



Belly plates

VIN: AAVZZ6R2NU017670

15 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023

Rear Axle



Fuel Lines



Sub Frame



CV Joint(s) Boot(s) Front Left (inner/outer)



Front Fender Right / Inner Tray



Roof

VIN: AAVZZZM1ZD017670
16 / 18



CONDITION REPORT

Report No: 2016194485

DATE
08/12/2023

Steering Wheel Trim

VIN: AAVZZZ6RZNU017670

17 / 18

VIN: AAVZZZ6RZNU017670

18 / 18