



CONDITION REPORT



Report No:
2016904811
DATE
06/06/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/06/2025		M57 Pretoria Road - 1619
Inspection Date	06/06/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	VOLKSWAGEN	Registration Number	KVM657NW
Model	POLO VIVO GP 1.4 55KW CONCEPTLINE 5-DR [2016-2018]	Register Number	
		Date Of First Licensing	
VIN	AAVZZZ6SZGU030895	Last COR	
Engine Number		License Expiry Date	31/12/2024
Doors	5	Power / Displacement	
Color	WHITE	Paint Finish	C - COMMON
Year Model	2016	Fuel	PETROL
Km Reading	200,634 KM	Transmission	MANUAL
Cab / Body Type	HATCHBACK		

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: AAVZZZ6SZGU030895



CONDITION REPORT



Report No:
2016904811
DATE
06/06/2025

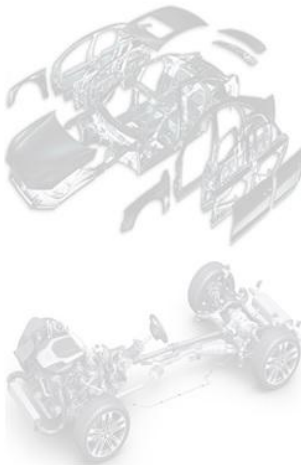

Damage	Repair Way
Windscreen Wiper Missing	Replace
Headlight Right Damaged	Repair
Seat Front Right Torn / Cut	Repair
Seat Belt Front Left Defective	Repair
Parcel Tray Missing	Replace
Window Winder front left Defective	Repair
Window Winder front right Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Residual Traces of Repair	Repair
Fuel Flap Damaged	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tie Rod End left Damaged	Replace
Tie Rod End right Cracked	Replace
Tyre Front Left Smooth	Replace
Tyre Front Right Smooth	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.6	2.9	-	
Rear	1.7	1.3	-	
Emergency / Parking	1.4	0.8	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65R14	82T	Kumho	Ecowing	V	1622	0 mm
Front Right	175/65R14	82T	Kumho	Ecowing	V	1622	0 mm
Rear Left	175/65R14	82T	Kumho	Ecowing	V	1622	3 mm
Rear Right	175/65R14	82T	Kumho	Ecowing	V	1622	3 mm
Spare	175/65R14	82T	Goodyear	Gt2	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895



CONDITION REPORT



Report No:
2016904811
DATE
06/06/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PASSIVE/SPORADIC	00532:007	SUPPLY VOLTAGE - SIGNAL TOO LOW	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got minor scratches, stone chips and dents. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895



CONDITION REPORT




Report No:


2016904811

DATE


06/06/2025

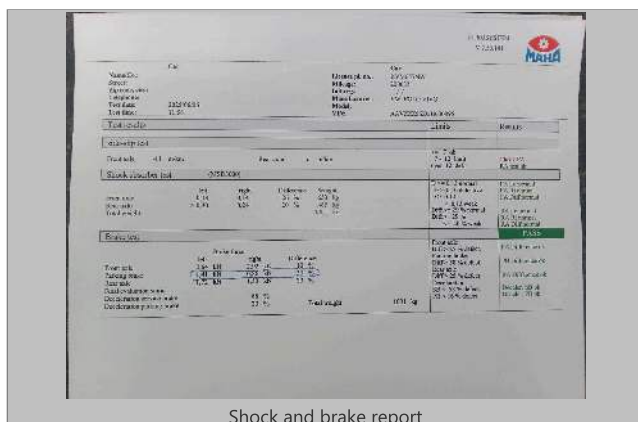

Shock and brake report

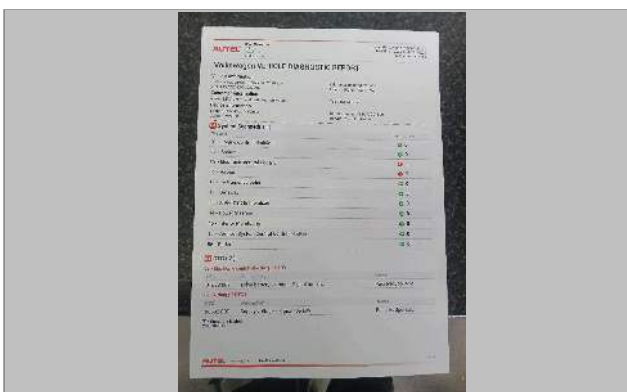

Diagnostic report

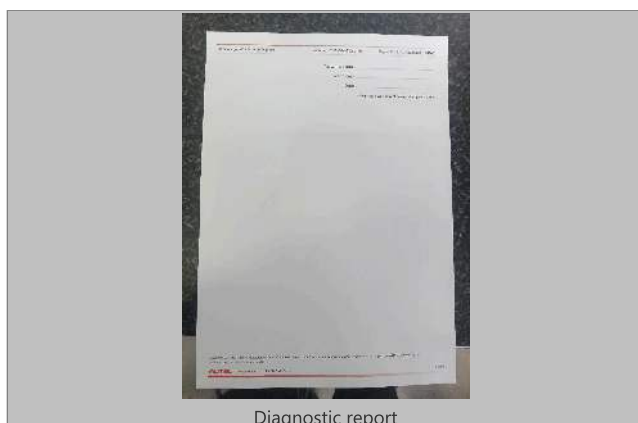

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZ6SZGU030895



CONDITION REPORT



Report No:

2016904811

DATE

06/06/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895



CONDITION REPORT



Report No:
2016904811
DATE
06/06/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895



CONDITION REPORT



Report No:


2016904811

DATE

06/06/2025



LICENSE DISC

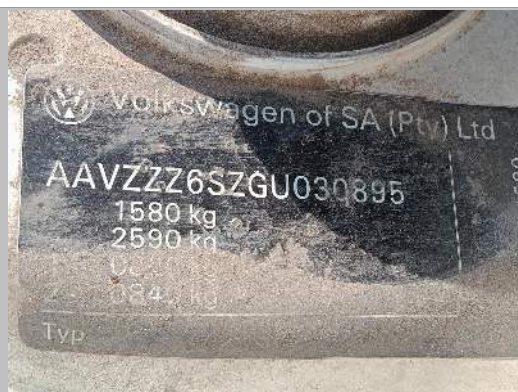

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895



CONDITION REPORT



Report No:

2016904811

DATE

06/06/2025



Expection bottle



Windscreen Wiper




Parcel Tray



Window Winder front left



Window Winder front right

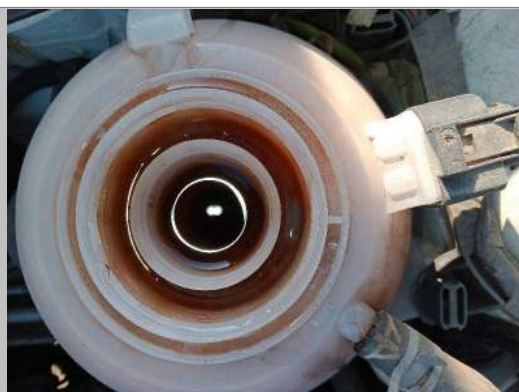

Water level

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895




CONDITION REPORT




Report No:
2016904811
DATE
06/06/2025



Headlight Right

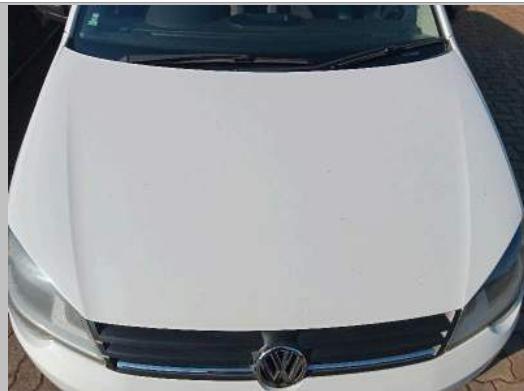

Bonnet

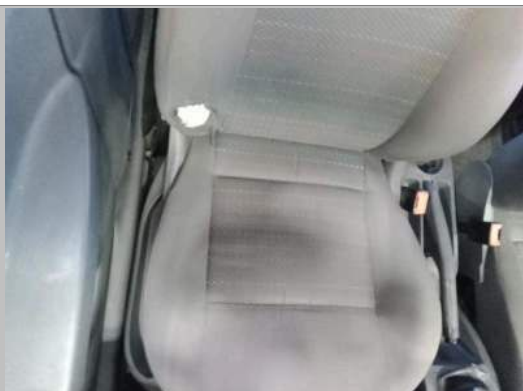

Seat Front Right



Rear bumper



Fuel Flap



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895



CONDITION REPORT



Report No:
2016904811
DATE
06/06/2025



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895




CONDITION REPORT



Report No:
2016904811
DATE
06/06/2025



Door Front Left

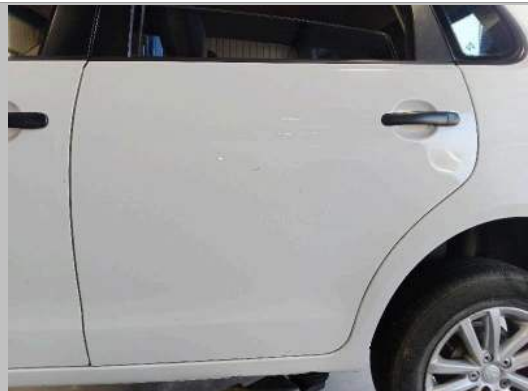

Door Rear Left



Rear Fender Left



Rear bumper



Tyre Front Left



Tie Rod End left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895



CONDITION REPORT



Report No:
2016904811
DATE
06/06/2025



Tie Rod End right




Tyre Front Right



Bolt(s) / Nut(s) Rear Wheel Left



Seat Belt Front Left

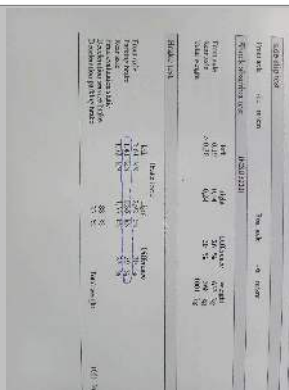

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZZ6SZGU030895