



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/01/2024		M57 Pretoria Road - 1619
Inspection Date	10/01/2024		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	KPW468NW
Model	POLO TSI	Register Number	
VIN	AAVZZAWZJU071493	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2024
Color	GREY	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	126,006 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

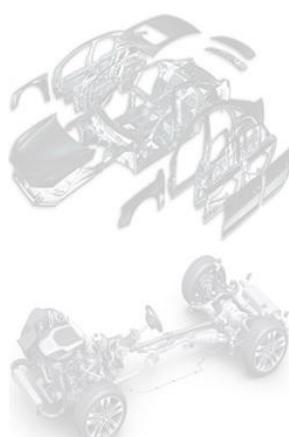

Damage	Repair Way
Engine Oil Leak	Repair
Seat Front Left Dirty	Repair
Seat Front Right Damaged	Repair
Seat Rear Dirty	Repair
Sun Visor Right Dirty	Repair
Hood Lining Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Paintwork • Scratched	Repair
Rocker Panel Left Dented	Repair
Rocker Panel Right Dented	Repair
Roof Paintwork • Scratched	Repair
Windscreen Chipped	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Tie Rod End left Damaged	Replace
Tie Rod End right Damaged	Replace
Tyre Front Left Worn	Replace
Belly plates Defective	Repair
Brakes Noisy	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AAVZZAWZJU071493

1 / 12



CONDITION REPORT

Report No: 201622334

DATE
10/01/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [kN]	Braking Force [kN]	Axle Weight [kg]	Deceleration [m/s ²]
Front	3.3	3.29	-	
Rear	2.04	1.8	-	
Emergency / Parking	0.65	1.79	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65 R15	88H	Continental	Contipremium	V	1421	0 mm
Front Right	185/65 R15	88H	Continental	Contipremium	V	1421	4 mm
Rear Left	185/65 R15	88H	Continental	Contipremium	V	1421	3 mm
Rear Right	185/65 R15	88H	Continental	Contipremium	V	1421	4 mm
Spare	185/70 R14	88H	Falken	Sincera	V	3118	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE	P06E900	ENGINE STARTER PERFORMANCE	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine bay dirty. Brake fluid level ok.

Interior: Vehicle interior dirty and so

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: 1VWAV7A0W710023924

Report No: 2016229324

2 / 12

DATE

10/01/2024

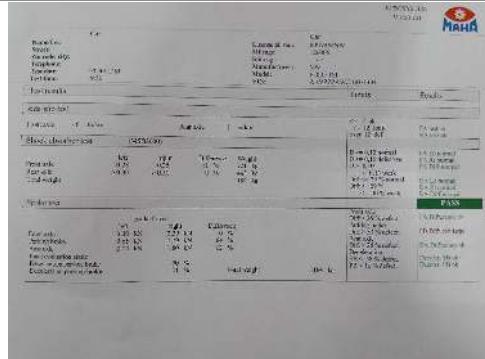

Brake and shock absorber report



Diagnostic report page 1



Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

**CONDITION REPORT****Report No: 2016223324**

VIN: AAVZZZAWZJU071493

DATE

10/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016223324

DATE

VIN: AAVZZZAW10/09/2024

4 / 12



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

VIN: AAVZZZAWZJU071493

5 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

VIN: AAVZZAWZJU071493

6 / 12



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



LICENSE DISC



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

VIN: AAVZZZAWZJU071493

7 / 12



CONDITION REPORT

Report No: 201622334

DATE
10/01/2024

VIN PLATE OR STICKER



8 / 12

ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick



Manual Transmission



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

VIN: AAVZZZAWZJU071493

9 / 12



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

Sun Visor Right



Hood Lining



Seat Front Right



Windscreen



Front Fender Right



Door Front Right



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

VIN: AAVZZZAWZJU071493

11 / 12



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

Door Rear Right



Rear Fender Right



Seat Rear



Rear bumper



Rear bumper



Boot Lid / Hatch door



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

Roof



Door Front Left



Seat Rear



Seat Front Left



Side Mirror Left



Front Bumper



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

Front Bumper



Bonnet



Engine



Water level



Inner Boot Floor Pan and Spare Wheel Well



Rocker Panel Right



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

Rocker Panel Left

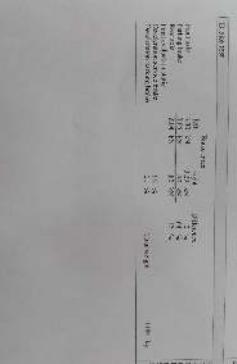


Parking Brake Performance



Tyre Front Left



Tie Rod End left

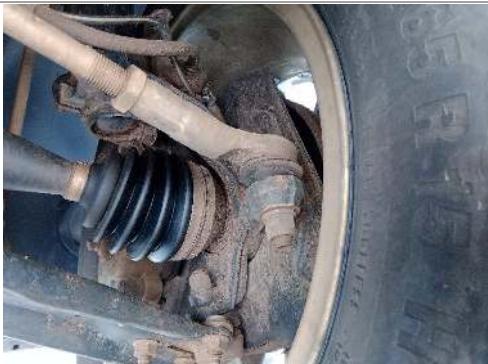

Tie Rod End right



Belly plates



CONDITION REPORT

Report No: 2016223324

DATE
10/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za