



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	09/01/2024		M57 Pretoria Road - 1619
Inspection Date	09/01/2024		Kempton Park - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	VOLKSWAGEN	Registration Number	LH00VTGP
Model	POLO TSI	Register Number	
VIN	AAVZZZAWZMU056005	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/07/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	62,675 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

**Vehicle Options & Accessories****Items**

## VEHICLE INSPECTION

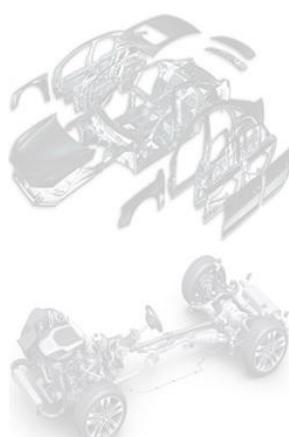

Damage	Repair Way
Engine Oil Sweat	Repair
Seat Front Left Dirty	Repair
Hood Lining Dirty	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Brake disc 1. Axle right Defective	Replace
Parking Brake Performance Left / Right Difference out of legal range	Repair
Shock Absorber Front Left Sweat	Replace
Belly plates Defective	Repair



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

### Brakes

#### Brake Test Results

	Left	Right		
	Braking Force [kN]	Braking Force [kN]	Axle Weight [kg]	Deceleration [m/s <sup>2</sup> ]
Front	2.79	2.94	-	
Rear	1.15	1.12	-	
Emergency / Parking	1.31	0.78	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65 R15	91H	Firestone	Touring	V	3522	4 mm
Front Right	195/65 R15	91H	Firestone	Touring	V	3622	4 mm
Rear Left	185/65 R15	88H	Continental	Contipremium	V	2521	4 mm
Rear Right	185/65 R15	88H	Continental	Contipremium	V	0221	4 mm
Spare	185/65 R15	88H	Continental	Contipremium	V	0221	7 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

No	System	Code	Description	Status
1	01-ENGINE CONTROL MODULE	P06E900	ENGINE STARTER PERFORMANCE	

### Inspection Conditions

No Test Drive

Rain at time of inspection

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine bay dirty. Brake fluid level ok. Signs of rodent in engine bay.

Interior: Vehicle interior dirty and soot

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



# CONDITION REPORT

VIN: AAV777AWZM1056056  
Report No. 201622756

2 / 12

**DATE**

09/01/2024



### Front chassis



## Rear chassis

Brake and shock absorber report

Diagnostic report page 1

Diagnostic report page 2



Diagnostic report page 3

**CONDITION REPORT****Report No: 2016222756**

VIN: AAVZZZAWZMU056005

**DATE**

09/01/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016222756

DATE

VIN: AAVZZZAW091092024

4 / 12



Triangle



Spare wheel and Accessories



Oil cap and dipstick.



Automatic Transmission.



FRONT RIGHT CORNER



REAR LEFT CORNER



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

VIN: AAVZZZAWZMU056005

5 / 12

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

VIN: AAVZZZAWZMU056005

6 / 12



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

VIN: AAVZZZAWZMU056005

7 / 12



# CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

VIN: AAVZZZAWZMU056005

9 / 12



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

VIN PLATE OR STICKER



ENGINE 1



Hood Lining



Sill Panel Right



Sill Panel Right



Rear bumper



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

VIN: AAVZZZAWZMU056005

11 / 12



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

Rear bumper



Sill Panel Left



Sill Panel Left



Seat Front Left



Bonnet



Windscreen



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

Boot Lid / Hatch door



Engine



Brake disc 1. Axle right



Rear Fender Left



Door Rear Left



Door Front Left



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

Front Fender Left



Shock Absorber Front Left



Door Front Right



Door Rear Right



Rear Fender Right



Belly plates



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

Inner Boot Floor Pan and Spare Wheel Well



Water level



## CONDITION REPORT

Report No: 2016222756

DATE  
09/01/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)