



CONDITION REPORT

Report No: 2016331658

DATE
08/04/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/04/2024		M57 Pretoria Road - 1619
Inspection Date	08/04/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	ISUZU	Registration Number	FVG261L
Model	D-MAX	Register Number	
VIN	ACVMRRAR4L4093798	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/05/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	53,303 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Fan Damaged	Replace
Hooter Defective	Repair
Dash Padding Damaged	Repair
Steering Wheel Trim Damaged	Repair
Number Plate Front Missing	Replace
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Residual Traces of Repair	Repair
Bonnet slam plate (Shock tower/ Inner tray) Welded	Repair
Front Fender Left Dented	Repair
Front Fender Right Paintwork • Pitmarks	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Right / Inner Tray Dented	Repair
Door Front Left Dented	Repair
Door Front Right Dented	Repair
Tailgate Dented	Repair
Windscreen Cracked	Replace
Tyre Rear Left Smooth	Replace
Main Beam Left Welded	Repair
Main Beam Right Welded	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
Body exterior	Signs of spray work done on some body panels
Airbag light on	Repair
R/F fender liner damage	Replace
Body exterior	Vehicle is cut and join

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ACVMRRAR4L4093798

1 / 12



CONDITION REPORT

Report No: 2016331658

DATE
08/04/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.8	3.8	-	
Rear	1.7	1.5	-	
Emergency / Parking	2.2	2.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205R16	110/108S	Goodyear	Wrangler	V	0922	1 mm
Front Right	205R16	110/108S	Goodyear	Wrangler	V	0922	4 mm
Rear Left	205R16	110/108S	Goodyear	Wrangler	V	0922	0 mm
Rear Right	205R16	110/108S	Goodyear	Wrangler	V	0922	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1		B005200	AIRBAG CIRCUIT ACTIVATED (CRASH)	PRESENT

Inspection Conditions

No Test Drive
 Rain at time of inspection
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksoord, Pretoria, 0200
 Phone: 012 542 4867
 www.dekraauto.co.za



CONDITION REPORT


VIN: ACVAPRA2016331658

Report No: 2016331658

2 / 12

DATE


08/04/2024

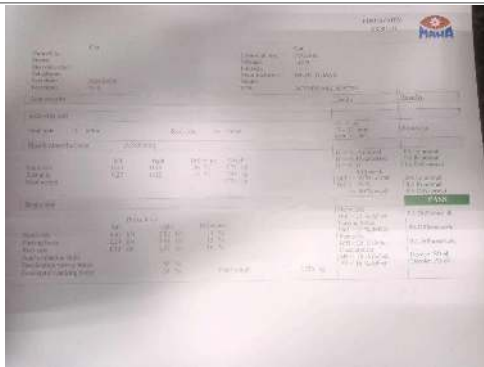

Shock and brake report



Diagnostic report

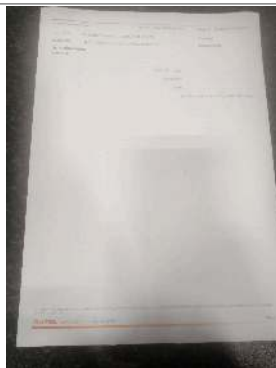

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016331658**

VIN: ACVMRRAR4L4093798

DATE

08/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016331658

VIN: ACVMRRAPN1003798
DATE: 08/04/2024
4 / 12



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016331658****DATE**
08/04/2024

VIN: ACVMRRAR4L4093798

5 / 12



CONDITION REPORT

Report No: 2016331658

DATE
08/04/2024

VIN: ACVMRRAR4L4093798

6 / 12



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

**CONDITION REPORT****Report No: 2016331658****DATE**
08/04/2024

VIN: ACVMRRAR4L4093798

7 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016331658

DATE
08/04/2024

ENGINE 1



ENGINE 2

VIN: ACVMRRR4L4093798
8 / 12

CHASSIS



Coolant bottle



Oil cap and dipstick



Manual

**CONDITION REPORT****Report No: 2016331658****DATE**
08/04/2024

VIN: ACVMRRAR4L4093798

9 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016331658

DATE
08/04/2024

No spare wheel



Water level

VIN: ACVMRRAR4L4093798

10 / 12



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)



Bonnet slam plate (Shock tower/ Inner tray)



Grill

**CONDITION REPORT****Report No: 2016331658****DATE**
08/04/2024

VIN: ACVMRRAR4L4093798

11 / 12



CONDITION REPORT

Report No: 2016331658

DATE
08/04/2024

Bonnet



Fan



Fan



Bonnet



Windscreen



Dash Padding

**CONDITION REPORT**

Report No: 2016331658

DATE
08/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016331658

DATE
08/04/2024

Steering Wheel Trim



Hooter



Front Fender Right / Inner Tray



Door Front Right



Front Fender Right



Front Bumper

**CONDITION REPORT**

Report No: 2016331658

DATE
08/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016331658

DATE
08/04/2024


Front Bumper



Number Plate Front



Front Fender Left

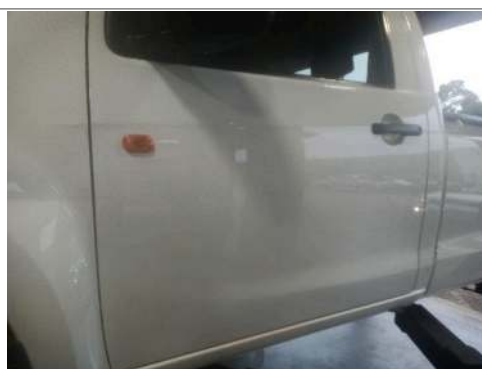

Door Front Left



Rear Fender Left



Rear Fender Right

**CONDITION REPORT**

Report No: 2016331658

DATE
08/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016331658

DATE
08/04/2024

Tailgate



Tyre Rear Left



Engine



Main Beam Right



Main Beam Left

**CONDITION REPORT****Report No: 2016331658****DATE**
08/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za