

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	21/12/2023		M57 Pretoria Road - 1619
Inspection Date	21/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	ISUZU	Registration Number	HT06CWGP
Model	D MAX	Register Number	
VIN	ACVMRRAR5J4021120	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/10/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	181,952 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Tail Light Right Broken	Replace
Seat Front Right Torn / Cut	Repair
Side Mirror Right Damaged	Replace
Windscreen Cracked	Replace
Tyre Front Right Smooth	Replace
Spare Tyre Smooth	Replace



Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.3	3.8	-	
Rear	2.9	3.2	-	
Emergency / Parking	3.1	3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205R16	110/108S	Continental	Contact	V	1821	1 mm
Front Right	205R16	110/108S	Continental	Contact	V	1821	0 mm
Rear Left	245/70R16	111/109T	Goodyear	Wrangler	V	0819	7 mm
Rear Right	245/70R16	111/109T	Goodyear	Wrangler	V	2923	6 mm
Spare	205R16	110/108T	Continental	Contact	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. SHOCK TEST NOT PERFORMED DUE TO SHOCK MACHINE NOT WORKING.
Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels and.
Axle and Suspension: Shock test not performed.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




Shock and brake report



Diagnostic test



Sparewheel

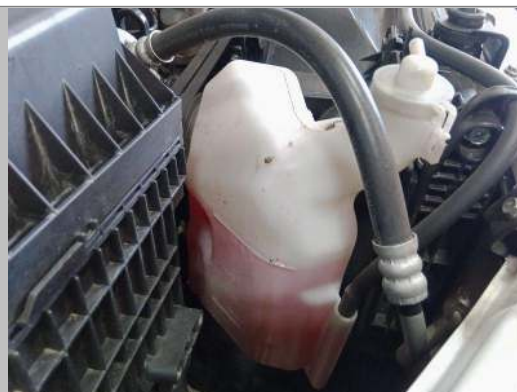

Coolant reservoir




Oil cap and dipstick



Manual



Dipstick cut

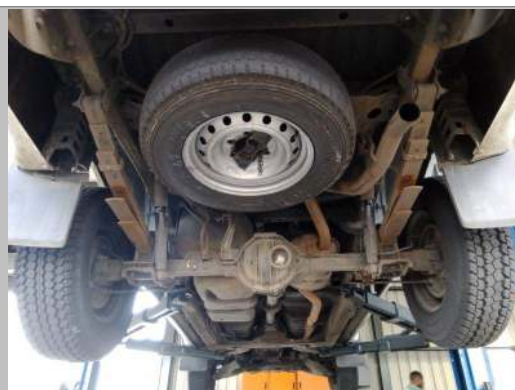

Rear end



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

VIN: ACVMRRAR5J4021120


7 / 8



LR TYRE TREAD



RR TYRE TREAD

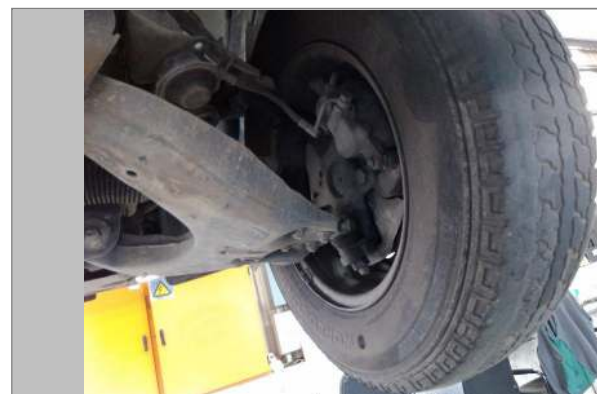

LF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS




Windscreen



Tail Light Right



Side Mirror Right

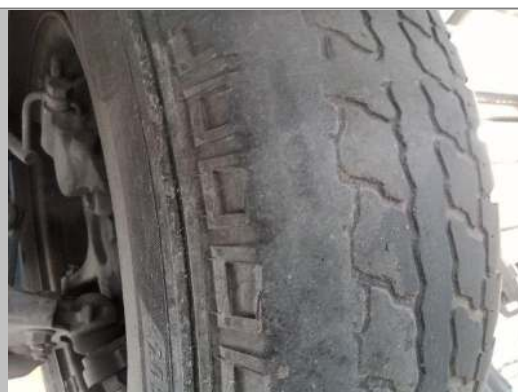

Tyre Front Right



Engine



Spare Tyre



Seat Front Right



CONDITION REPORT

Report No: 2016209209

DATE
21/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za