

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/02/2024		M57 Pretoria Road - 1619
Inspection Date	22/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	CHEVROLET	Registration Number	FH56VVGP
Model	UTILITY	Register Number	
VIN	ADMLF4MR9G4777469	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/08/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	109,082 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Hoses Oil Leak	Repair
Expansion Bottle Damaged	Replace
Head Light Switch Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Defective	Repair
Hood Lining Dirty	Repair
Door Panel Front Right Defective	Repair
Mirror Adjusters Defective	Repair
Steering Wheel Trim Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Paintwork • Scratched	Repair
Roof Paintwork • Scratched	Repair
Load Body Paintwork • Scratched	Repair
Stabilizer Mounting Front Left Defective	Repair
Tyre Front Left Damaged	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Left Defective	Replace
Spare Tyre Damaged	Replace
Rim Front Left Scratched	Repair

Damage

Repair Way

Engine to silencer pipe Defective
Silencer Corrosion
Gearbox Oil Leak
Oil sweat on power steering reservoir

Repair
Replace
Repair
Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.69	2.74	-	
Rear	2.36	2.42	-	
Emergency / Parking	1.58	1.41	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65 R14	86H	Dunlop	Sp-Sport	V	0816	0 mm
Front Right	185/65 R14	86H	Dunlop	Sp-Sport	V	3018	0 mm
Rear Left	185/65 R14	86H	Dunlop	Sp-Sport	V	0816	1 mm
Rear Right	185/65 R14	86H	Dunlop	Sp-Sport	V	0916	2 mm
Spare	185/65 R14	86H	Dunlop	Sp-Sport	V	0916	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ELECTRONIC BRAKE CONTROL MODULE	C0245:5A	WHEEL SPEED SENSOR FREQUENCY NOT PLAUSIBLE	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: MINOR DENTS, SCRATCHES & STONE CHIPS ON VARIOUS BODY PANELS. SOME BODY PANELS MISAGLINED. SIGNS OF SPRAY WORK DONE ON VARIOUS BODY PANELS. INTERIOR, ENGINE BAY & UNDERCARRIAGE IS DIRTY.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual Transmission



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Oil cap and dipstick



Front chassis



Rear chassis



Spare wheel

VIN: ADMLF4MR9G4777469

7 / 14



Spare wheel Accessories



ENGINE 1

VIN: ADMLF4MR9G4777469

8 / 14



VIN PLATE OR STICKER



LICENSE DISC

BRAKE AND SHOCK REPORT			
Vehicle No:	544	Car:	MAHA
Make:	MAHA	Model:	MAHA
Registration:	544	Year:	2016
Test Date:	2024/02/22	Test Time:	15:08
Test results			
Shock absorber test			
Front axle	Left	Right	Weight
Shock absorber	0.11	0.11	11.11
Shock absorber	0.11	0.11	11.11
Brake test			
Front axle	Left	Right	Weight
Brake force	2.18	2.18	11.11
Brake force	2.18	2.18	11.11
Total weight			
1200 kg			


BRAKE AND SHOCK REPORT

DIAGNOSTIC REPORT PAGE 1	
Vehicle No:	544
Make:	MAHA
Model:	MAHA
Year:	2016
Test Date:	2024/02/22
Test Time:	15:08
Test results	
Shock absorber test	
Front axle	Left
Shock absorber	0.11
Shock absorber	0.11
Brake test	
Front axle	Left
Brake force	2.18
Brake force	2.18
Total weight	
1200 kg	

DIAGNOSTIC REPORT PAGE 1

VIN: ADMLF4MR9G4777469

9 / 14

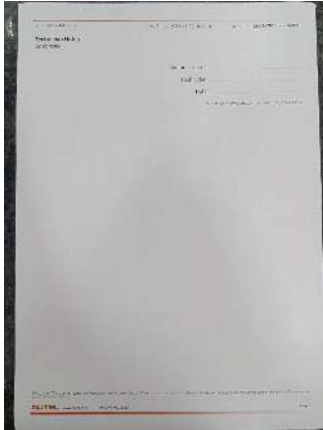

DIAGNOSTIC REPORT PAGE 2



Steering Wheel Trim

VIN: ADMLF4MR9G4777469

10 / 14



Hood Lining



Seat Front Right



Rear Fender Right



Door Front Right

VIN: ADMLF4MR9G4777469

11 / 14



Front Fender Right



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left

VIN: ADMLF4MR9G4777469

13 / 14



Rear Fender Left



Rear bumper



Rear bumper



Tailgate



Door Panel Front Right



Door Panel Front Right



Seat Front Left



Sill Panel Left



Load Body



Tailgate



Tailgate



Roof



Head Light Switch



Mirror Adjusters



Mirror Adjusters



Water level



Expansion Bottle



Rim Front Left



Tyre Rear Left



Tyre Front Left



Tyre Front Right



Engine



Gearbox



Spare Tyre



Engine to silencer pipe



Silencer



Hoses



Stabilizer Mounting Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za