

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/03/2024		M57 Pretoria Road - 1619
Inspection Date	18/03/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	ISUZU	Registration Number	KMK001NW
Model	KB 250	Register Number	
VIN	ADMNRCHR4H4825370	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/06/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	96,547 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Center Console / Cubbyhole + Lid Damaged	Replace
Engine Management Lights Set	Repair
Windscreen Wiper Damaged	Replace
Seat Front Right Worn	Repair
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Residual Traces of Repair	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Repair
Tyre Front Right Worn	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.41	4.96	-	
Rear	3.06	3.29	-	
Emergency / Parking	3.22	2.64	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/70R16	111H	General	Radial	V	4421	1 mm
Front Right	245/70R16	111H	General	Radial	V	4421	0 mm
Rear Left	245/70R16	111H	General	Radial	V	5021	1 mm
Rear Right	245/70R16	111T	Goodyear	Wrangler	V	0421	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: SIGNS OF REPAIR WORK DONE TO SOMEBODY PANELS. POOR ALIGNMENT TO SOME BODY PANELS. ACCORDING TO THE AGE AD MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)




INTERIOR (FRONT DRIVER DOOR)




Manual




LF TYRE TREAD

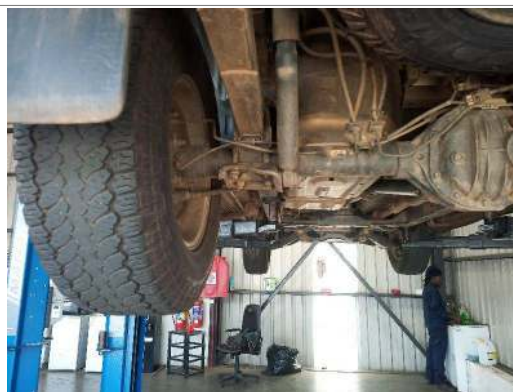

LR TYRE TREAD

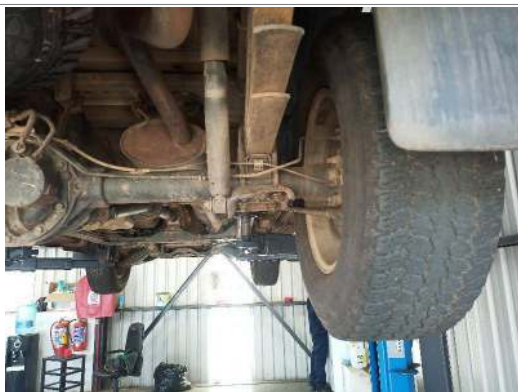

RR TYRE TREAD

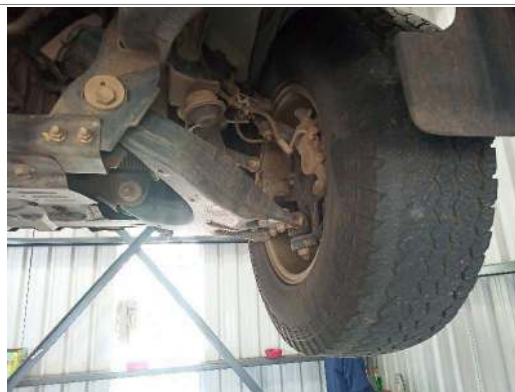

RF TYRE TREAD



Oil cap and dipstick



Undercarriage front.



Undercarriage rear.




ENGINE 1




VIN PLATE OR STICKER




LICENSE DISC

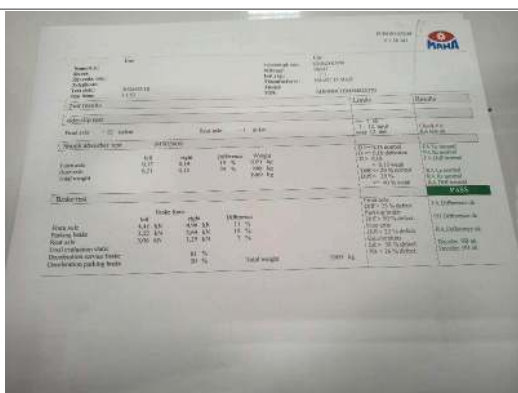

BRAKE AND SHOCK REPORT

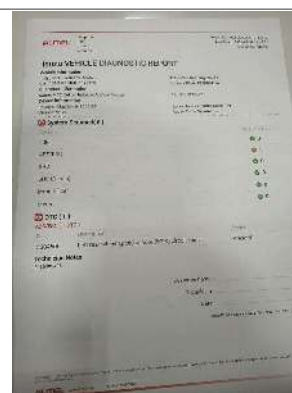

DIAGNOSTIC REPORT

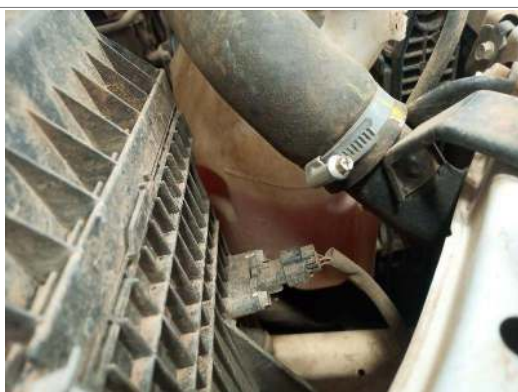

Water level



Front Bumper



Front Bumper



Bonnet




Front Fender Left



Door Front Left



Door Rear Left

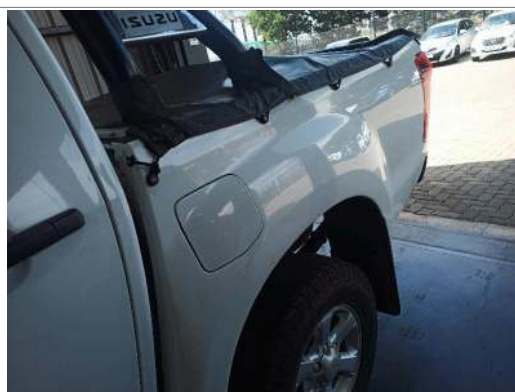

Rear Fender Left



Tailgate



Rear bumper



Rear bumper



Rear Fender Right



Front Fender Right




Door Front Right



Door Rear Right



Seat Front Right

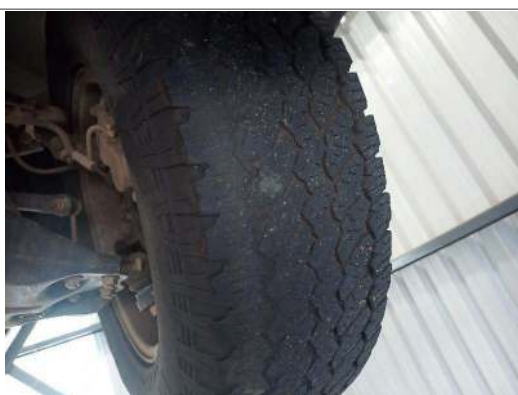

Tyre Front Right



Grill



Windscreen Wiper



Engine Management Lights



Center Console / Cubbyhole + Lid



Center Console / Cubbyhole + Lid



CONDITION REPORT

Report No: 2016309496

DATE
18/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za