



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/01/2024		M57 Pretoria Road - 1619
Inspection Date	18/01/2024		Kempton Park -

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	NISSAN	Registration Number	FK48JCGP
Model	NP300 HARDBODY	Register Number	
VIN	ADNCDGD22ZR088423	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/01/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	161,494 KM	Fuel	PETROL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION



Damage	Repair Way
Engine Oil Leak	Repair
Tail Light Left Damaged	Replace
Headlight Left Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Door Panel Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
C • Pillar Left Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Replace
Steering Stopper Left Damaged	Replace
Steering Stopper Right Damaged	Replace
Torsion Bar Front Left Deformed	Replace
Alignment Poor Alignment	Repair
Tyre Front Right Damaged	Replace
Center Prop Shaft Rubber(s) Worn	Repair



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	2.65	3.08	-	
Rear	2.29	2.11	-	
Emergency / Parking	2.73	3.11	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	245/70R16	107S	Bridgestone	Radial	V	3319	2 mm
Front Right	245/70R16	107S	Bridgestone	Radial	V	3219	2 mm
Rear Left	245/70R16	107S	Bridgestone	Radial	V	3319	2 mm
Rear Right	245/70R16	107S	Bridgestone	Radial	V	3319	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: Sound wiring loose in vehicle
 Body • Exterior: Minor dents and scratches and stone chip

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: RDNCNGD2016002602

Report No: 2016002602


2 / 12

DATE

18/01/2024

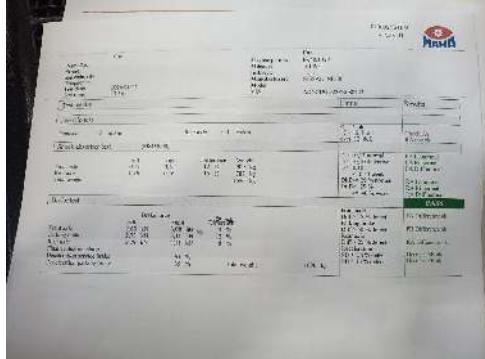

Brake and shock test

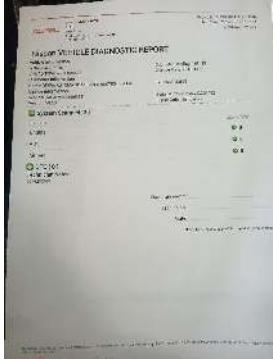

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



CONDITION REPORT

Report No: 2016232602

VIN: ADNCDGD22ZR088423

DATE

18/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232602

DATE

VIN: ADNCDGD2070092024

8/09/2024

4 / 12



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

VIN: ADNCDGD22ZR088423

5 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

VIN: ADNCDGD22ZR088423

6 / 12



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

VIN: ADNCDGD22ZR088423

7 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

ADDITIONAL 3



ADDITIONAL 4



ADDITIONAL 10



ADDITIONAL 11



Water level



Headlight Left





CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

VIN: ADNCDGD22ZR088423

9 / 12



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

Tail Light Left



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

VIN: ADNCDGD22ZR088423

11 / 12



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

Door Rear Left



VIN: ADNCDGD22ZR088423

12 / 12



Rear Fender Left



Tailgate



Rear bumper



Rear Fender Right



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

Front Fender Right



Door Front Right



Door Rear Right



Seat Front Right



Seat Front Left



Door Panel Front Right



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

Engine



Tyre Front Right



Center Prop Shaft Rubber(s)



Torsion Bar Front Left



Steering Stopper Left



Steering Stopper Left



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

Steering Stopper Right



Steering Stopper Right



Alignment



Alignment



CONDITION REPORT

Report No: 2016232602

DATE
18/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za