



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/02/2024		M57 Pretoria Road - 1619
Inspection Date	19/02/2024		Kempton Park - GT


Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	NISSAN	Registration Number	JR23PWGP
Model	NP200	Register Number	
VIN	ADNUSN1D5U0180197	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/08/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	74,516 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

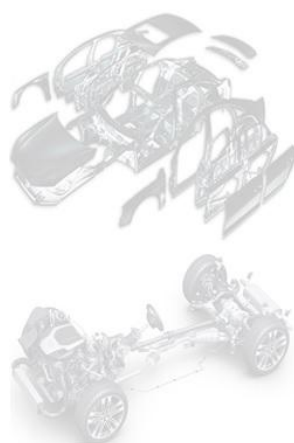

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Hoses Sweat	Repair
Interior Lights Damaged	Replace
Indicator Light Front Right Damaged	Repair
Park Light Front Left Damaged	Repair
Park Light Front Right Damaged	Repair
Tail Light Left Cracked	Replace
Number Plate Light Left Damaged	Repair
Number Plate Light Right Damaged	Repair
Door Panel Front Left Defective	Repair
Door Panel Front Right Defective	Repair
Door Sealing Rubber Front Right Damaged	Replace
Steering Wheel Trim Defective	Repair
Side Mirror Left Paintwork • Scratched	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Grill Paintwork • Scratched	Repair
Bonnet Dented	Repair
Bonnet slam plate (Shock tower/ Inner tray) Welded	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Tailgate Dented	Repair
Fuel Flap Defective	Repair
Sill Panel Right Paintwork • Scratched	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: ADNUSN1D5U0180197

1 / 19



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Damage	Repair Way
Rocker Panel Left Damaged	Repair
Rocker Panel Right Damaged	Repair
Roof Dented	Repair
Load Body Defective	Repair
Speed Sensor Damaged	Replace
Brake Piping Defective	Repair
Steering box Sweat	Repair
Shock Absorber Front Right Sweat	Replace
Control Arm(s) Front Axle Left Defective	Replace
Tyre Front Left Defective	Replace
Tyre Front Right Torn / Cut	Replace
Tyre Rear Right Worn	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Right Missing	Replace
Chassis Damaged	Repair
Sub Frame Dented	Repair
Engine to silencer pipe Defective	Repair
Catalytic converter Missing	Replace
Belly plates Damaged	Repair
Gearbox Oil Sweat	Repair
Engine Noise Excessive	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Undercarriage	Exhaust loose.
Undercarriage	Non standard exhaust fitted to vehicle
Interior	Loose sound wiring inside of vehicle
Engine	Oil sweat power steering reservoir.
Engine	Battery loose
Undercarriage	Bottom of engine and gearbox covered.
Axle and Suspension	Front left and right stabilizer bar bracket bend
Brakes	Rear left brake piping bend
Brakes	Rear left speed sensor damaged
Steering	Front sway bar defective
Tyres and Rims	Hubcaps scratched
Tyres and Rims	Front left hubcap damaged
Axle and Suspension	Front left and right top shock mountings damaged
Axle and Suspension	Abnormal noise coming from front and rear suspensi
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips on some body panels
Body and Exterior	Spray work on some body panels
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Front right inner fender liner damaged
Body and Exterior	Signs of impact damage to front of vehicle
Speedometer not working	Repair
Body and Exterior	Signs of hail damage on some body panels
Engine	Engine bay dirty. Brake fluid level ok.
Body and Exterior	Front right inner fender liners damaged
Tyres and rims	Spare wheel missing
Warning lights illuminated on dashboard	Repair
Body and Exterior	Signs of impact damage to front of vehicle
Tyres and Rims	Front and rear tyre sizes different

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.04	3.02	-	
Rear	1.42	1.7	-	
Emergency / Parking	1.11	1.11	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

VIN: SAHWSN12516190197
Report No: 2016292800
2 / 19
DATE
19/02/2024

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60 R15	84H	Continental	Contipremuim	V	3622	3 mm
Front Right	185/60 R15	88H	Firestone	Touring	V	1079	3 mm
Rear Left	185/65 R15	92T	Barum	Brillantis	V	4319	5 mm
Rear Right	185/65 R15	88H	Cachland	CH-268	V	3918	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	BCM	000100	FRONT WINDSHIELD WIPER PARK CIRCUIT	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

Report No: 2016272800

VIN: ADNUSN1D5U0180197

DATE

3/19

19/02/2024

Vehicle Information				Inspection Results			
Model	2014	Year	2014	Engine	1.8L	Transmission	5-Speed
Make	DAEWOO	Model	LANOS	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01

Brake and shock absorber report

Vehicle Information				Inspection Results			
Model	2014	Year	2014	Engine	1.8L	Transmission	5-Speed
Make	DAEWOO	Model	LANOS	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01
Engine	1.8L	Transmission	5-Speed	Color	White	Registration	2014/01/01

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



CONDITION REPORT

Report No: 2016272800

DATE
VIN: ADNUSN1DE1019024
19/02/2024
4 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

VIN: ADNUSN1D5U0180197

5 / 19



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

VIN: ADNUSN1D5U0180197

6 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

VIN: ADNUSN1D5U0180197
8 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Front chassis



Rear chassis



Manual Transmission



Oil cap and dipstick



Door Panel Front Right



Door Panel Front Left



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

VIN: ADNUSN1D5U0180197
10 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Door Sealing Rubber Front Right



Sill Panel Right



Rear Fender Right



Door Front Right



Front Fender Right



Side Mirror Right



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

VIN: ADNUSN1D5U0180197
12 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Front Bumper



Front Bumper



Bonnet



Grill



Front Fender Left



Side Mirror Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

VIN: ADNUSN1D5U0180197
14 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Door Front Left



Rear Fender Left

NUSN1D5U0180197

15 / 19



Tailgate



Load Body



Load Body



Load Body



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

VIN: ADNUSN1D5U0180197
16 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Tail Light Left



Fuel Flap

VIN: ADNUSN1D5U0180197

17 / 19



Engine Wiring



Water level



Engine Wiring



Shock Absorber Front Right



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

VIN: ADNUSN1D5U0180197
18 / 19

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Bolt(s) / Nut(s) Front Wheel Right



Rocker Panel Right



Bolt(s) / Nut(s) Rear Wheel Right



Rocker Panel Left

VIN: ADNUSN1D5U0180197
19 / 19

Rocker Panel Left



Bolt(s) / Nut(s) Front Wheel Left



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024


Tyre Front Left



Engine Wiring



Engine Wiring

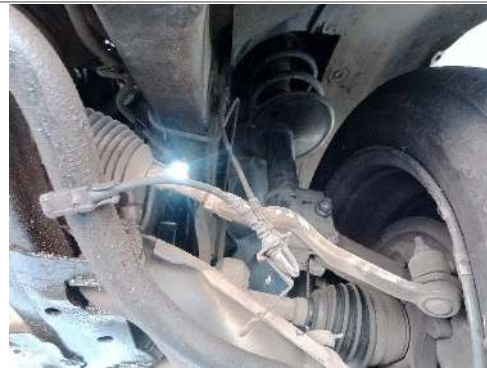

Speed Sensor



Speed Sensor



Tyre Front Right



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Engine



Belly plates



Engine



Chassis



Chassis



Chassis



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Belly plates



Catalytic converter



Engine to silencer pipe



Engine to silencer pipe



Engine to silencer pipe



Tyre Rear Right



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Brake Piping



Engine Wiring



Speed Sensor



Control Arm(s) Front Axle Left



Sub Frame



Steering box



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Gearbox



Bonnet slam plate (Shock tower/ Inner tray)



Hoses



Roof



Steering Wheel Trim



Number Plate Light Left



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016272800

DATE
19/02/2024

Number Plate Light Right



Indicator Light Front Right



Park Light Front Left



Park Light Front Left



Park Light Front Right



Interior Lights

**CONDITION REPORT****Report No: 2016272800****DATE**
19/02/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za