

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	08/01/2024		M57 Pretoria Road - 1619
Inspection Date	08/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	KSN522MP
Model	NP200	Register Number	
VIN	ADNUSN365U0188001	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	30/11/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	77,874 KM	Fuel	DIESEL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Headlight Left Cracked	Replace
Seat Front Right Torn / Cut	Repair
Tailgate Hinge Left Damaged	Replace
Tailgate Hinge Right Damaged	Replace
Roof Residual Traces of Repair	Repair
Windscreen Cracked	Replace
Shock Absorber Rear Right Sweat	Replace
Wheel bearing Front Left Loose / Excessive Play	Repair
Tyre Front Right Damaged	Replace
Tyre Rear Left Smooth	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.3	3.2	-	
Rear	1.2	1.5	-	
Emergency / Parking	1	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	92T	Barum	Brilliantis	V	4820	2 mm
Front Right	185/65R15	92T	Barum	Brilliantis	V	4820	5 mm
Rear Left	185/65R15	92T	Barum	Brilliantis	V	4620	0 mm
Rear Right	185/60R15	84H	BF Goodrich	Advantage	V	0220	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE NORMAL WEAR AND TEAR MARKS ON BODY INTERIOR EXTERIOR AND MECHANICAL ENGINEERING PARTS.

Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




Expansion bottle




Oil cap and dipstick



L/R quarter window broken.

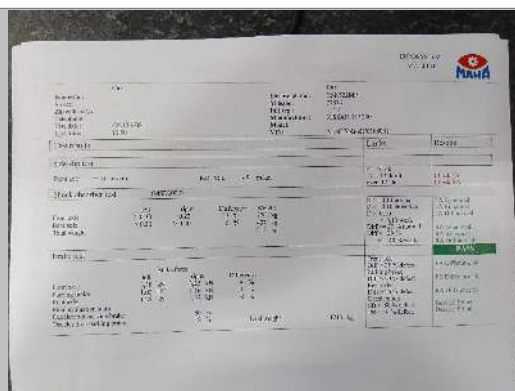

Shock and brake report

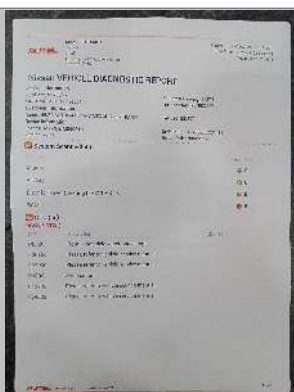

Diagnostic test



Diagnostic test




CONDITION REPORT

Report No: 2016221031

VIN: ADNUSN365U0188001

DATE
3/9
08/01/2024

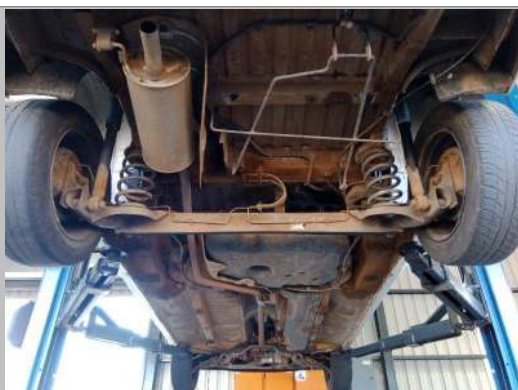

Rear end



No sparewheel



Manual



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: ADNUSN365U0188001

7 / 9



LF TYRE TREAD



LR TYRE TREAD




RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

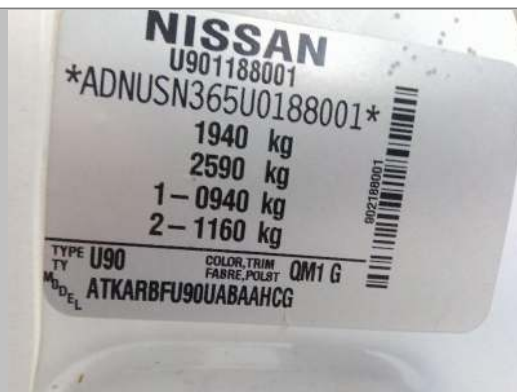

VIN PLATE OR STICKER

VIN: ADNUSN365U0188001

9 / 9



ENGINE 1



CHASSIS



ENGINE 2



Windscreen



Headlight Left



Tailgate Hinge Left



Tailgate Hinge Right



Tyre Front Right



Tyre Rear Left



Shock Absorber Rear Right



Seat Front Right



Seat Front Right



Roof



Roof



CONDITION REPORT

Report No: 2016221031

DATE
08/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za