



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/12/2023		M57 Pretoria Road - 1619
Inspection Date	20/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	HNL870FS
Model	RANGER	Register Number	
VIN	AFAGXXMJ2GHU44411	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/12/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	211,942 KM	Fuel	DIESEL
Cab / Body Type	SUPER CAB	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION



Damage	Repair Way
Engine Oil Leak	Repair
Dim Light Right Malfunction	Repair
Seat Front Right Torn / Cut	Repair
Door Handle Rear Left Damaged	Replace
Door Handle Rear Right Damaged	Replace
Number Plate Rear Missing	Replace
Side Mirror Right Cracked	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Right Dented	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Windscreen Chipped	Repair
Brake Drum 2. Axle left Defective	Repair
Rebound Rubber Front Axle Left Damaged	Replace
Rebound Rubber Front Axle Right Damaged	Replace
Gearbox Oil Leak	Repair
Differential Defective	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023**Brakes****Brake Test Results**

No Brake Test on a brake test machine has been performed.

	Left	Right	Axe Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	-	-	-	-
Rear	-	-	-	-
Emergency / Parking	-	-	-	-

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	275/70R16	114T	Lanigator	Catchfors	V	1821	3 mm
Front Right	275/70R16	114T	Lanigator	Catchfors	V	1821	3 mm
Rear Left	275/70R16	114T	Lanigator	Catchfors	V	1821	4 mm
Rear Right	275/70R16	114T	Lanigator	Catchfors	V	1821	4 mm
Spare	215R15	109/107S	Dunlop	Sp sport	V	1317	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Vehicle got minor scratches, stone chips and dents on some body panels

Brakes: No brake test done vehicle is 4 wd

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: AFAGYNUJ2016207091

Report No: 2016207091


2 / 12

DATE


20/12/2023

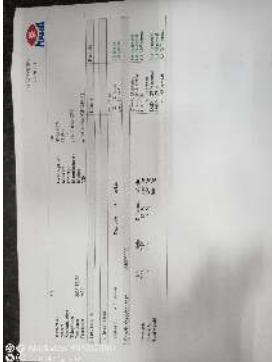

Shock and brake report

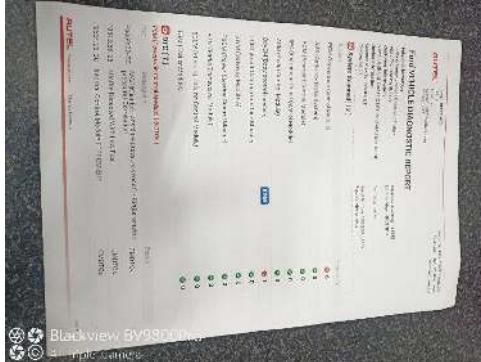

Diagnostic report

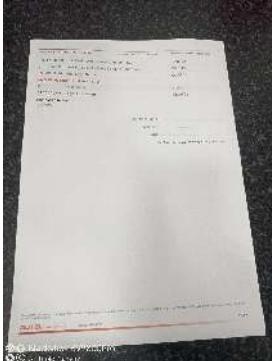

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

**CONDITION REPORT****Report No: 2016207091**

VIN: AFAGXXMJ2GHU44411

DATE

20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207091

DATE

VIN: AFAGXXMJ2011242023

20/12/2023

4 / 12



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

VIN: AFAGXXMJ2GHU44411

5 / 12

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

VIN: AFAGXXMJ2GHU44411

6 / 12



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023


VIN: AFAGXXMJ2GHU44411

7 / 12



CONDITION REPORT

Report No: 2016207091

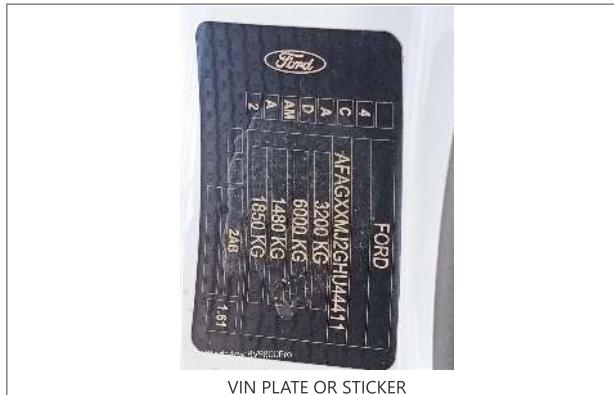DATE
20/12/2023



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

VIN: AFAGXXMJ2GHU44411

9 / 12



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

Manual



Water level



Seat Front Right



Door Handle Rear Right



Door Handle Rear Left



Windscreen



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

VIN: AFAGXXMJ2GHU44411

11 / 12



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

Front Fender Right



Front Bumper



Front Bumper



Door Front Left



Door Rear Left



Rear Fender Left



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

Number Plate Rear



Tailgate



Rear bumper



Rear bumper



Rear Fender Right



Door Front Right



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

Door Rear Right



Side Mirror Right



Brake Drum 2. Axle left



Engine



Gearbox



Differential



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

Differential



CV Joint(s) Boot(s) Front Right (inner/outer)



Rebound Rubber Front Axle Right



Rebound Rubber Front Axle Left



Dim Light Right



CONDITION REPORT

Report No: 2016207091

DATE
20/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za