



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/12/2023		M57 Pretoria Road - 1619
Inspection Date	14/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	KMB957MP
Model	RANGER	Register Number	
VIN	AFANXXMJ2NJM08832	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/12/2022
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	168,094 KM	Fuel	PETROL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

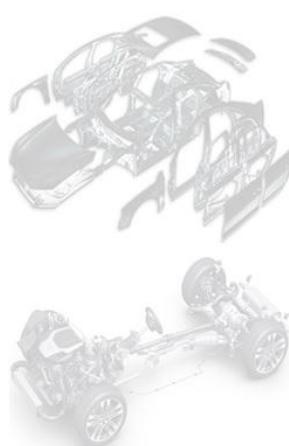

Damage	Repair Way
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Tailgate Damaged	Repair
Rear bumper Damaged	Repair
Wheel Cylinder / Caliper 2. Axle left Leak	Repair
Tyre Front Right Worn	Replace
Tyre Rear Right Worn	Replace
Engine to silencer pipe Welded	Replace
Differential Oil Leak	Repair



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.41	3.59	-	
Rear	1.47	2.75	-	
Emergency / Parking	1.23	2.06	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	120S	BFGOODRICH	Radial	V	1120	1 mm
Front Right	265/65R17	112S	BFGoodrich	Radial	V	3620	0 mm
Rear Left	265/65R17	112S	BFGoodrich	Radial	V	1120	2 mm
Rear Right	265/65R17	112S	BFGoodrich	Radial	V	3620	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: VEHICLE ELECTRONICS MALFUNCTIONING.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE
ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Technician

Werner Laubscher

This document was created electronically and is valid without signature.


General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT


Report No: 2016201940

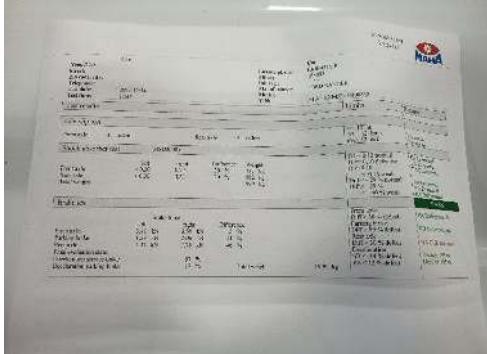DATE
14/12/2023

Brake and shock test

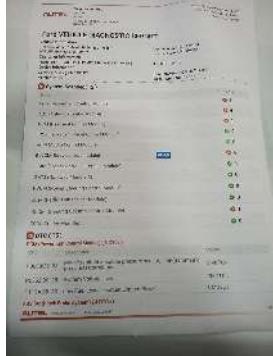

Diagnostic report

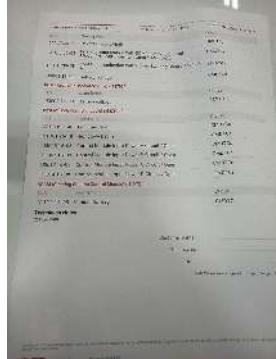

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFANXXMJ2NJM08832

4 / 10



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AFANXXMJ2NJM08832

6 / 10



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

ENGINE 1



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 10



ADDITIONAL 11



Water level



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Rear Fender Left



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

Tailgate



Rear bumper



Rear bumper



Rear Fender Right



Rear Fender Right



Front Fender Right



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

Door Front Right



Seat Front Right



Tyre Rear Right



Wheel Cylinder / Caliper 2. Axle left



Differential



Engine to silencer pipe





CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

Tyre Front Right



CONDITION REPORT

Report No: 2016201940

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za