

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 12/01/2024        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 12/01/2024        |                     | Kempton Park - GT        |

## Vehicle Data

|                 |                   |                         |              |
|-----------------|-------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE | Registered Owner        | MFC          |
| Manufacturer    | TOYOTA            | Registration Number     | JMP505MP     |
| Model           | COROLLA           | Register Number         |              |
| VIN             | AHTBBOJE000014271 | Date Of First Licensing |              |
| Engine Number   |                   | Last COR                |              |
| Doors           | 4                 | License Expiry Date     | 12/01/2024   |
| Color           | WHITE             | Power / Displacement    |              |
| Year Model      |                   | Paint Finish            | TWO COAT UNI |
| Km Reading      | 247,541 KM        | Fuel                    | PETROL       |
| Cab / Body Type | SEDAN             | Transmission            | MANUAL       |

## Vehicle Options & Accessories

### Items

## VEHICLE INSPECTION

| Damage                                       | Repair Way |
|----------------------------------------------|------------|
| Windscreen Wiper Damaged                     | Replace    |
| Headlight Left Defective                     | Replace    |
| Headlight Right Defective                    | Replace    |
| Hood Lining Dirty                            | Repair     |
| Steering Wheel Trim Defective                | Repair     |
| Front Bumper Damaged                         | Repair     |
| Bonnet Paintwork • Discoloured               | Repair     |
| Front Fender Left Residual Traces of Repair  | Repair     |
| Front Fender Right Residual Traces of Repair | Repair     |
| Rear Fender Left Paintwork • Scratched       | Repair     |
| Door Front Left Paintwork • Chipmarks        | Repair     |
| Door Front Right Dented                      | Repair     |
| Door Rear Left Paintwork • Scratched         | Repair     |
| Door Rear Right Paintwork • Scratched        | Repair     |
| Boot Lid / Hatch door Paintwork • Scratched  | Repair     |
| Rear bumper Paintwork • Scratched            | Repair     |
| Sill Panel Left Paintwork • Scratched        | Repair     |
| Sill Panel Right Paintwork • Scratched       | Repair     |
| Rocker Panel Left Damaged                    | Repair     |
| Roof Dented                                  | Repair     |
| Windscreen Chipped                           | Repair     |
| Tie Rod End right Defective                  | Replace    |
| Control Arm(s) Front Axle Left Defective     | Repair     |
| Control Arm(s) Front Axle Right Defective    | Repair     |
| Ball Joint(s) Front Axle Left Defective      | Replace    |
| Shock Absorber Front Left Sweat              | Replace    |
| Tyre Front Left Worn                         | Replace    |
| Tyre Front Right Defective                   | Replace    |
| Tyre Rear Left Damaged                       | Replace    |

## Damage

## Repair Way

Chassis Scratched  
Engine to silencer pipe Defective  
Belly plates Defective  
Jack Missing  
Wheel Spanner Missing  
Triangle Missing

Repair  
Repair  
Repair  
Replace  
Replace  
Replace

## Brakes

### Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 3.2                | 3.49               | -                |                                  |
| Rear                | 1.71               | 2.02               | -                |                                  |
| Emergency / Parking | 1.45               | 2.11               | -                |                                  |

## Tyres and Rims

### Tyre Specification & Measurement

|             | Size       | Load/Speed Index | Manufacture | Model     | Type* | Production Date | Tread Depth (mm) |
|-------------|------------|------------------|-------------|-----------|-------|-----------------|------------------|
| Front Left  | 205/55 R16 | 91V              | Tracmax     | Radial    | V     | 2919            | 0 mm             |
| Front Right | 205/55 R16 | 91V              | Continental | Sport     | V     | 3215            | 6 mm             |
| Rear Left   | 205/55 R16 | 91V              | Windforce   | Catchfors | V     | 1623            | 0 mm             |
| Rear Right  | 205/55 R16 | 91V              | Goodyear    | Efficient | V     | 0518            | 3 mm             |

\* Tyre Legend: V=Virgin, R=Recap

## Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System    | Code  | Description                            | Status |
|----|-----------|-------|----------------------------------------|--------|
| 1  | MAIN BODY | U0100 | LOST COMMUNICATION WITH ECM/PCM/ECU"A" |        |

## Inspection Conditions

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

## Comments

General Comments: VEHICLE HAS NO LICENSE DISK.Engine Compartment: Engine bay dirty.Brake fluid level ok.  
Interior: Vehicle interior dirty and some interior panels scratched.  
Body • Exterior: Dents and scratches on some body panels.Spray work on some body pan

## Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE  
?ACCORDING TO THE AGE AND  
MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND  
MECHANICAL PARTS

## Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




VIN PLATE OR STICKER



LICENSE DISC MISSING




Manual Transmission

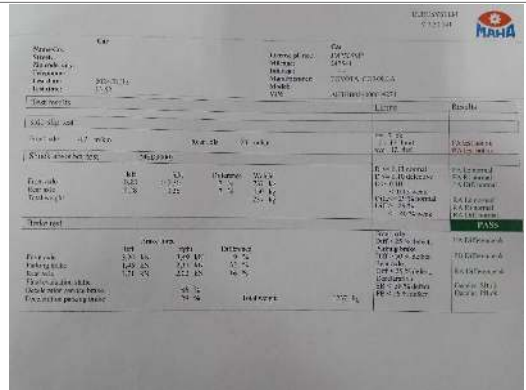

Brake and shock absorber report



Diagnostic report page 1

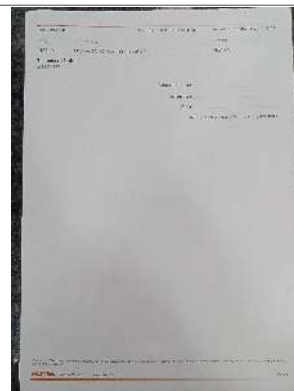

Diagnostic report page 2



## CONDITION REPORT

Report No: 2016227186

VIN: AHTBB0JE000014271

DATE  
3/13  
12/01/2024



ONLY RIM NO SPARE TYRE



Oil cap and dipstick



Front chassis



Rear chassis



FRONT RIGHT CORNER



REAR LEFT CORNER





INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

VIN: AHTBB0JE000014271

7 / 13



90 DEGREE LEFT



LF TYRE TREAD

VIN: AHTBB0JE000014271

8 / 13



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



ENGINE 1

VIN: AHTBB0JE000014271

9 / 13



Headlight Left



Headlight Right



Front Bumper



Front Bumper



Bonnet



Windscreen

VIN: AHTBB0JE000014271


11 / 13



Windscreen Wiper



Front Fender Left

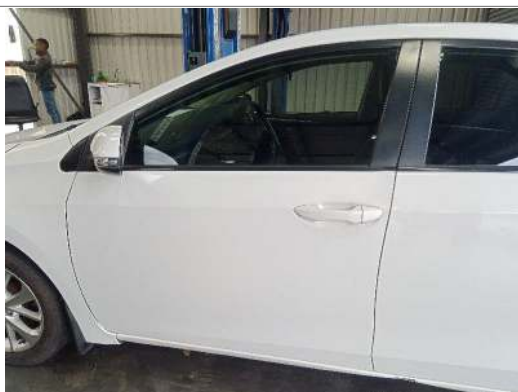

Door Front Left



Door Rear Left



Rear Fender Left



Sill Panel Left

VIN: AHTBB0JE000014271

13 / 13



Rear bumper



Rear bumper



Boot Lid / Hatch door



Roof



Door Rear Right




Door Front Right





Front Fender Right

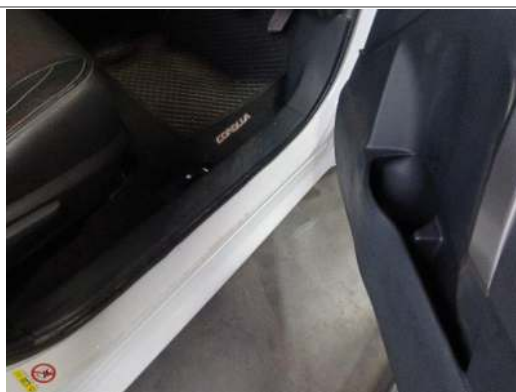

Sill Panel Right



Water level



Rocker Panel Left



Tyre Front Left



Tyre Front Right





Control Arm(s) Front Axle Right




Control Arm(s) Front Axle Left



Chassis



Engine to silencer pipe

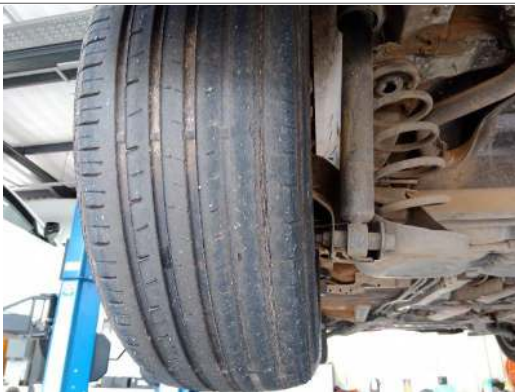

Tyre Rear Left



Engine to silencer pipe






Shock Absorber Front Left




Ball Joint(s) Front Axle Left

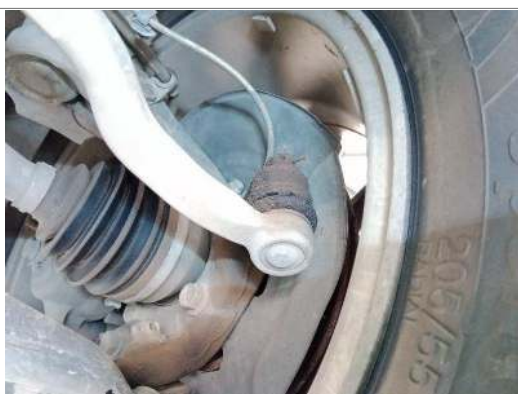

Tie Rod End right



Belly plates

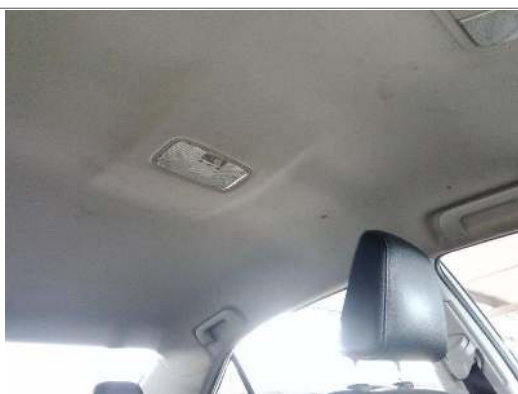

Hood Lining



Steering Wheel Trim



## CONDITION REPORT

Report No: 2016227186

DATE  
12/01/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)