

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/02/2024		M57 Pretoria Road - 1619
Inspection Date	16/02/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	DK07XPGP
Model	COROLLA	Register Number	
VIN	AHTBB0JE700005552	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/08/2022
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	192,708 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Seat Front Right Torn / Cut	Repair
Gear Lever Dust Boot Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet slam plate (Shock tower/ Inner tray) Corrosion	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Paintwork • Pitmarks	Repair
Rear bumper Paintwork • Scratched	Repair
Gearbox Oil Leak	Repair
Airbag warning light stays illuminated	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.0	3.3	-	
Rear	2.4	2.2	-	
Emergency / Parking	1.4	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91H	Goodyear	Excellence	V	2318	3 mm
Front Right	195/65R15	91H	Goodyear	Excellence	V	0519	3 mm
Rear Left	195/65R15	91H	Goodyear	Excellence	V	1818	4 mm
Rear Right	195/65R15	91H	Goodyear	Excellence	V	2918	3 mm
Spare	195/65R15	91H	Goodyear	Excellence	V	4021	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: SIGNS OF SPRAY WORK DONE ON SOME BODY PANELS. VARIOUS SCRATCHES, DENTS & STONE CHIPS ON VARIOUS BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



REAR LEFT CORNER



FRONT RIGHT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE FRONT



90 DEGREE REAR



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Expansion bottle



Manual



Oil cap and dipstick



Spare wheel



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



ENGINE 1

VIN: AHTBB0JE700005552

7 / 8

VIN: AHTBBOJE700005552
8 / 8



ENGINE 2




CHASSIS



VIN PLATE OR STICKER




LICENSE DISC

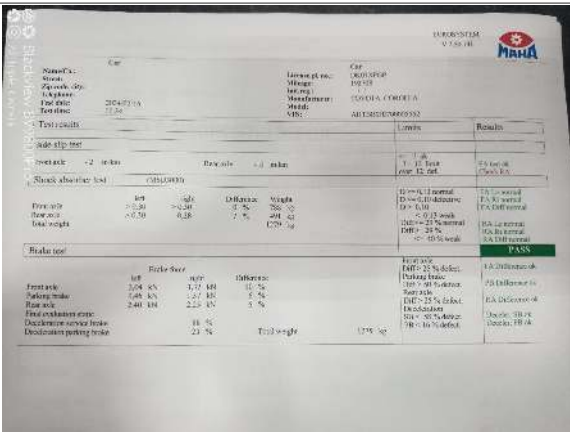

SHOCK & BRAKE REPORT



DIAGNOSTIC REPORT PAGE 1

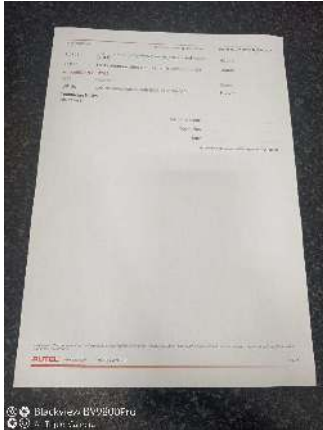

DIAGNOSTIC REPORT PAGE 2



Water level



Bonnet slam plate (Shock tower/ Inner tray)



Seat Front Right



Front Bumper



Front Bumper



Door Rear Left



Rear bumper



Rear bumper



Door Rear Right



Gearbox



Gear Lever Dust Boot

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za