

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/03/2024		M57 Pretoria Road - 1619
Inspection Date	28/03/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	TOYOTA	Registration Number	JNS321MP
Model	HILUX	Register Number	
VIN	AHTJB8DD104755373	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	28/03/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	153,082 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Hooter Defective	Repair
Central Locking Defective	Repair
Dim and Bright Indicator Light Malfunction	Repair
Indicator Light Rear Left Malfunction	Repair
Seat Front Right Torn / Cut	Repair
Interior Mirror Missing	Replace
Side Mirror Right Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Front Fender Left Dented	Repair
Rear Fender Left Dented	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Dented	Repair
Door Rear Right Paintwork • Scratched	Repair
Sill Panel Left Welded	Repair
Roof Dented	Repair
Windscreen Damaged	Replace
Brake Drum 2. Axle left Defective	Repair
Service Brake Performance Rear Axle Left / Right	
Difference out of legal range	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Bolt(s) / Nut(s) Rear Wheel Left Missing	Replace
Sub Frame Welded	Repair

Damage	Repair Way
No license dice	Replace
Engine management lights illuminated	Repair
L/F panic handle missing	Replace
Signs of hail damage on some body panels	Repair
Vehicle is cut and join on sub frame	

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.7	3.4	-	
Rear	0.2	1.8	-	
Emergency / Parking	1.7	3.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112Q	Goodyear	Wrangler	V	4918	3 mm
Front Right	265/65R17	112Q	Goodyear	Wrangler	V	5218	5 mm
Rear Left	265/65R17	112Q	Goodyear	Wrangler	V	5118	3 mm
Rear Right	265/65R17	112Q	Goodyear	Wrangler	V	4918	4 mm
Spare	265/70R17	121/118Q	Royal black	Royal m/t	V	0418	10 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: SIGNS OF SPRAY WORK DONE ON SOME BODY PANELS. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016322467

VIN: AHTJB8DD104755373

DATE

28/03/2024



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Coolant bottle



Oil cap and dipstick



Spare wheel



CHASSIS

VIN: AHTJB8DD104755373

7 / 13



ENGINE 2




ENGINE 1



VIN PLATE OR STICKER



LICENSE DISC MISSING

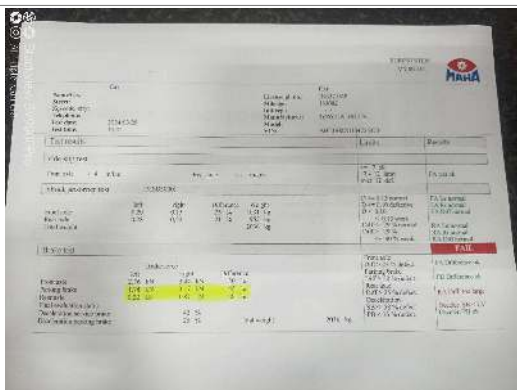


SHOCK & BRAKE REPORT




DIAGNOSTIC REPORT PAGE 1

VIN: AHTJB8DD104755373

9 / 13

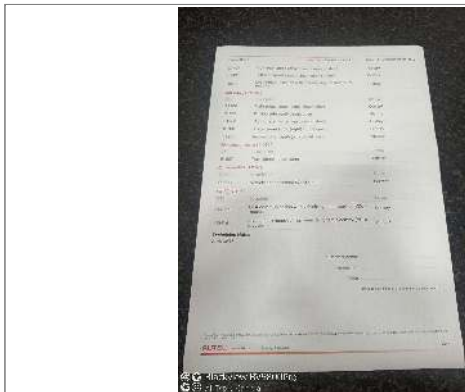


DIAGNOSTIC REPORT PAGE 2

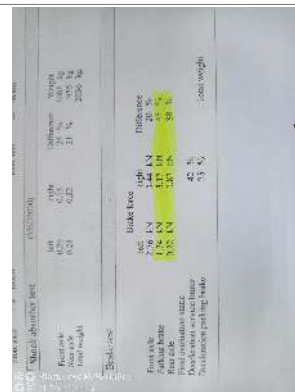

VIN: AHTJB8DD104755373

10 / 13

Parking Brake Performance

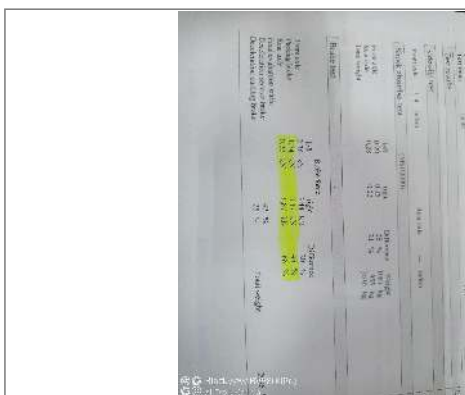

Service Brake Performance Rear Axle



Water level



Bonnet



Windscreen

VIN: AHTJB8DD104755373

11 / 13



Seat Front Right



Roof

VIN: AHTJB8DD104755373

12 / 13



Front Fender Left



Steering Wheel



Central Locking



Side Mirror Right

VIN: AHTJB8DD104755373

13 / 13



Door Front Left



Door Rear Left



Rear Fender Left



Rear Fender Right



Door Rear Right



Door Front Right



Front Bumper



Front Bumper



Bolt(s) / Nut(s) Front Wheel Right



Bolt(s) / Nut(s) Front Wheel Left



Bolt(s) / Nut(s) Rear Wheel Left



Brake Drum 2. Axle left



Sub Frame



Sub Frame



Sill Panel Left



Engine



Dim and Bright Indicator Light



Dim and Bright Indicator Light



Indicator Light Rear Left



Interior Mirror



CONDITION REPORT

Report No: 2016322467

DATE
28/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za