



Report No: 2016892727 DATE 27/05/2025

MFC Auction House M57 Pretoria Rd, Glenmarais, KEMPTON PARK Gauteng DEKRA MFC M57 Pretoria Rd - 1619 KEMPTON PARK - GT 08610 33572











Assia	nment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/05/2025		M57 Pretoria Road - 1619
Inspection Date	27/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	TOYOTA	Registration Number	HH05NZGP
Model	COROLLA QUEST 1.6 AT [2016-2021]	Register Number	
VIN	AHTLB52E103127726	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/08/2025
Color	SILVER	Power / Displacement	
Year Model	2018	Paint Finish	M - METALLIC
Km Reading	239,818 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za

VIN: AHTLB52E103127726





Report No: 2016892727 DATE 27/05/2025



Damage	Repair Way
Seat Front Right Torn / Cut	Repair
Grill Damaged	Repair
Bonnet Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Rear bumper Cracked	Repair
Stabilizer Mounting Front Right Damaged	Repair
Exhaust leak.	Repair

Brakes Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.9	3.4	-	
Rear	2.4	2.5	-	
Emergency / Parking	1.3	1.3	-	

Tyres and Rims Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/65R15	91V	Dunlop	Sport	V	4223	4 mm
Front Right	195/65R15	91V	Dunlop	Sport	V	4223	3 mm
Rear Left	195/65R15	91V	Dunlop	Sport	V	4223	4 mm
Rear Right	195/65R15	91V	Dunlop	Sport	V	4223	5 mm
Spare	195/65R15	91V	nexen	Nblue	V	0000	4 mm

^{*} Tyre Legend: V=Virgin, R=Recap





Report No: 2016892727 DATE 27/05/2025

Diagnostic

A vehicle diagnostic has not been conducted.

Diagnostic could not be performed due to no data available and or OBD interface malfunction.

Inspection Conditions

No Test Drive Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling) Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Body • Exterior: Signs of spray work done on some body panels. Minor dents scratches stone chips on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.


General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.





Report No: 2016892727 DATE 27/05/2025

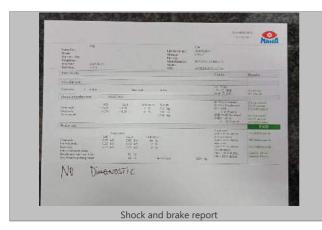
















Report No: 2016892727 DATE 27/05/2025










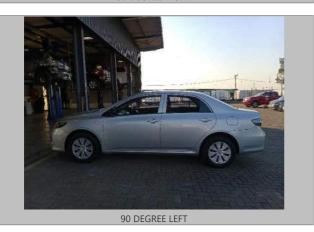


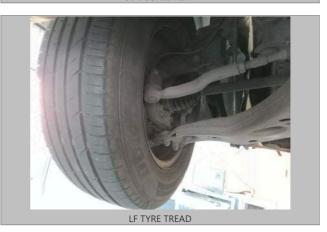





Report No: 2016892727 DATE 27/05/2025

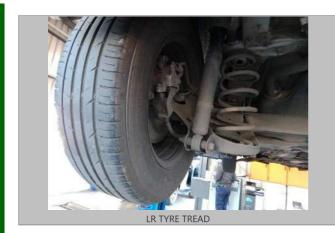















Report No: 2016892727 DATE 27/05/2025

















Report No: 2016892727 DATE 27/05/2025

















Report No: 2016892727 DATE 27/05/2025







DEKRA Automotive (PTY) Ltd. 97 Willem Cruywagen Ave Klerksoord, Pretoria, 0200 Phone: 012 542 4867 www.dekraauto.co.za

VIN: AHTLB52E103127726