



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/12/2023		M57 Pretoria Road - 1619
Inspection Date	19/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	NN101-678
Model	COROLLA	Register Number	
VIN	AHTLT56E606036635	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/06/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	88,090 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

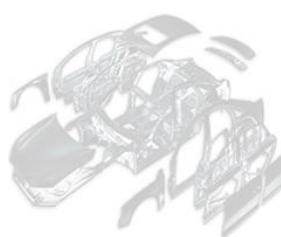

Damage	Repair Way
Park Light Front Left Defective	Repair
Seat Rear Damaged	Repair
Side Mirror Left Paintwork • Discoloured	Repair
Front Bumper Paintwork • Flaking	Repair
Windscreen Cracked	Replace
Shock Absorber Front Left Sweat	Replace
Tyre Front Right Smooth	Replace
Spare Tyre Excessive Wear & Tear	Replace
Rim Front Right Dented	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	3.3	3.3	-	
Rear	2.0	2.2	-	
Emergency / Parking	1.3	1.9	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55R16	91V	Continental	Contact	V	4418	5 mm
Front Right	205/55R16	91V	Continental	Contact	V	1612	0 mm
Rear Left	205/55R16	91V	Continental	Contact	V	4218	5 mm
Rear Right	205/55R16	91V	Continental	Contact	V	4218	5 mm
Spare	205/55R16	91V	Continental	Contact	V	//////////	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

VIN: 1HTN55E0000000000 Report No: 2016206319

2 / 9

DATE


19/12/2023

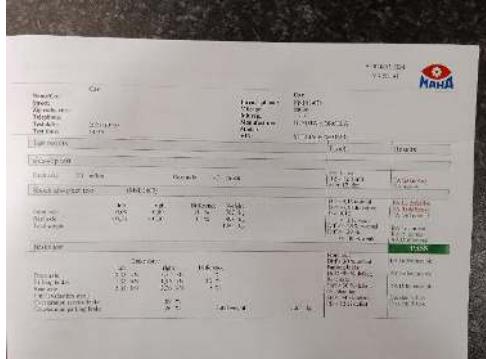

Shock and brake report



Diagnostic test

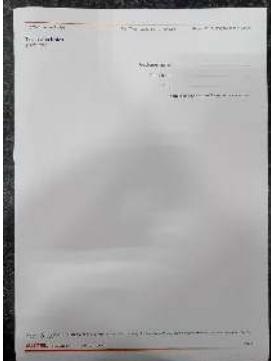

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

**CONDITION REPORT****Report No:** 2016206319

VIN: AHTLT56E606036635

DATE

19/12/2023

3/9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206319

DATE

VIN: AHTLT561591022023

4 / 9



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

VIN: AHTLT56E606036635

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

VIN: AHTLT56E606036635

6 / 9



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

VIN: AHTLT56E606036635

7 / 9



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Manual



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

VIN: AHTLT56E606036635

9 / 9



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

Expansion bottle



Oil cap and dipstick



Spare Tyre



Side Mirror Left



Windscreen



Tyre Front Right



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

Front Bumper



Rim Front Right




Rim Front Right



CV Joint(s) Boot(s) Front Left (inner/outer)



Shock Absorber Front Left

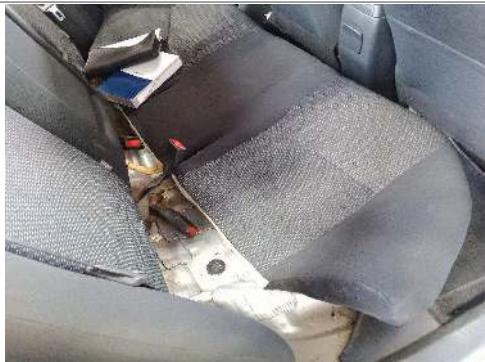

Seat Rear





CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

Park Light Front Left



CONDITION REPORT

Report No: 2016206319

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za