



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/05/2024		M57 Pretoria Road - 1619
Inspection Date	02/05/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	TOYOTA	Registration Number	LD48XFGP
Model	QUANTUM	Register Number	
VIN	AHTSS22P307147397	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/04/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	40,812 KM	Fuel	DIESEL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Tail Light Right Defective	Repair
Seat Front Left Torn / Cut	Repair
Seat Rear Defective	Repair
Seat Belt Rear Left (2. Row) Torn / Cut	Replace
Hood Lining Dirty	Repair
Carpet Rear Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Residual Traces of Repair	Repair
Firewall Dented	Repair
C • Pillar Left Residual Traces of Repair	Repair
C • Pillar Right Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Residual Traces of Repair	Repair
Rear Fender Left / Inner Tray Residual Traces of Repair	Repair
Rear Fender Right / Inner Tray Residual Traces of Repair	Repair
Boot Lid / Hatch door Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Dented	Repair
Sill Panel Right Dented	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Stabilizer Front Defective	Repair
Rim Rear Left Scratched	Repair
Main Beam Right Welded	Repair
Chassis Welded	Repair
Radiator Cradle Dented	Repair
Jack Missing	Replace
Interior	Vehicle interior dirty and some panels scratched

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: AHTSS22P307147397

1 / 14



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

Damage	Repair Way
Interior	Rear left window net missing
Interior	Rear left door side step loose.
Undercarriage	Vehicle undercarriage dirty
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Vehicle is a cut joint
Body and Exterior	Vehicle safety integrity compromised.
Road test	Vehicle unsafe to drive
Body and Exterior	Poor residual traces of repair on some body panels
Interior	Jack cubbyhole cover missing
Body and Exterior	Signs of impact damage to rear of vehicle
Body and Exterior	Signs of impact damage to front of vehicle
Interior	Spare wheel loose inside of vehicle

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	5.15	4.92	-	
Rear	3.34	4.6	-	
Emergency / Parking	2.23	3.27	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R15C	106S	Toyo	H07	V	0923	6 mm
Front Right	195R15C	106S	Toyo	H07	V	0823	5 mm
Rear Left	195R15C	106S	Toyo	H07	V	0723	6 mm
Rear Right	195R15C	106S	Toyo	H07	V	3222	7 mm
Spare	195R15C	104S	Toyo	H07	V	0723	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	COMBUSTION METER	B1507	TURN SIGNAL CIRCUIT OPEN	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


VIA AUTOS 2016167809

Report No: 2016167809


2 / 14

DATE

02/05/2024

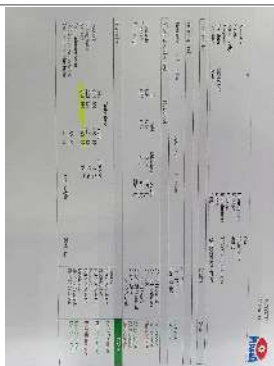

Brake and shock absorber repor

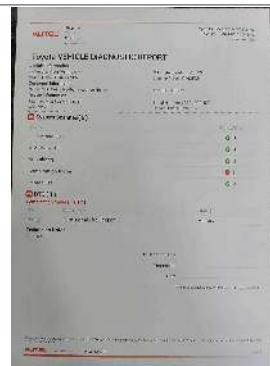

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



CONDITION REPORT

Report No: 2016362509

VIN: AHTSS22P307147397

DATE

02/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

VIN: AHTSS22P2071573397
DATE: 02/05/2024
4 / 14



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

VIN: AHTSS22P307147397

5 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

VIN: AHTSS22P307147397


6 / 14




LF TYRE TREAD



LR TYRE TREAD

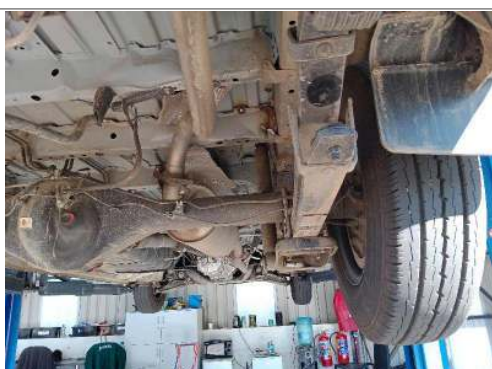


RR TYRE TREAD

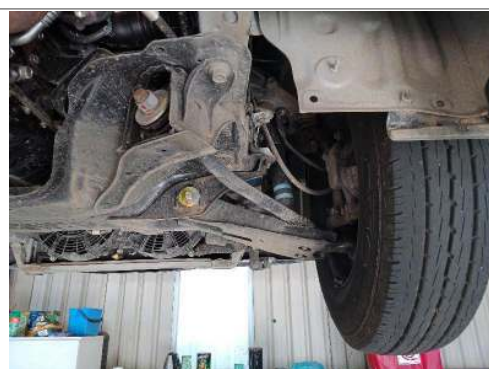

RF TYRE TREAD



Spare wheel

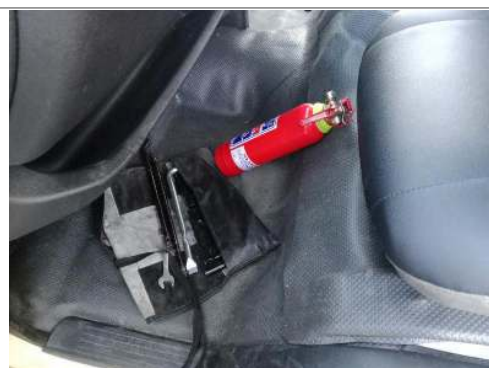

Spare wheel Accessories



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

VIN: AHTSS22P307147397
7 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Rear Chassis



Front chassis



Door rear left side step

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

VIN: AHTSS22P307147397
9 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

Oil cap and dipstick



Seat Rear

VIN: AHTSS22P307147397
10 / 14

Seat Rear



Seat Belt Rear Left (2. Row)



Rear Fender Left / Inner Tray



Rear Fender Right



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

VIN: AHTSS22P307147397

11 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

Carpet Rear



Seat Front Left

VIN: AHTSS20P307147397
12 / 14

Front Bumper



Front Bumper



Bonnet



Front Fender Right



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

VIN: AHTSS22P307147397
13 / 14

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

Water level



Front Fender Right

VIN: AHTSS22P307147397

14 / 14



C • Pillar Left



C • Pillar Right



Rear Fender Right / Inner Tray



Boot Lid / Hatch door



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

Rear Fender Right



Tail Light Right




Rear bumper



Rear bumper



Hood Lining

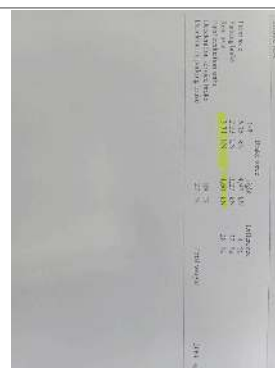

Service Brake Performance Rear Axle



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

Sill Panel Right




Rear Fender Right / Inner Tray



Rear Fender Right / Inner Tray



Rim Rear Left

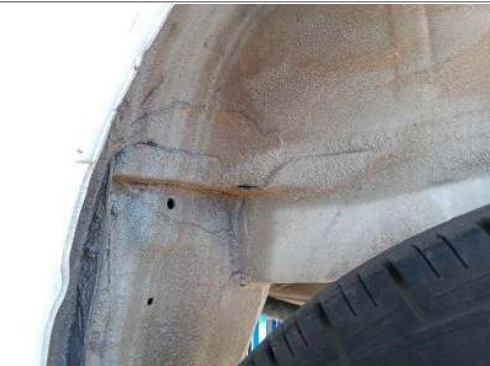

Rear Fender Left



Sill Panel Left



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016362509

DATE
02/05/2024

Radiator Cradle



Chassis

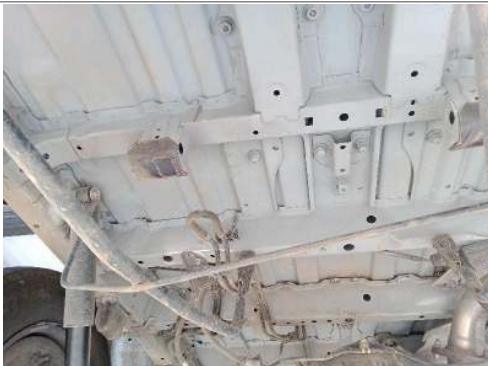

Chassis



Chassis



Chassis



Rear Fender Right



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

Sill Panel Left



Stabilizer Front



Main Beam Right



Firewall



CONDITION REPORT

Report No: 2016362509

DATE
02/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za