



MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	02/06/2025		M57 Pretoria Road - 1619
Inspection Date	02/06/2025		Kempton Park - GT


Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	CP67KKGP
Model	H-100 BAKKIE 2.6 DECK DSL PU [2011-2020]	Register Number	
VIN	KMFZBX7BLEU984765	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	31/12/2025
Color	WHITE	Power / Displacement	
Year Model	2013	Paint Finish	C - COMMON
Km Reading	313,949 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

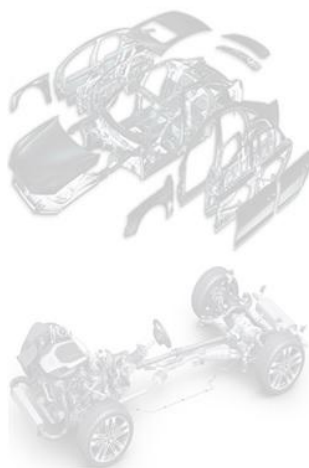

Damage	Repair Way
Engine Wiring Defective	Repair
Seat Front Right Torn / Cut	Repair
Door Handle Front Right Damaged	Replace
Rear Lower Valance Dented	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
A • Pillar Right Paintwork • Flaking	Repair
B • Pillar Left Dented	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Paintwork • Chipmarks	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Load Body Paintwork • Scratched	Repair
Service Brake Performance Rear Axle Malfunction	Repair
Parking brake light on	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.1	3.5	-	
Rear	0.0	0.0	-	
Emergency / Parking	1.6	1.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195/70R15	104/102R	Autogrip	Van max	V	4324	4 mm
Front Right	195/70R15	104/102R	Autogrip	Van max	V	4324	4 mm
Rear Left	195/70R15	104/102R	Autogrip	Van max	V	4324	4 mm
Rear Right	195/70R15	104/102R	Autogrip	Van max	V	4324	4 mm
Spare	195/70R15	104/102R	Good ride	Radial h188	V	0000	4 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Vehicle got some scratches, stone chips and dent.

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

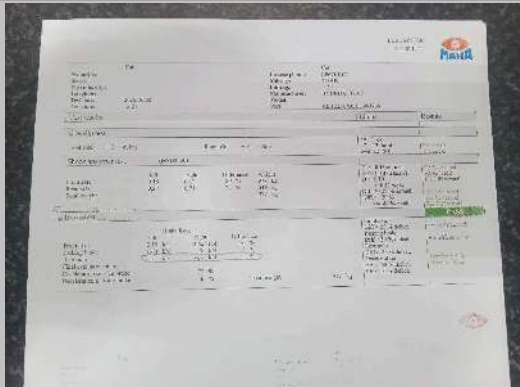

Shock and brake report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Coolant bottle



Oil cap and dipstick



Seat Front Right



Water level



Bonnet



A • Pillar Right



Front Fender Right



Front Fender Left



Engine Wiring

Shock absorber test			
Front axle	2.00 km	0.12	0.27
Rear axle	2.00 km	0.12	0.27
Total weight	2.00 km	0.12	0.27
Brake force			
Front axle	1.49 kN	1.55 kN	1.05 kN
Rear axle	1.05 kN	1.70 kN	1.05 kN
Parking brake	1.05 kN	1.70 kN	1.05 kN
Deceleration parking brake	1.05 kN	1.70 kN	1.05 kN
Deceleration service brake	1.05 kN	1.70 kN	1.05 kN
Total weight	1.05 kN	1.70 kN	1.05 kN

Service Brake Performance Rear Axle



Door Front Right



Door Handle Front Right



Front Bumper



Front Bumper



Front Bumper



B • Pillar Left



Door Front Left



Load Body



Tailgate



Rear Lower Valance



Load Body

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMFZBX7BLEU984765