

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	13/12/2024		M57 Pretoria Road - 1619
Inspection Date	13/12/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	HK72YPGP
Model	ACCENT	Register Number	
VIN	KMHCT41DLJU415766	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	13/12/2024
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	114,395 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Seat Front Left Torn / Cut	Repair
Seat Front Right Torn / Cut	Repair
Door Sealing Rubber Rear Left Defective	Replace
Side Mirror Left Paintwork • Scratched	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Paintwork • Scratched	Repair
Front Fender Right Damaged	Repair
Door Rear Right Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Roof Dented	Repair
Parking Brake Performance Left / Right Difference out of legal range	Repair
Rim Front Left Dented	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KMHCT41DLJU415766

1 / 9

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.7	1.9	-	
Rear	1.8	1.9	-	
Emergency / Parking	0.8	0.7	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R14	84T	Rovelo	RHL	V	3821	4 mm
Front Right	175/70R14	84T	Rovelo	RHP	V	3821	4 mm
Rear Left	175/70R14	84T	Kumho	Solus	V	0000	3 mm
Rear Right	175/70R14	84T	Kumho	Solus	V	0000	5 mm
Spare	175/70R14	84T	Kumho	Solus	V	0000	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. MINOR DENTS, SCRATCHES & STONE CHIPS ON VARIOUS BODY PANELS. SIGNS OF SPRAY WORK DONE ON VARIOUS BODY PANELS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER

VIN: KMHCT41DLJU415766

2 / 9



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT

VIN: KMHCT41DLJU415766

3 / 9



ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)




Manual

VIN: KMHCT41DLJU415766

4 / 9



LF TYRE TREAD

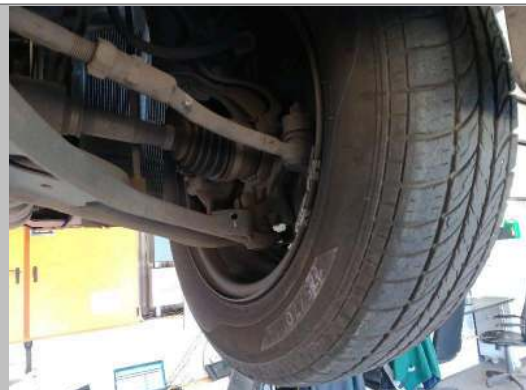

RF TYRE TREAD

VIN: KMHCT41DLJU415766

5 / 9



RR TYRE TREAD



LR TYRE TREAD



Sparewheel



Coolant reservoir



Oil cap and dipstick



Rear end

VIN: KMHCT41DLJU415766

6 / 9



ENGINE 1



CHASSIS




ENGINE 2



VIN PLATE OR STICKER




LICENSE DISC MISSING

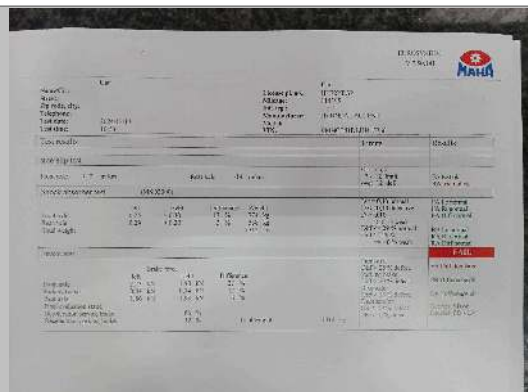

SHOCK & BRAKE REPORT

VIN: KMHCT41DLJU415766

8 / 9

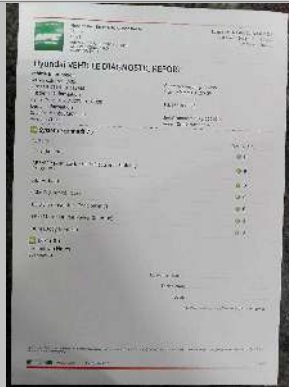

DIAGNOSTIC REPORT



VIN: KMHCT13LJU415766

9 / 9

Seat Front Left



Seat Front Right



Door Rear Right




Rear bumper




Door Sealing Rubber Rear Left



Side Mirror Left

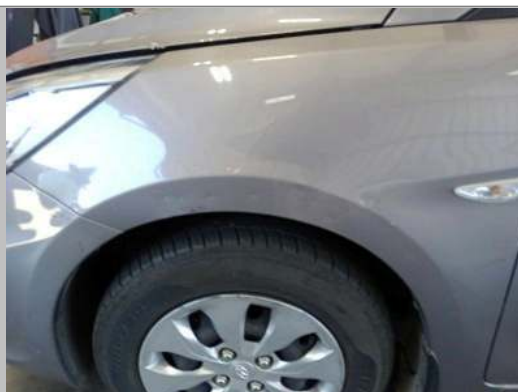

Front Fender Left

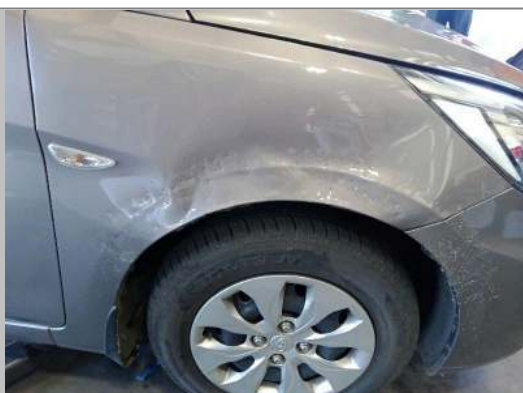

Front Fender Right

Vehicle Information		VIN: 2016660424	
Make	Toyota	Model	Yaris
Year	2016	Color	White
Engine	1.8L	Transmission	Manual
Drive Type	FWD	Registration	1234567
Inspection Date	13/12/2024	Inspector	John Doe
Inspection Location	DEKRA	Vehicle Status	Pass

Parking Brake Performance



Roof



Front Bumper



Front Bumper



Front Bumper



Front Bumper



Rim Front Left



CONDITION REPORT

Report No: 2016660424

DATE
13/12/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za