



CONDITION REPORT

Report No: 2016204863

DATE
18/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	18/12/2023		M57 Pretoria Road - 1619
Inspection Date	18/12/2023		Kempton Park - GT

Vehicle Data


Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	HYUNDAI	Registration Number	JB43GXGP
Model	ACCENT	Register Number	
VIN	KMHCT41DLKU461056	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/07/2024
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	64,135 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Switch Electrical Window Winder front left Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Shock Absorber Rear Right Sweat	Replace

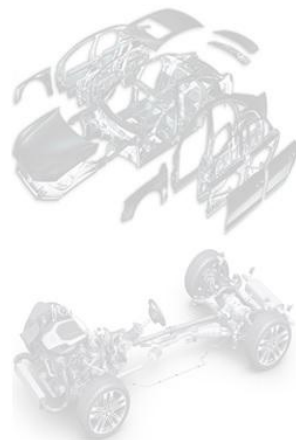



CONDITION REPORT

Report No: 2016204863

 DATE
18/12/2023

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.6	2.7	-	
Rear	1.5	1.3	-	
Emergency / Parking	1	1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/70R14	84T	Kumho	Solus	V	1517	6 mm
Front Right	175/70R14	84T	Kumho	Solus	V	2418	3 mm
Rear Left	175/70R14	84T	Kumho	Solus	V	4218	5 mm
Rear Right	175/70R14	84T	Goodyear	Duraplus	V	4920	7 mm
Spare	175/70R14	84T	Kumho	Solus	V	///////	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: KMHCU12014201863

Report No: 2016204863

2 / 7

DATE


18/12/2023

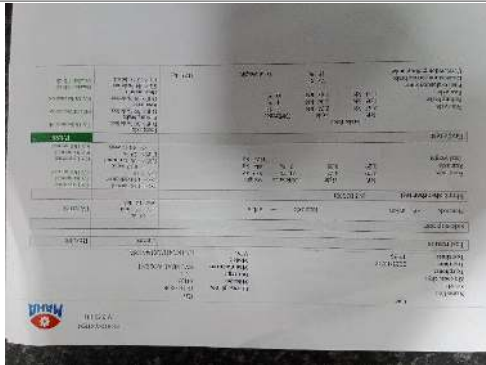

Shock and brake



Diagnostic

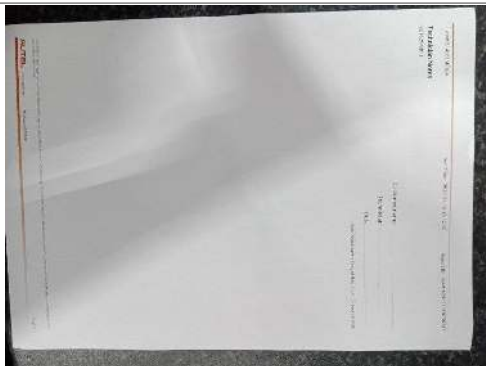

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204863
VIN: KMHCT41DLKU461056
DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204863

DATE
VIN: KMHCT41D1814272023

4/7



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204863

DATE
18/12/2023

VIN: KMHCT41DLKU461056

5 / 7

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204863

DATE
18/12/2023

VIN: KMHCT41DLKU461056

6 / 7



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



CONDITION REPORT

Report No: 2016204863

DATE
18/12/2023

VIN: KMHCT41DLKU461056
7 / 7

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204863

DATE
18/12/2023

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Manual



CONDITION REPORT

Report No: 2016204863

DATE
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016204863

DATE
18/12/2023

Oil cap and dipstick



Coolant reservoir



Switch Electrical Window Winder front left



Windscreen



Front Bumper



Shock Absorber Rear Right

**CONDITION REPORT****Report No: 2016204863****DATE**
18/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za