

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/03/2024		M57 Pretoria Road - 1619
Inspection Date	06/03/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	JJ95HFGP
Model	ACCENT	Register Number	
VIN	KMHCT41DLKU473793	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	06/03/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	244,087 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way
	Engine Oil Leak	Repair
	Caps Missing	Replace
	Hoses Damaged	Repair
	Expansion Bottle Damaged	Replace
	Fan Damaged	Replace
	Fan Belt Defective	Repair
	Water level Insufficient	Repair
	Air conditioner pump Damaged	Repair
	Bonnet safety caps Missing	Replace
	Dim and Bright Indicator Light Malfunction	Repair
	Headlight Left Damaged	Replace
	Headlight Right Damaged	Replace
	Seat Belt Front Left Defective	Repair
	Dash Padding Damaged	Repair
	Steering Wheel Trim Damaged	Replace
	Number Plate Rear Missing	Replace
	Side Mirror Right Paintwork • Scratched	Repair
	Front Bumper Paintwork • Scratched	Repair
	Bonnet Paintwork • Blisters	Repair
	A • Pillar Right Dented	Repair
	Front Fender Left Paintwork • Pitmarks	Repair
	Front Fender Right Paintwork • Blisters	Repair
	Rear Fender Left Dented	Repair
	Rear Fender Right Dented	Repair
	Door Front Left Residual Traces of Repair	Repair
	Door Front Right Dented	Repair
	Door Rear Left Paintwork • Scratched	Repair
	Door Rear Right Paintwork • Scratched	Repair
	Boot Lid / Hatch door Paintwork • Scratched	Repair

Damage	Repair Way
Rear bumper Paintwork • Scratched	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Tyre Front Left Torn / Cut	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Defective	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Main Beam Right Welded	Repair
Chassis Dented	Repair
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Defective	Replace
Radiator Cradle Dented	Replace
Engine Performance Insufficient	Repair
Body exterior	Vehicle got minor scratches, stone chips and dents
Body exterior	Signs of spray work done on some body panels
Vehicle is cut and join	Repair
Battery loose	Repair
Fuse box damage	Replace
No license dice	Replace
Steering column cover damage	Repair
All four hub caps missing	Replace
R/F fender line missing	Replace
L/F fender line damage	Replace
Wiper blades valance grill damage	Replace
Airbag and door light on	Repair
Steering wheel noisy	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.0	-	
Rear	2.0	2.0	-	
Emergency / Parking	1.4	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/60R14	75H	Dunlop	Sp sport	V	2915	2 mm
Front Right	185/70R14	88T	Goodyear	Assurance	V	1018	2 mm
Rear Left	165/60R14	75H	Continental	Contact	V	1407	0 mm
Rear Right	165/65R14	79H	Nexen	Cp661	V	4414	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	B1650	CRASH RECORDED IN 1ST STAGE ONLY	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE




Technician

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

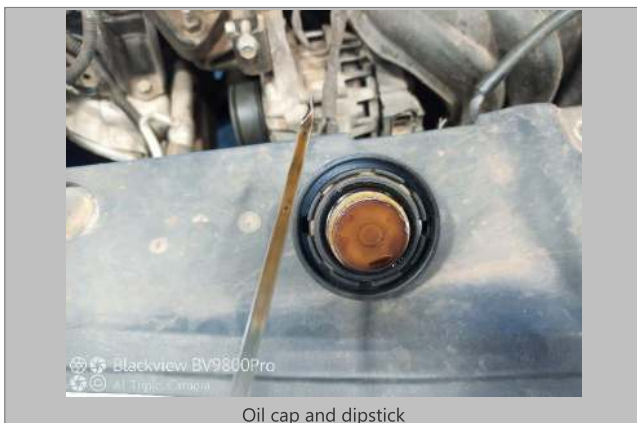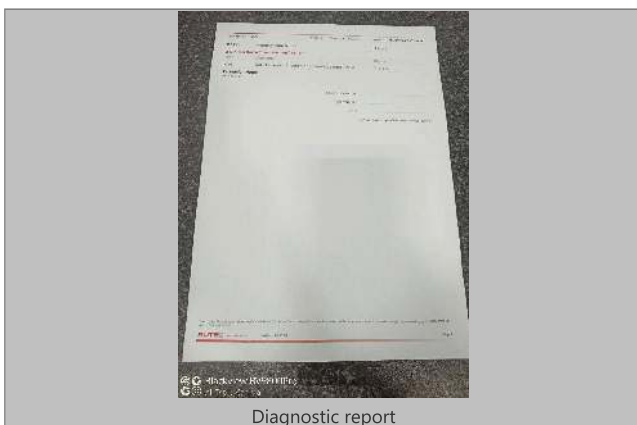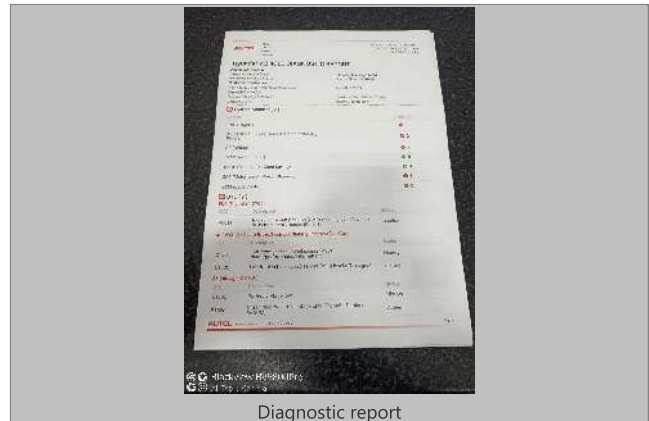



Fuse box damage



Manual



Steering column cover damage



No spare wheel



FRONT RIGHT CORNER



REAR LEFT CORNER

VIN: KMHCT41DLKU473793
7 / 17



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT




90 DEGREE RIGHT




90 DEGREE REAR

VIN: KMHCT41DLKU473793


8 / 17

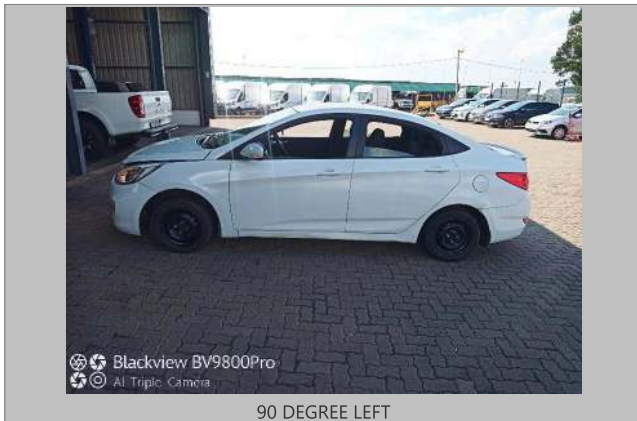

90 DEGREE LEFT

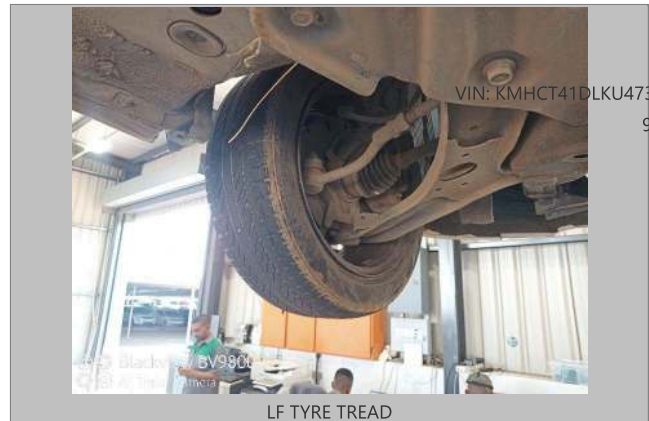

LF TYRE TREAD

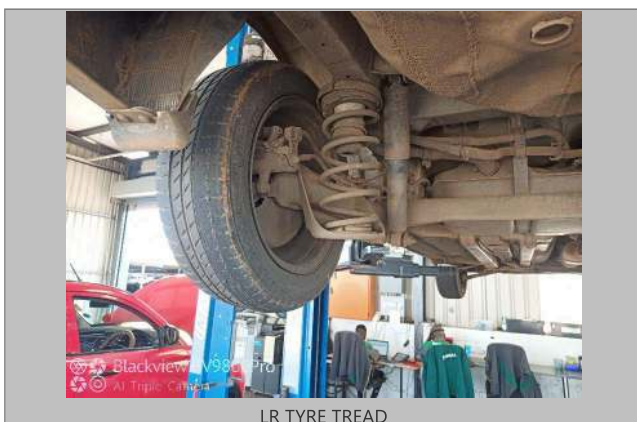


LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

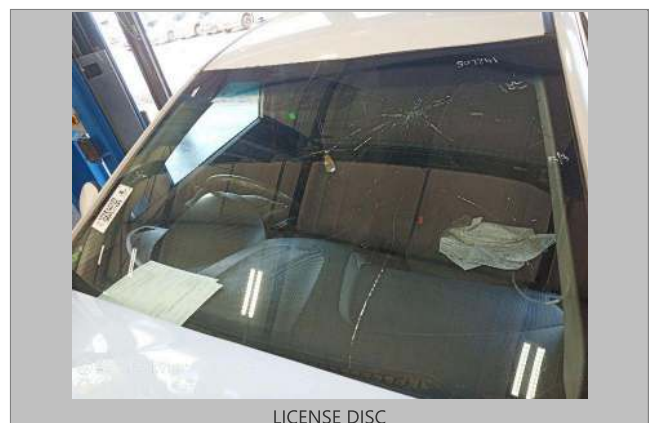

LICENSE DISC

VIN: KMHCT41DLKU473793

10 / 17



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS




Expansion Bottle



Caps

VIN: KMHCT41DLKU473793

12 / 17

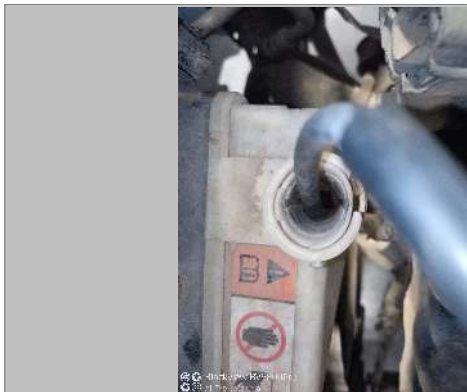

Water level



Hoses



Bonnet safety caps



Headlight Left



Headlight Right



Main Beam Right

VIN: KMHCT41DLKU473793

14 / 17



Main Beam Right



Windscreen



Steering Wheel Trim



Dash Padding




Number Plate Rear



Bonnet

VIN: KMHCT41DLKU473793

16 / 17

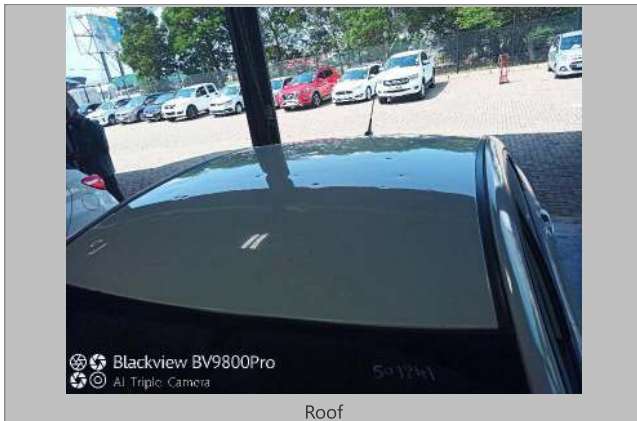


Roof




Boot Lid / Hatch door

VIN: KMHCT41DLKU473793


17 / 17

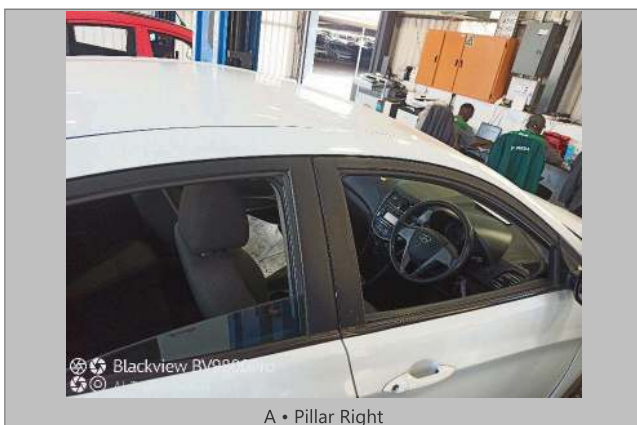

A • Pillar Right

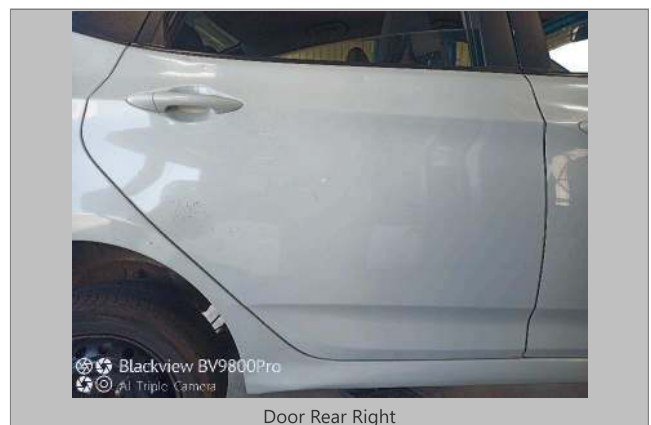

Door Rear Right

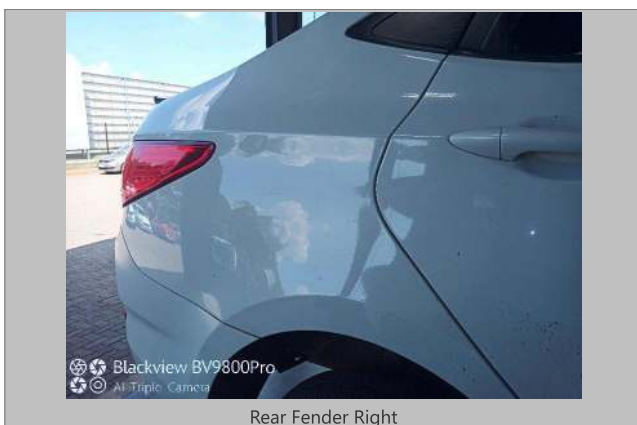

Rear Fender Right



Door Front Right



Side Mirror Right



Front Fender Right



Front Bumper



Front Bumper



Front Bumper



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Tyre Rear Left




Tyre Rear Right



Tyre Front Left



Chassis

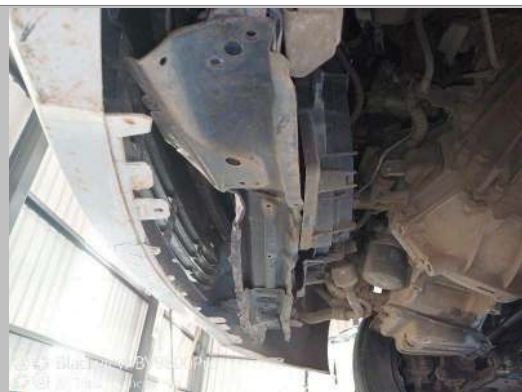

Radiator Cradle



Main Beam Right



Fan Belt



Air conditioner pump



Engine



Gearbox



CV Joint(s) Boot(s) Front Right (inner/outer)



CV Joint(s) Boot(s) Front Left (inner/outer)



Fan



Bolt(s) / Nut(s) Front Wheel Left



Seat Belt Front Left



Dim and Bright Indicator Light



CONDITION REPORT

Report No: 2016295247

DATE
06/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za