



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


| | | | |
|-----------------|-------------------|---------------------|--------------------------|
| Client | MFC Auction House | Inspection Location | MFC |
| Requested Date | 24/07/2024 | | M57 Pretoria Road - 1619 |
| Inspection Date | 24/07/2024 | | Kempton Park - GT |

Vehicle Data

| | | | |
|-----------------|-------------------|-------------------------|--------------|
| Vehicle Type | PASSENGER VEHICLE | Registered Owner | |
| Manufacturer | HYUNDAI | Registration Number | JX44SGGP |
| Model | ELANTRA | Register Number | |
| VIN | KMHDH41CMFU462579 | Date Of First Licensing | |
| Engine Number | | Last COR | |
| Doors | 4 | License Expiry Date | 31/05/2025 |
| Color | WHITE | Power / Displacement | |
| Year Model | | Paint Finish | TWO COAT UNI |
| Km Reading | 314,258 KM | Fuel | PETROL |
| Cab / Body Type | SEDAN | Transmission | AUTOMATIC |

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

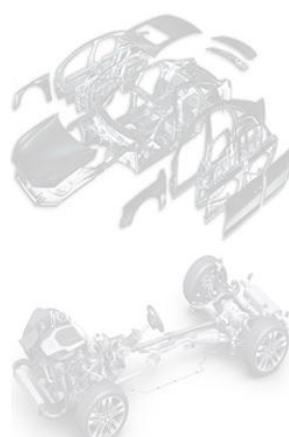

| Damage | Repair Way |
|---|------------|
| Engine Oil Leak | Repair |
| Center Console / Cubbyhole + Lid Defective | Repair |
| Tail Light Left Defective | Repair |
| Headlight Left Scratched | Repair |
| Seat Rear Dirty | Repair |
| Hood Lining Dirty | Repair |
| Door Sealing Rubber Front Right Damaged | Replace |
| Carpet Front Damaged | Replace |
| Steering Wheel Trim Defective | Repair |
| Side Mirror Left Paintwork • Scratched | Repair |
| Side Mirror Right Paintwork • Scratched | Repair |
| Front Bumper Damaged | Repair |
| Bonnet Paintwork • Chipmarks | Repair |
| C • Pillar Left Dented | Repair |
| Front Fender Left Residual Traces of Repair | Repair |
| Front Fender Right Residual Traces of Repair | Repair |
| Rear Fender Left Dented | Repair |
| Rear Fender Right Paintwork • Scratched | Repair |
| Rear Fender Left / Inner Tray Damaged | Repair |
| Rear Fender Right / Inner Tray Dented | Repair |
| Door Front Left Dented | Repair |
| Door Front Right Dented | Repair |
| Door Rear Left Dented | Repair |
| Door Rear Right Residual Traces of Repair | Repair |
| Boot Lid / Hatch door Damaged | Repair |
| Rear bumper Damaged | Repair |
| Inner Boot Floor Pan and Spare Wheel Well Residual Traces of Repair | Repair |
| Rocker Panel Right Damaged | Repair |

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekrauto.co.za

VIN: KMHDH41CMFU462579

1 / 17



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

| Damage | Repair Way |
|--|--|
| Roof Dented | Repair |
| Stabilizer Mounting Front Left Defective | Replace |
| Stabilizer Mounting Front Right Defective | Replace |
| Control Arm Bush(es) Front Axle Left Cracked | Replace |
| Mounting Rubber(s) Rear Axle Left Cracked | Replace |
| Mounting Rubber(s) Rear Axle Right Cracked | Replace |
| Spare Tyre Worn | Replace |
| Rim Front Left Scratched | Repair |
| Rim Front Right Scratched | Repair |
| Rim Rear Left Scratched | Repair |
| Rim Rear Right Scratched | Repair |
| Rim Spare Wheel Scratched | Repair |
| Chassis Scratched | Repair |
| Engine to silencer pipe Welded | Replace |
| Catalytic converter Welded | Repair |
| Belly plates Defective | Repair |
| Gearbox Oil Leak | Repair |
| Fuel Tank Dented | Repair |
| Interior | Vehicle interior dirty and some panels scratched |
| Body and Exterior | Signs of hail damage on some body panels. |
| Body and Exterior | Residual traces of repair on some body panels |
| Body and Exterior | Stone chips and spray work on some body panels |
| Body and Exterior | Dents and scratches on some body panels |
| Undercarriage | Vehicle undercarriage dirty |

Brakes**Brake Test Results**

| | Left | Right | Axle Weight [KG] | Deceleration [m/s ²] |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
| | Braking Force [KN] | Braking Force [KN] | | |
| Front | 3.14 | 3.35 | - | |
| Rear | 1.58 | 1.64 | - | |
| Emergency / Parking | 1.48 | 1.9 | - | |

Tyres and Rims**Tyre Specification & Measurement**

| | Size | Load/Speed Index | Manufacture | Model | Type* | Production Date | Tread Depth (mm) |
|-------------|------------|------------------|-------------|------------|-------|-----------------|------------------|
| Front Left | 225/45 R17 | 91W | Continental | Contisport | V | 2323 | 5 mm |
| Front Right | 225/45 R17 | 91W | Continental | Contisport | V | 2823 | 5 mm |
| Rear Left | 225/45 R17 | 91W | Continental | Contisport | V | 2323 | 5 mm |
| Rear Right | 225/45 R17 | 91W | Continental | Contisport | V | 4622 | 5 mm |
| Spare | 215/45 R17 | 91W | Sailwin | Sportway | V | 3821 | 0 mm |

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacturer).

| No | System | Code | Description | Status |
|----|-------------|-------|--|--------|
| 1 | ENG(ENGINE) | P0014 | EXHAUST CAMSHAFT POSITION(CMP)B TIMING OVER-ADVANC | |

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksdorp, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT**

VIN: KMHDDH11CMFLM62570

Report No: 2016466181

2 / 17

DATE

24/07/2024

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 201646618


VIN: KMHDH41CMFU462579

DATE


24/07/2024

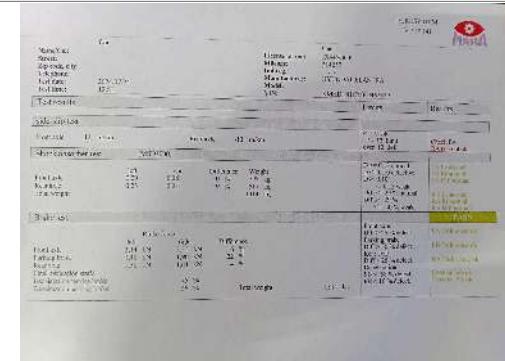

Brake and shock absorber report

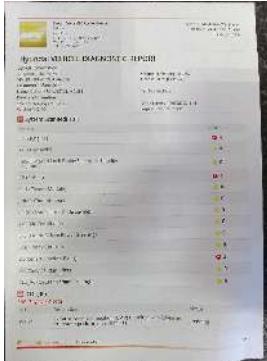

Diagnostic report page 1

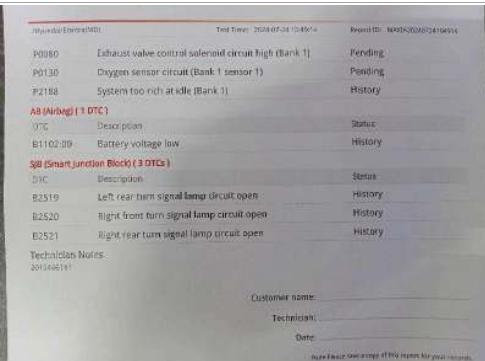

Diagnostic report page 2






FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)
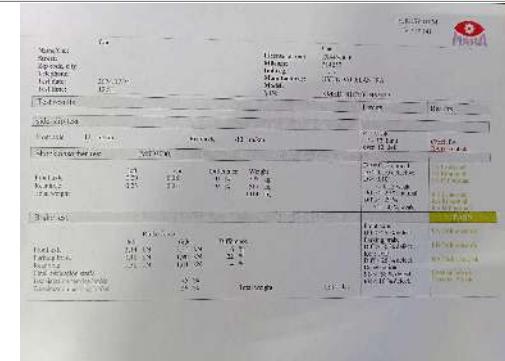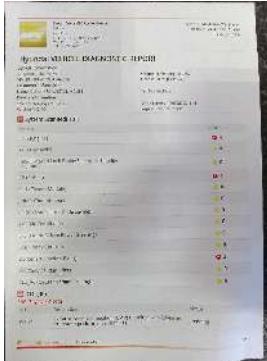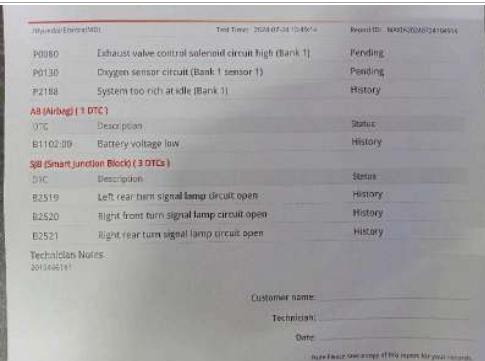
| | |
|---|---|
| <div style="border: 1px solid black; padding: 10px;">  <p>Brake and shock absorber report</p> </div> | <div style="border: 1px solid black; padding: 10px;">  <p>Diagnostic report page 1</p> </div> |
| <div style="border: 1px solid black; padding: 10px;">  <p>Diagnostic report page 2</p> </div> | <div style="border: 1px solid black; padding: 10px;">  <p>FRONT RIGHT CORNER</p> </div> |
| <div style="border: 1px solid black; padding: 10px;">  <p>REAR LEFT CORNER</p> </div> | <div style="border: 1px solid black; padding: 10px;">  <p>INTERIOR (FRONT DRIVER DOOR)</p> </div> |



CONDITION REPORT

Report No: 2016466181

DATE
VIN: KMHDH41CMEU462579
24/07/2024
4 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016466181

DATE

24/07/2024

VIN: KMHDH41CMFU462579-

5 / 17



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

VIN: KMHDH41CMFU462579

6 / 17



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

VIN: KMHDH41CMFU462579

8 / 17



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

LICENSE DISC

VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

VIN: KMHDH41CMFU462579

10 / 17

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

Center Console / Cubbyhole + Lid



VIN: KMHDH41GMFU462579

11 / 17



Steering Wheel Trim



Door Sealing Rubber Front Right



Seat Rear



Side Mirror Left



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

VIN: KMHDH41CMFU462579

12 / 17



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

Roof



Side Mirror Right

VIN: KMHDH41CMFU462579

13 / 17



Rear bumper



Rear bumper



Boot Lid / Hatch door



Tail Light Left



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

VIN: KMHDH41CMFU462579

14 / 17



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

C • Pillar Left



VIN: KMHDH41CMFU462579

15 / 17

Spare Tyre



Inner Boot Floor Pan and Spare Wheel Well



Rim Spare Wheel



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

VIN: KMHDH41CMFU462579

16 / 17



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

Bonnet



Headlight Left

17 / 17



Water level



Rim Front Right



Front Fender Right



Rocker Panel Right



CONDITION REPORT

Report No: 2016466181

DATE

24/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

Door Front Right



Door Rear Right



Rear Fender Right



Rim Rear Right



Rim Rear Left



Rear Fender Left



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

Door Rear Left



Door Front Left



Front Fender Left



Rim Front Left



Control Arm Bush(es) Front Axle Left



Stabilizer Mounting Front Left



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

Gearbox



Engine



Stabilizer Mounting Front Right



Engine to silencer pipe



Catalytic converter



Belly plates



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

Belly plates



Chassis



Fuel Tank



Mounting Rubber(s) Rear Axle Left



Mounting Rubber(s) Rear Axle Right



Rear Fender Left / Inner Tray



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksdorp, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016466181

DATE
24/07/2024

Rear Fender Right / Inner Tray



Water level



Carpet Front



**CONDITION REPORT**

Report No: 2016466181

DATE
24/07/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za