



## CONDITION REPORT



Report No:  
2016903489  
DATE  
05/06/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 05/06/2025        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 05/06/2025        |                     | Kempton Park - GT        |

## Vehicle Data

|                 |                                |                         |              |
|-----------------|--------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE              | Registered Owner        |              |
| Manufacturer    | HYUNDAI                        | Registration Number     | FWX543MP     |
| Model           | IX35 2.0 EXECUTIVE [2010-2013] | Register Number         |              |
| VIN             | KMHJU81BLCU560343              | Date Of First Licensing |              |
| Engine Number   |                                | Last COR                |              |
| Doors           | 5                              | License Expiry Date     | 31/01/2026   |
| Color           | BLUE                           | Power / Displacement    |              |
| Year Model      | 2012                           | Paint Finish            | M - METALLIC |
| Km Reading      | 256,260 KM                     | Fuel                    | PETROL       |
| Cab / Body Type | HATCHBACK                      | Transmission            | MANUAL       |

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: KMHJU81BLCU560343



## CONDITION REPORT



Report No:  
2016903489  
DATE  
05/06/2025

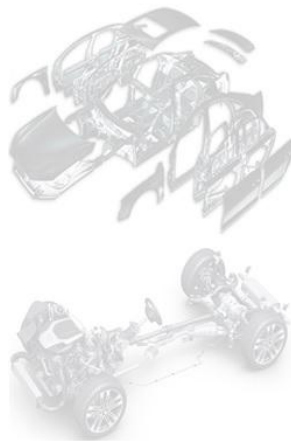

| Damage                                                               | Repair Way                                         |
|----------------------------------------------------------------------|----------------------------------------------------|
| Switch Electrical Window Winder rear left Damaged                    | Repair                                             |
| Seat Front Right Damaged                                             | Repair                                             |
| Front Bumper Paintwork • Scratched                                   | Repair                                             |
| Bonnet Paintwork • Chipmarks                                         | Repair                                             |
| Front Fender Right Paintwork • Scratched                             | Repair                                             |
| Rear Fender Left Dented                                              | Repair                                             |
| Rear Fender Right Paintwork • Scratched                              | Repair                                             |
| Door Front Left Paintwork • Scratched                                | Repair                                             |
| Door Front Right Paintwork • Scratched                               | Repair                                             |
| Door Rear Right Paintwork • Scratched                                | Repair                                             |
| Boot Lid / Hatch door Dented                                         | Repair                                             |
| Rear bumper Paintwork • Scratched                                    | Repair                                             |
| Windscreen Chipped                                                   | Repair                                             |
| Window Rear Door Left Defective                                      | Repair                                             |
| Parking Brake Performance Left / Right Difference out of legal range | Repair                                             |
| Stabilizer Mounting Front Left Damaged                               | Replace                                            |
| Body exterior                                                        | Vehicle got minor scratches, stone chips and dents |
| Body exterior                                                        | Discoloring on some body panels                    |
| Aftermarket exhaust fitted                                           | Repair                                             |
| Both front fender liner damage                                       | Replace                                            |
| Front tires deferred name brand from rear tires                      | Repair                                             |

## Brakes

## Brake Test Results

|                     | Left               | Right              |                  |                                  |
|---------------------|--------------------|--------------------|------------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] | Axle Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
| Front               | 3.4                | 3.3                | -                |                                  |
| Rear                | 2.3                | 2.4                | -                |                                  |
| Emergency / Parking | 1.2                | 2.2                | -                |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size      | Load/Speed Index | Manufacture | Model        | Type* | Production Date | Tread Depth (mm) |
|-------------|-----------|------------------|-------------|--------------|-------|-----------------|------------------|
| Front Left  | 225/55R18 | 98H              | Lanvigator  | Performax    | V     | 1621            | 4 mm             |
| Front Right | 225/55R18 | 98H              | Lanvigator  | Performax    | V     | 1121            | 3 mm             |
| Rear Left   | 225/55R18 | 98V              | Goodyear    | Efficient gr | V     | 4319            | 1 mm             |
| Rear Right  | 225/55R18 | 98V              | Goodyear    | Efficient gr | V     | 4319            | 3 mm             |
| Spare       | 225/45R18 | 95W              | Continental | Contact      | V     | 0000            | 2 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: KMHJU81BLCU560343



## CONDITION REPORT



Report No:  
2016903489  
DATE  
05/06/2025

**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code  | Description       | Status |
|----|--------|-------|-------------------|--------|
| 1  | ACTIVE | B1688 | A/C IONIZER FAULT |        |

**Inspection Conditions**

No Test Drive  
Battery Flat  
Engine number – not possible to verify engine number (not visible without dismantling)  
Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: KMHJU81BLCU560343



## CONDITION REPORT




Report No:  
2016903489  
DATE  
05/06/2025

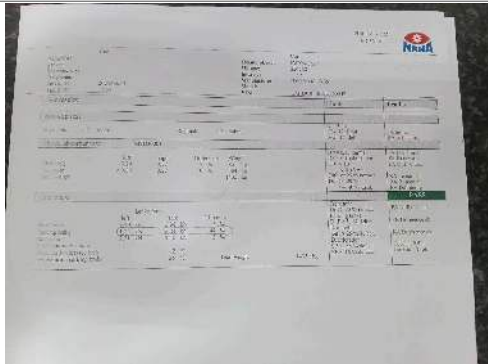

Shock and brake report



Diagnostic report

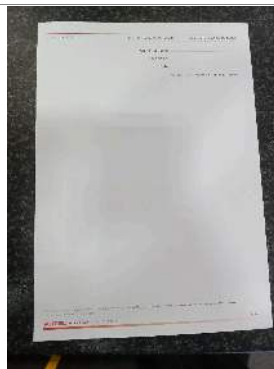

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: KMHJU81BLCU560343



## CONDITION REPORT



Report No:  
2016903489  
DATE  
05/06/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: KMHJU81BLCU560343




## CONDITION REPORT




Report No:  
2016903489  
DATE  
05/06/2025




90 DEGREE LEFT

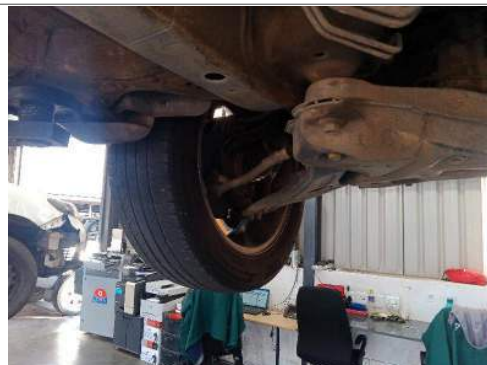

LF TYRE TREAD

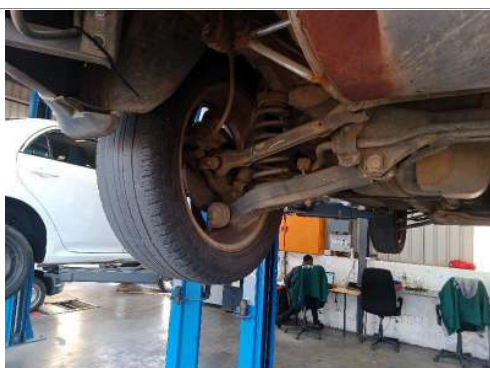

LR TYRE TREAD

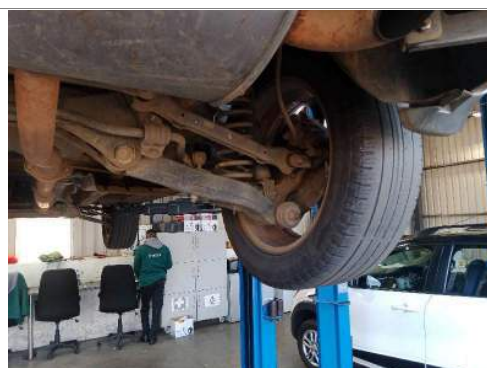

RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: KMHJU81BLCU560343



CONDITION REPORT



Report No:  
2016903489  
DATE  
05/06/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: KMJHU81BLCU560343




CONDITION REPORT



Report No:  
2016903489  
DATE  
05/06/2025



Coolant bottle

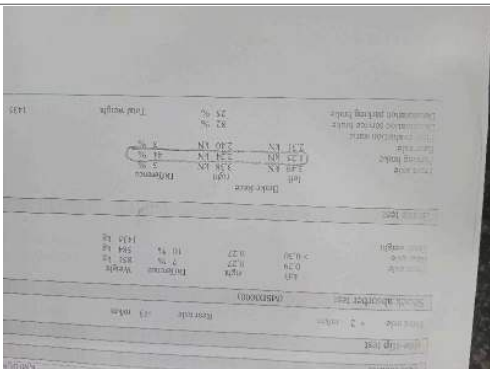

Parking Brake Performance



Water level



Bonnet



Windscreen



Seat Front Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: KMHJU81BLCU560343



## CONDITION REPORT



Report No:  
2016903489  
DATE  
05/06/2025



Rear Fender Right



Door Rear Right



Door Front Right



Front Fender Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: KMHJU81BLCU560343



## CONDITION REPORT




Report No:  
2016903489  
DATE  
05/06/2025



Door Front Left



Rear Fender Left

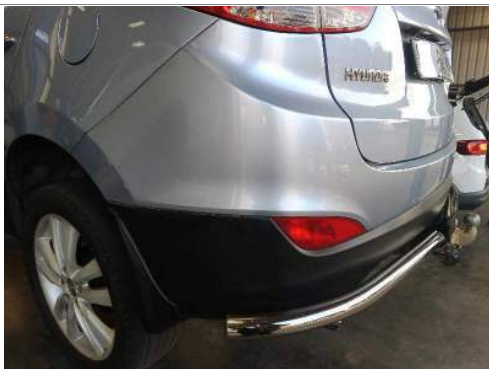

Rear bumper



Rear bumper



Boot Lid / Hatch door



Stabilizer Mounting Front Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: KMHJU81BLCU560343



## CONDITION REPORT



Report No:  
2016903489  
DATE  
05/06/2025



Switch Electrical Window Winder rear left



Window Rear Door Left

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: KMHJU81BLCU560343