



## CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572



## Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	27/05/2024		M57 Pretoria Road - 1619
Inspection Date	27/05/2024		Kempton Park - GT

## Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	FGT291L
Model	H-1	Register Number	
VIN	KMHWH81KMGU801461	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	264,302 KM	Fuel	DIESEL
Cab / Body Type	OTHERS	Transmission	AUTOMATIC

## Vehicle Options &amp; Accessories

## Items

## VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Windscreen Wiper Malfunction	Replace
Park Light Rear Right Defective	Repair
Fog Light Front Left Missing	Replace
Fog Light Front Right Defective	Replace
Seat Front Right Excessive Wear & Tear	Repair
Seat Rear Torn / Cut	Repair
Door Handle Rear Right Damaged	Replace
Channel / Roof Gutter Left Damaged	Repair
Front Bumper Residual Traces of Repair	Repair
Grill Damaged	Replace
Bonnet Paintwork • Flaking	Repair
Front Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Door Front Left Residual Traces of Repair	Repair
Sill Panel Right Damaged	Repair
Sliding Door Dented	Repair
Windscreen Cracked	Replace
Shock Absorber Rear Right Leak	Replace
Tyre Rear Left Smooth	Replace
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Catalytic converter Welded	Replace
Axle and suspension.	Both front control arm bushes covered
Body exterior	Signs of spray work done on some body panels
Body exterior	Minor dents scratches and stone chips on some body
Warning lights illuminated.	Repair.
Axle and suspension	Excessive noise front suspension

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: KMHWH81KMGU801461

1 / 13



## CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024

### Brakes

#### Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [KN]	Braking Force [KN]		
Front	5.3	5.6	-	
Rear	2.4	3.3	-	
Emergency / Parking	3.3	3.4	-	

### Tyres and Rims

#### Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65R16	109/107R	Grenlander	L-max		0119	1 mm
Front Right	215/65R16	109/107R	Grenlander	L-max	V	0119	1 mm
Rear Left	215/70R16	99T	Lanvigator	Catchfors	V	1321	0 mm
Rear Right	215/65R16	98H	Continental	Contact	V	4018	1 mm
Spare	195/75R16	107/105	Michelin	Aglis	V	///////	1 mm

\* Tyre Legend: V=Virgin, R=Recap

### Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

### Inspection Conditions

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



# CONDITION REPORT


VIN: KM1HW181KMG4801461

Report No: 2016395143


2 / 13

DATE


27/05/2024

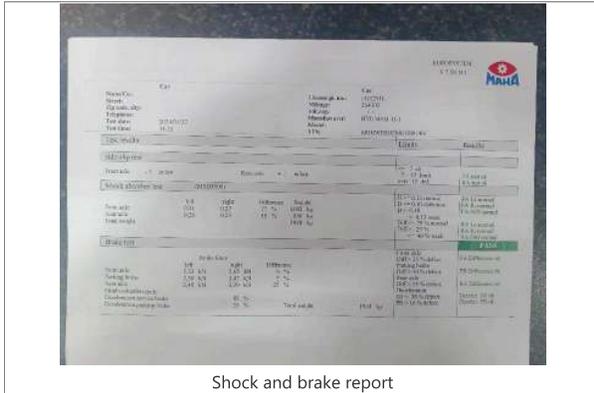

Shock and brake report

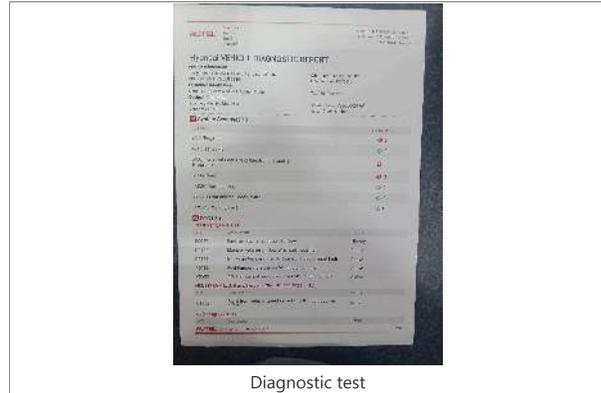

Diagnostic test

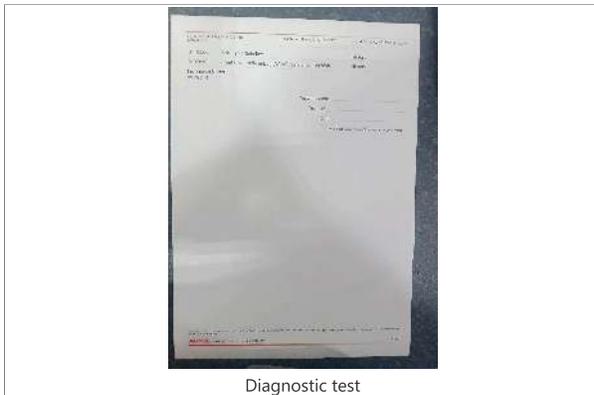

Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016395143**

VIN: KMHWH81KMGU801461

**DATE**

**27/05/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

VIN: KMHWH81KMGU801461  
DATE: 27/05/2024  
4 / 13



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016395143**

**DATE**

**27/05/2024**

~~VIN: KMHWH81KMGU801461~~

5 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024

VIN: KMHWH81KMGU801461

6 / 13



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016395143**

**DATE**  
**27/05/2024**

VIN: KMHWH81KMGU801461

7 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za





**CONDITION REPORT**

**Report No: 2016395143**

**DATE**  
**27/05/2024**

VIN: KMHWH81KMGU801461

9 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024



Oil sump bolt loose



Left side sliding window damag

VIN: KMHWH81KMGU801461

10 / 13



L/F fender liner missing



Oil cap and dipstick



Coolant reservoir



Warning lights illuminated

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016395143**

**DATE**  
**27/05/2024**

VIN: KMHWH81KMGU801461

11 / 13


DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024

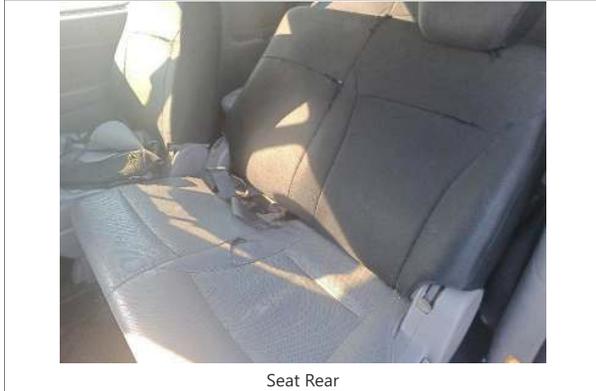

Seat Rear



Door Handle Rear Right

VIN: KMHWH81KMGU801461  
12 / 13



Seat Front Right



Windscreen



Sliding Door



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024

VIN: KMHWH81KMGU801461

13 / 13

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024



Front Bumper



Front Bumper



Fog Light Front Right



Grill



Fog Light Front Left



Front Bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

Report No: 2016395143

DATE  
27/05/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024



Bolt(s) / Nut(s) Front Wheel Left



Front Fender Left



Door Front Left



Sliding Door



Rear Fender Right



Engine

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

Report No: 2016395143

DATE  
27/05/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024



Engine




Engine




Engine Wiring



Catalytic converter

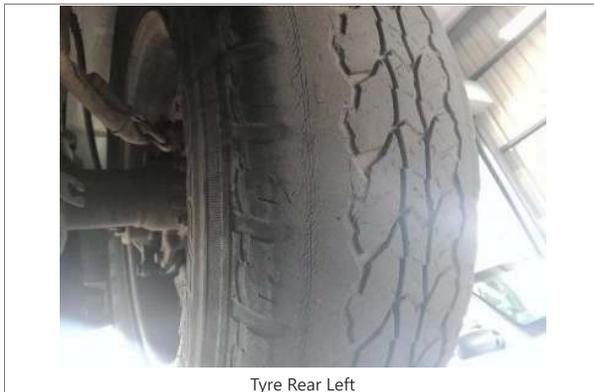

Tyre Rear Left

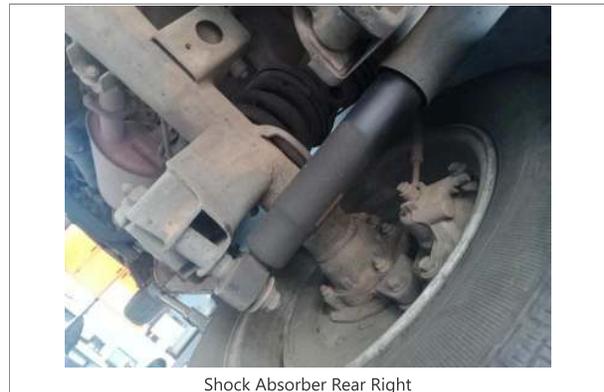

Shock Absorber Rear Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016395143

DATE  
27/05/2024



Sill Panel Right



Sill Panel Right



Park Light Rear Right



Channel / Roof Gutter Left



Bonnet



Windscreen Wiper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za



**CONDITION REPORT**

**Report No: 2016395143**

**DATE**  
**27/05/2024**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za