

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	30/12/2024		M57 Pretoria Road - 1619
Inspection Date	30/12/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	FJ90WWGP
Model	PICANTO 1.0 LX 5-DR [2011-2018]	Register Number	
VIN	KNABE511LHT307965	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2024
Color	PURPLE	Power / Displacement	
Year Model	2016	Paint Finish	TWO COAT METALLIC
Km Reading	169,492 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Replace
Switch Electrical Window Winder front left Defective	Replace
Tail Light Left Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
A • Pillar Left Damaged	Repair
C • Pillar Left Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Rear bumper Damaged	Repair
Windscreen Damaged	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Gearbox Oil Leak	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: KNABE511LHT307965

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.04	2.09	-	
Rear	0.93	0.72	-	
Emergency / Parking	0.92	0.48	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/60R14	82H	Goodyear	Efficient	V	0422	0 mm
Front Right	175/70R13	82T	Continental	Contieco	V	3511	0 mm
Rear Left	185/60R14	82H	Goodyear	Efficient	V	2419	1 mm
Rear Right	175/65R14	82T	Continental	Contieco	V	4617	4 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: excessive oil leak.

Body • Exterior: Battery loose. Minor dents and scratches and stone chips. Signs of repair work done to somebody panels. Poor alignment to somebody panels. Vehicle body and poor condition.

Axle and Suspension: rear shock tests not performed.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER

VIN: KNABE511LHT307965
2 / 10



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT

VIN: KNABE511LHT307965

3 / 10




90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

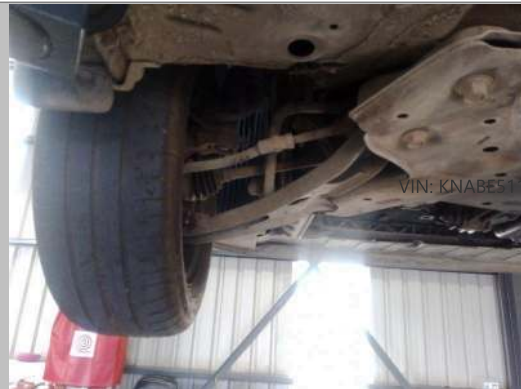

LF TYRE TREAD

VIN: KNABES11 LHT307965
4 / 10

LR TYRE TREAD



RR TYRE TREAD

VIN: KNABE511LHT307965

5 / 10




RF TYRE TREAD




LICENSE DISC




VIN PLATE OR STICKER

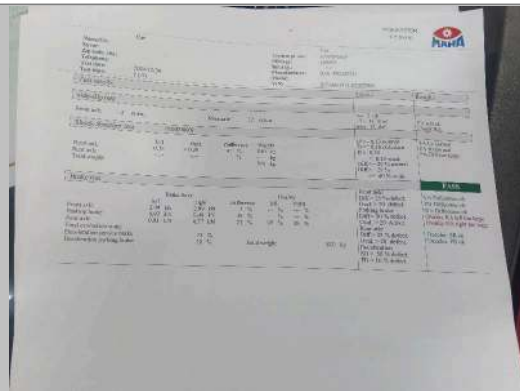

ADDITIONAL 1

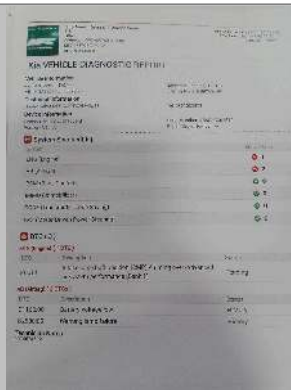

ADDITIONAL 2

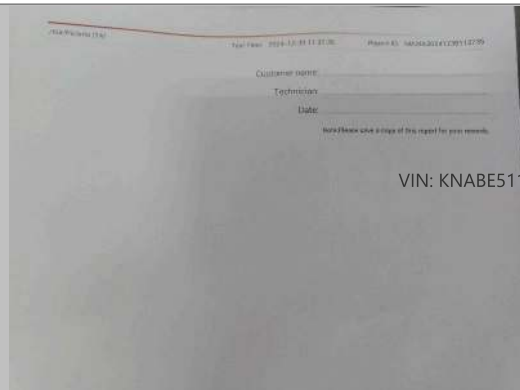

ADDITIONAL 3

VIN: KNABE511LHT307965

6 / 10

VIN: KNABE511LHT307965

7 / 10



ADDITIONAL 4



ADDITIONAL 5



ENGINE 1



ADDITIONAL 10



ADDITIONAL 11



Water level



Front Bumper



Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left

VIN: KNABE511LHT307965

10 / 10



Rear Fender Left



C • Pillar Left




A • Pillar Left



Rear bumper



Rear bumper

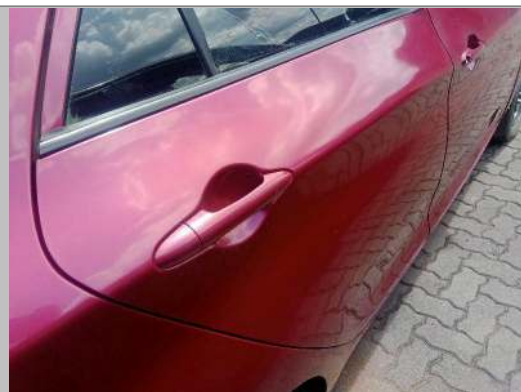

Door Rear Right



Door Front Right



Front Fender Right



Rear Fender Right



Windscreen



Tail Light Left



Tyre Front Right



Tyre Front Left



Engine



Gearbox



Switch Electrical Window Winder front left



Switch Electrical Window Winder front left



CONDITION REPORT

Report No: 2016674532

DATE
30/12/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za