



CONDITION REPORT

Report No: 2016191495

DATE
06/12/2023MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
GautengDEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/12/2023		M57 Pretoria Road - 1619
Inspection Date	06/12/2023		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	FV93JYGP
Model	RIO	Register Number	
VIN	KNADN511LG6056984	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	119,506 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

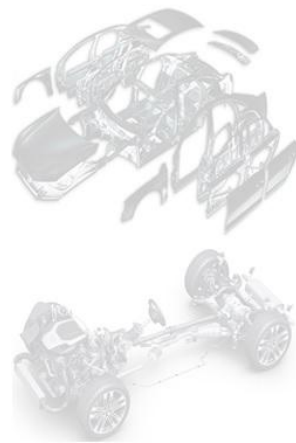

Damage	Repair Way
Front Bumper Paintwork • Scratched	Repair
Rear Fender Left Paintwork • Scratched	Repair
Door Front Left Paintwork • Discoloured	Repair
Door Front Right Paintwork • Discoloured	Repair
Rear bumper Paintwork • Scratched	Repair
Sill Panel Left Paintwork • Scratched	Repair



CONDITION REPORT

Report No: 2016191495

DATE
06/12/2023

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.5	2.6	-	
Rear	1.5	1.4	-	
Emergency / Parking	1.5	1.6	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	88H	Dunlop	Sp sport	V	4521	3 mm
Front Right	185/65R15	88H	Dunlop	Sp sport	V	4621	3 mm
Rear Left	185/65R15	88H	Dunlop	Sp sport	V	4521	3 mm
Rear Right	185/65R15	88H	Dunlop	Sp sport	V	4621	3 mm
Spare	185/65R15	88H	Kumho	Solus	V	2716	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Vehicle got minor scratches, stone chips and dents on some body panels and discolouring on some body panels

Concluding Remarks


THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Andrick Wymers

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

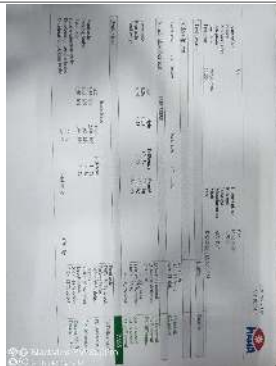

Shock and brake report



Diagnostic report

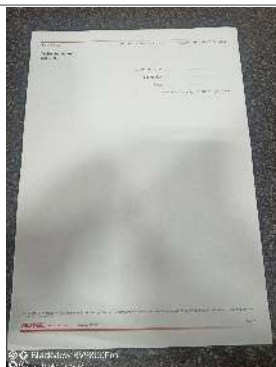

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: KNADN511LG6056984


4 / 8



CONDITION REPORT

Report No: 2016191495

DATE
06/12/2023

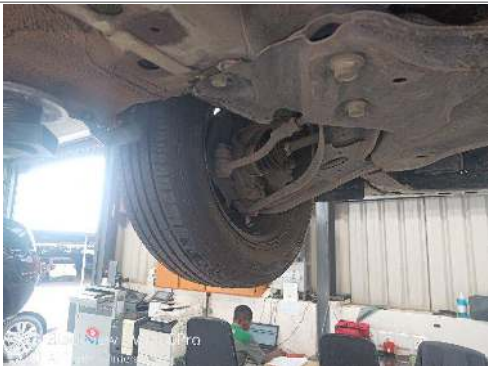

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC

VIN: KNADN511LG6056984



CONDITION REPORT

Report No: 2016191495

DATE
06/12/2023



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Coolant bottle



Oil cap and dipstick

VIN: KNADN511LG605984
6 / 8



CONDITION REPORT

Report No: 2016191495

DATE
06/12/2023

Manual



Water level



Door Front Right



Door Front Left



Front Bumper



Sill Panel Left

VIN: KNADN511LG6056984

7 / 8



CONDITION REPORT

Report No: 2016191495

DATE
06/12/2023

Rear Fender Left



Rear bumper



Rear bumper

VIN: KNADN511LG6056984

8 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za