



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**


Client	MFC Auction House	Inspection Location	MFC
Requested Date	10/01/2024		M57 Pretoria Road - 1619
Inspection Date	10/01/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	KIA	Registration Number	KM22SKGP
Model	K2700	Register Number	
VIN	KNCSHX71LN7576095	Date Of First Licensing	
Engine Number		Last COR	
Doors	2	License Expiry Date	28/02/2023
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	2,705 KM	Fuel	DIESEL
Cab / Body Type	SINGLE CAB	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION

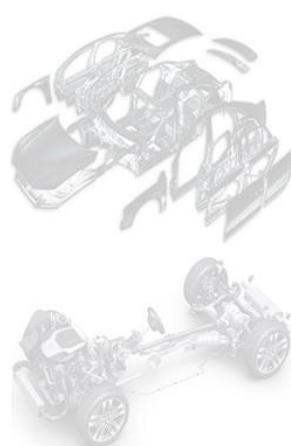

Damage	Repair Way
Headlight Right Scratched	Repair
Side Mirror Left Damaged	Replace
Front Bumper Paintwork • Scratched	Repair
Bonnet Paintwork • Chipmarks	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Tailgate Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Load Body Defective	Repair
Service Brake Performance Rear Axle Left / Right Difference out of legal range	Repair
Triangle Missing	Replace



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [kN]	Braking Force [kN]	Axle Weight [kg]	Deceleration [m/s ²]
Front	4.06	4.28	-	
Rear	1.02	1.44	-	
Emergency / Parking	1.65	2.83	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	195R14C	106P	Hankook	Radial	V	3521	7 mm
Front Right	195R14C	106P	Hankook	Radial	V	3521	7 mm
Rear Left	195R14C	106P	Hankook	Radial	V	3521	7 mm
Rear Right	195R14C	106P	Hankook	Radial	V	3521	7 mm
Spare	195R14C	106P	Hankook	Radial	V	0000	8 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

A vehicle diagnostic has not been conducted.

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Engine Compartment: Engine bay dirty. Brake fluid level ok.

Interior: Vehicle interior dirty and so

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks:

The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

VIN: KNCF672016240053

Report No: 2016240053

2 / 9

DATE

10/01/2024

Brake and shock absorber report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



CONDITION REPORT

Report No: 2016224153

VIN: KNCSHX71LN7576095

DATE

10/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016224153

DATE

VIN: KNC SHX710/01/2024

4 / 9



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



CONDITION REPORT

Report No: 2016224153

DATE

10/01/2024

VIN: KNCSHX71LN7576095

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

VIN: KNCSHX71LN7576095

6 / 9



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1





CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

VIN: KNCSHX71LN7576095

7 / 9



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

Front chassis



Rear chassis



Jack



Oil cap and dipstick



Manual Transmission



Spare wheel Accessories



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024


VIN: KNCSHX71LN7576095

9 / 9



CONDITION REPORT


Report No: 2016224153

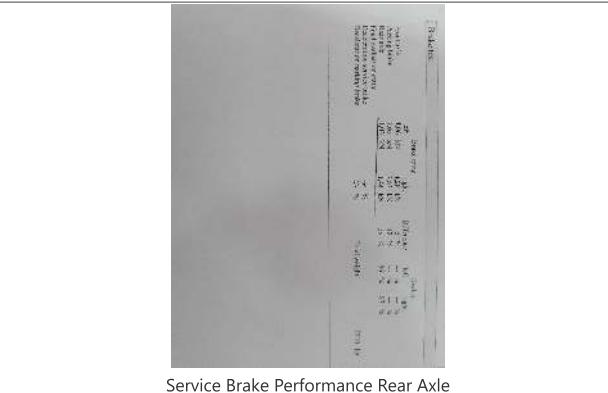DATE
10/01/2024

Service Brake Performance Rear Axle



Door Front Right

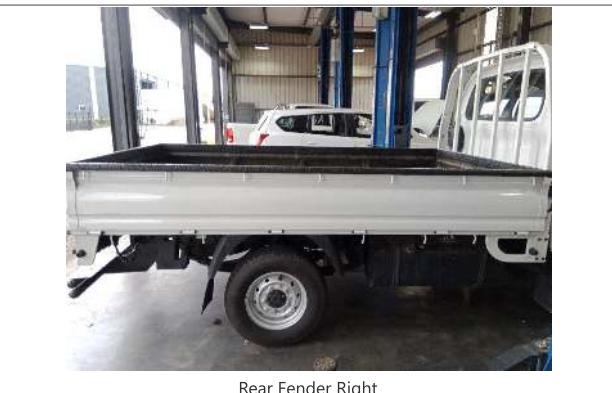

Rear Fender Right



Bonnet



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

Door Front Left



Side Mirror Left



Rear Fender Left



Tailgate



Rear bumper



Rear bumper



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

Load Body



Water level



Headlight Right



CONDITION REPORT

Report No: 2016224153

DATE
10/01/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za