



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**

|                 |                   |                     |                          |
|-----------------|-------------------|---------------------|--------------------------|
| Client          | MFC Auction House | Inspection Location | MFC                      |
| Requested Date  | 12/08/2025        |                     | M57 Pretoria Road - 1619 |
| Inspection Date | 12/08/2025        |                     | Kempton Park - GT        |

**Vehicle Data**

|                 |                                |                         |              |
|-----------------|--------------------------------|-------------------------|--------------|
| Vehicle Type    | PASSENGER VEHICLE              | Registered Owner        |              |
| Manufacturer    | HAVAL                          | Registration Number     | LK76BHGP     |
| Model           | JOLION 1.5T LUXURY [2021-2024] | Register Number         |              |
| VIN             | LGWEE4A51PK617146              | Date Of First Licensing |              |
| Engine Number   |                                | Last COR                |              |
| Doors           | 5                              | License Expiry Date     | 30/11/2025   |
| Color           | RED                            | Power / Displacement    |              |
| Year Model      | 2023                           | Paint Finish            | M - METALLIC |
| Km Reading      | 25,201 KM                      | Fuel                    | PETROL       |
| Cab / Body Type | STATION WAGON                  | Transmission            | MANUAL       |

**Vehicle Options & Accessories****Items****VEHICLE INSPECTION**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za


VIN: LGWEE4A51PK617146



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025

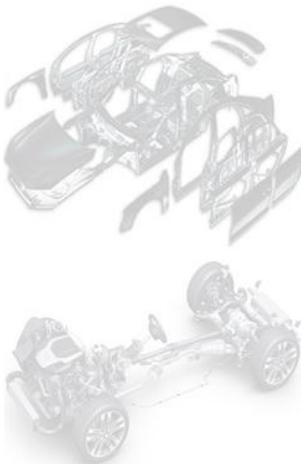

| Damage                                       | Repair Way |
|----------------------------------------------|------------|
| Headlight Left Damaged                       | Replace    |
| Headlight Right Damaged                      | Replace    |
| Front Bumper Paintwork • Scratched           | Repair     |
| Bonnet Residual Traces of Repair             | Repair     |
| Front Fender Left Residual Traces of Repair  | Repair     |
| Front Fender Right Residual Traces of Repair | Repair     |
| Rear Fender Left Dented                      | Repair     |
| Rear Fender Right Residual Traces of Repair  | Repair     |
| Door Front Left Paintwork • Scratched        | Repair     |
| Door Front Right Paintwork • Scratched       | Repair     |
| Door Rear Left Paintwork • Scratched         | Repair     |
| Door Rear Right Paintwork • Scratched        | Repair     |
| Boot Lid / Hatch door Paintwork • Chipmarks  | Repair     |
| Rear bumper Paintwork • Scratched            | Repair     |
| Windscreen Cracked                           | Replace    |
| Gearbox Oil Leak                             | Repair     |

## Brakes

## Brake Test Results

|                     | Left               | Right              | Axe Weight [KG] | Deceleration [m/s <sup>2</sup> ] |
|---------------------|--------------------|--------------------|-----------------|----------------------------------|
|                     | Braking Force [KN] | Braking Force [KN] |                 |                                  |
| Front               | 3.3                | 2.9                | -               |                                  |
| Rear                | 1.7                | 1.7                | -               |                                  |
| Emergency / Parking | 2.2                | 2.1                | -               |                                  |

## Tyres and Rims

## Tyre Specification &amp; Measurement

|             | Size       | Load/Speed Index | Manufacture | Model     | Type* | Production Date | Tread Depth (mm) |
|-------------|------------|------------------|-------------|-----------|-------|-----------------|------------------|
| Front Left  | 225/55R18  | 102Y             | Radar       | RPX -800  | V     | 4323            | 3 mm             |
| Front Right | 225/55R18  | 102Y             | Radar       | RPX -800  | V     | 4223            | 3 mm             |
| Rear Left   | 225/55R18  | 98V              | Kumho       | Solus     | V     | 4422            | 3 mm             |
| Rear Right  | 225/55R18  | 98V              | Kumho       | Solus     | V     | 4422            | 3 mm             |
| Spare       | T135/90R17 | 104M             | Ling long   | Temporary | V     | ////            | 3 mm             |

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: LGWEE4A51PK617146



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025

**Diagnostic**

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

| No | System | Code    | Description         | Status      |
|----|--------|---------|---------------------|-------------|
| 1  | APS    | U110116 | ECU VOLTAGE TOO LOW | HISTORY DTC |

**Inspection Conditions**

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

**Comments**

General Comments: SIGNS OF SPRAY WORK DONE ON SOME BODY PANELS. ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL, AND MECHANICAL PARTS

**Concluding Remarks**

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

**Technician**

Andrick Wymers

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: LGWEE4A51PK617146



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



Spare wheel



ENGINE 1

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: LGWEE4A51PK617146



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025




Expedition bottle



Oil cap and dipstick



VIN PLATE OR STICKER

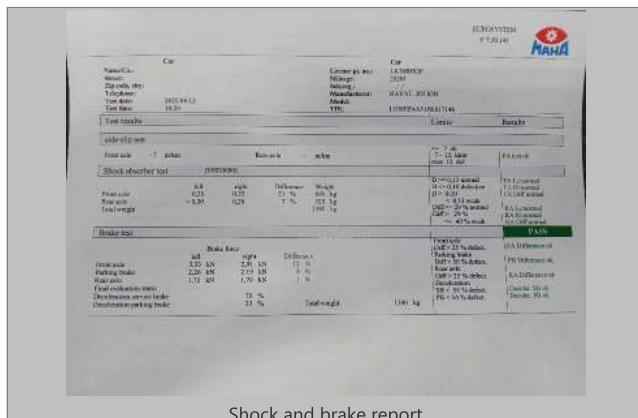

Shock and brake report



Diagnostic report

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: LGWEE4A51PK617146



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025



Diagnostic report



Diagnostic report



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: LGWEE4A51PK617146



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025



CHASSIS



ENGINE 2



Water level



Headlight Left



Headlight Right



Bonnet

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: LGWEE4A51PK617146



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025



Front Fender Right



Front Fender Left



Front Bumper



Front Bumper



Windscreen



Rear Fender Right

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: LGWEE4A51PK617146



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025



Door Rear Right



Door Front Right




Door Front Left



Door Rear Left



Rear Fender Left

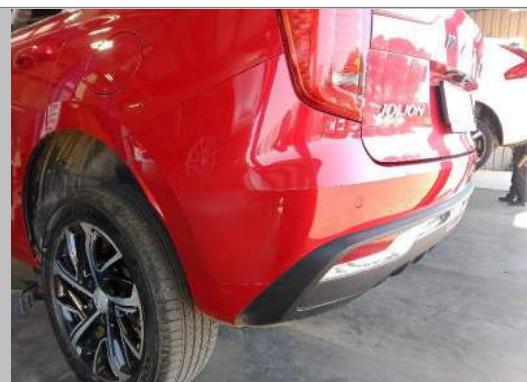

Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: LGWEE4A51PK617146



## CONDITION REPORT



Report No:  
2016976331  
DATE  
12/08/2025



Rear bumper



Boot Lid / Hatch door



Gearbox

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: LGWEE4A51PK617146