

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/02/2024		M57 Pretoria Road - 1619
Inspection Date	14/02/2024		Kempton Park - GT

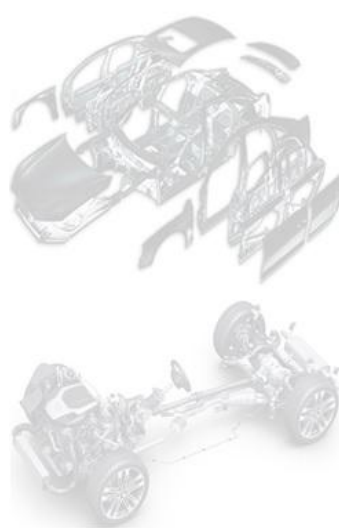
Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	GWM	Registration Number	HTX204NW
Model	H5	Register Number	
VIN	LGWEF3A5XCB617356	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2023
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	181,916 KM	Fuel	PETROL
Cab / Body Type	STATION WAGON	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way
	Engine Oil Leak	Repair
	Engine Wiring Defective	Repair
	Expansion Bottle Water Leak	Replace
	Air cleaner Damaged	Repair
	Under bonnet insulation cover Damaged	Repair
	Center Console / Cubbyhole + Lid Broken	Repair
	Windscreen Wiper Damaged	Replace
	Tail Light Left Defective	Replace
	Tail Light Right Defective	Replace
	Fog Light Front Left Damaged	Replace
	Headlight Left Damaged	Replace
	Headlight Right Damaged	Replace
	Seat Front Left Damaged	Repair
	Seat Front Right Damaged	Repair
	Seat Rear Damaged	Repair
	Seat Belt Rear Middle Missing	Replace
	Sun Visor Right Cracked	Repair
	Hood Lining Defective	Repair
	Door Panel Front Left Defective	Repair
	Door Panel Front Right Defective	Repair
	Door Handle Front Left Damaged	Replace
	Door Handle Front Right Missing	Replace
	Door Handle Rear Left Damaged	Replace
	Door Handle Rear Right Damaged	Replace
	Gear Lever Dust Boot Damaged	Repair
	Clutch Pedal Rubber Missing	Replace
	Brake Pedal Rubber Torn / Cut	Replace
	Steering Wheel Trim Defective	Repair
	Side Mirror Left Damaged	Replace

Damage	Repair Way
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Residual Traces of Repair	Replace
C • Pillar Left Dented	Repair
C • Pillar Right Dented	Repair
Front Fender Left Residual Traces of Repair	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Dented	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Residual Traces of Repair	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Damaged	Repair
Roof Dented	Repair
Windscreen Chipped	Replace
Bolt(s) / Nut(s) Front Wheel Right Missing	Replace
Chassis Welded	Repair
Belly plates Damaged	Repair
Gearbox Oil Leak	Repair
Differential Oil Sweat	Repair
Fuel Tank Sweat	Repair
Fuel Lines Defective	Repair
Engine Noise Excessive	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	3.64	4.29	-	
Rear	3.63	3.97	-	
Emergency / Parking	2.19	3.45	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	235/65 R17	104H	Hilo	Sport	V	0120	3 mm
Front Right	235/65 R17	104H	Hilo	Sport	V	4219	2 mm
Rear Left	235/65 R17	104H	Hilo	Sport	V	0120	3 mm
Rear Right	235/65 R17	108T	Goodyear	Wrangler	V	4217	2 mm
Spare	235/65 R17	104H	Wideway	Speedmax	V	0000	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	SRS(AIRBAG SYSTEM)-BOSCH ABS SYSTEM	B0048	CRASH OUTPUT OF CONTROLLER SHORT TO GND OR OPEN	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ?ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Engine bay dirty.Brake fluid level ok.Battery loose.Oil sweat on power steering re

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE LEFT



ODOMETER

VIN: LGWEF3A5XCB617356

7 / 19



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



Manual Transmission



Oil cap and dipstick



Front chassis



Rear chassis

VIN: LGWEF3A5XCB617356

8 / 19



Spare wheel



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



ENGINE 1

VIN: LGWEF3A5XCB617356

10 / 19



Headlight Left



Headlight Right

VIN: LGWEF3A5XCB617356

11 / 19



Fog Light Front Left



Grill



Front Bumper



Front Bumper

VIN: LGWEF3A5XCB617356

12 / 19



Bonnet



Windscreen



Front Fender Left



Door Front Left



Side Mirror Left



Side Mirror Left

VIN: LGWEF3A5XCB617356

14 / 19



Door Panel Front Left



VIN: LGWEF3A5XCB617356

15 / 19

Seat Front Left



Door Rear Left



Rear Fender Left



Door Handle Rear Left



C • Pillar Left

VIN: LGWEF3A5XCB617356

16 / 19



Door Handle Front Left



Rear bumper

VIN: LGWEF3A5XCB617356

17 / 19



Rear bumper



Boot Lid / Hatch door



Tail Light Left



Tail Light Right

VIN: LGWEF3A5XCB617356

18 / 19



Windscreen Wiper



Rear Fender Right

VIN: LGWEF3A5XCB617356

19 / 19



Door Rear Right



Door Front Right



Seat Rear



Door Handle Rear Right



C • Pillar Right



Seat Front Right



Door Panel Front Right



Door Handle Front Right



Door Panel Front Right



Roof



Center Console / Cubbyhole + Lid



Hood Lining



Steering Wheel Trim



Clutch Pedal Rubber



Brake Pedal Rubber



Side Mirror Right



Air cleaner



Expansion Bottle



Engine Wiring



Engine Wiring



Bolt(s) / Nut(s) Front Wheel Right



Gearbox



Engine



Differential



Chassis



Fuel Tank



Fuel Lines



Belly plates



Engine Wiring



Side Mirror Right



Water level



Engine Wiring



Under bonnet insulation cover



Gear Lever Dust Boot



Seat Belt Rear Middle



Sun Visor Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za