



CONDITION REPORT

Report No: 2016186904

DATE
01/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/12/2023		M57 Pretoria Road - 1619
Inspection Date	01/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	SUZUKI	Registration Number	KLY712NW
Model	VITARA BREZZA	Register Number	
VIN	MA3NYFJ1S00726057	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	01/12/2023
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	TWO COAT METALLIC
Km Reading	46,304 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Hood Lining Damaged	Replace
Parcel Tray Missing	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Replace
Back Window Damaged	Repair
Tyre Front Left Worn	Replace



CONDITION REPORT

Report No: 2016186904

DATE
01/12/2023

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.23	2.87	-	
Rear	1.86	2.43	-	
Emergency / Parking	1.59	1.65	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/60R16	95H	Apollo	Radial	V	5120	0 mm
Front Right	215/60R16	95H	Apollo	Radial	V	5220	4 mm
Rear Left	215/60R16	95H	Apollo	Radial	V	5120	2 mm
Rear Right	215/60R16	95H	Apollo	Radial	V	5120	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Vehicle Dirty

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

Interior: Vehicle interior in poor condition. Vehicle interior dirty.

Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to some body panels. Poor alignment to some body panels. Signs of impact damage to rear of vehicle. Repair work done to vehicle below standard. Vehicle body in poor condition.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

VIN: MA3NYFJ1S00726057

2 / 10

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT


Report No: 2016186904

DATE
01/12/2023

ADDITIONAL 1

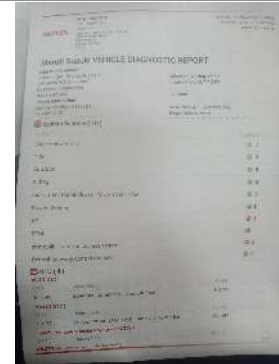

ADDITIONAL 2

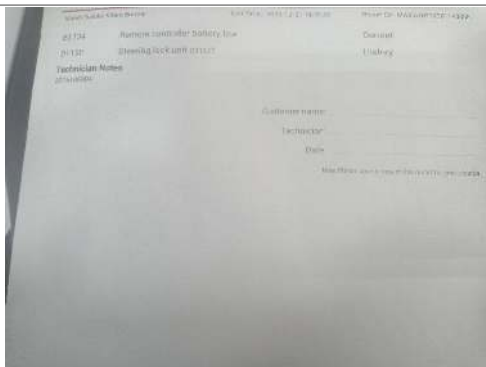

ADDITIONAL 3



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

VIN: MA3NYFJ1S00726057

3 / 10



CONDITION REPORT

Report No: 2016186904

DATE
01/12/2023

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: MA3NYFJ1S00726057

4 / 10



CONDITION REPORT

Report No: 2016186904

DATE
01/12/2023

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

VIN: MA3NYFJ1S00726057

5 / 10



CONDITION REPORT

Report No: 2016186904

DATE
01/12/2023

ENGINE 1



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 10



ADDITIONAL 11



Water level

VIN: MA3NYFJ1S00726057

6 / 10



CONDITION REPORT

Report No: 2016186904

DATE
01/12/2023

Front Bumper




Front Bumper



Bonnet



Front Fender Left

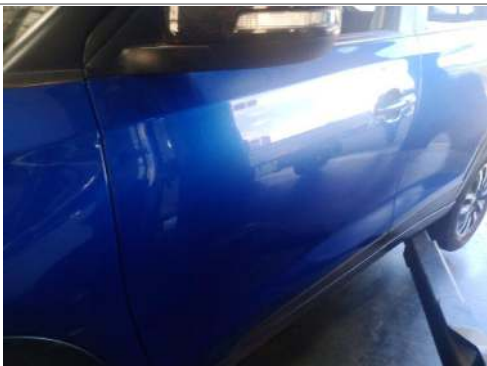

Door Front Left



Door Rear Left



CONDITION REPORT

Report No: 2016186904

DATE
01/12/2023


Rear Fender Left




Rear bumper



Rear bumper

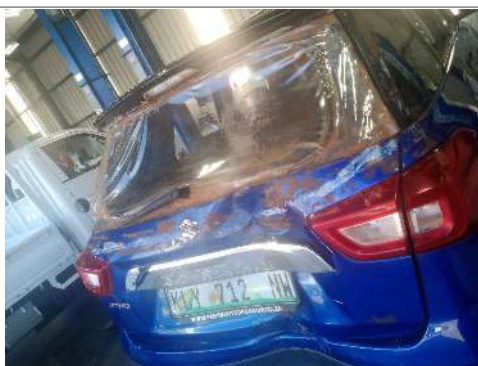

Boot Lid / Hatch door

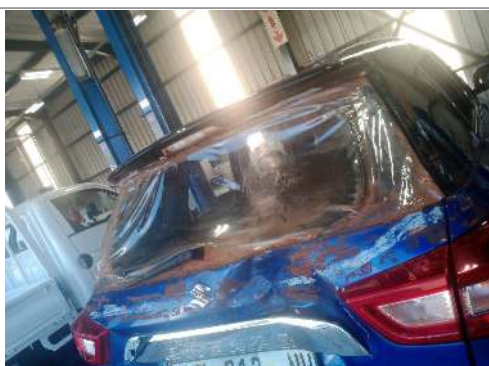

Back Window



Door Rear Right

VIN: MA3NMF1JS00726057
8 / 10



CONDITION REPORT


Report No: 2016186904

DATE
01/12/2023

Door Front Right



Rear Fender Right

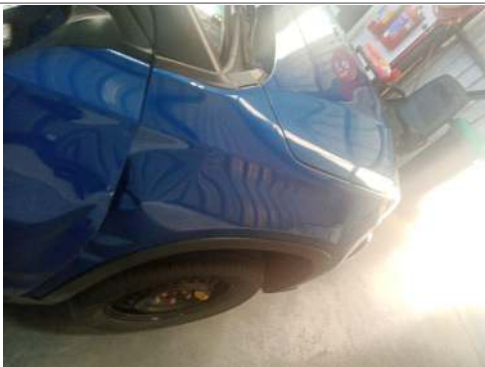

Front Fender Right



Hood Lining



Hood Lining



Parcel Tray

VIN: MA3NYFJ1S00726057
9 / 10



CONDITION REPORT

Report No: 2016186904

DATE
01/12/2023

Inner Boot Floor Pan and Spare Wheel Well



Tyre Front Left

VIN: MA3NYFJ1S00726057

10 / 10