



CONDITION REPORT

Report No: 2016866051

DATE
06/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	06/05/2025		M57 Pretoria Road - 1619
Inspection Date	06/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	SUZUKI	Registration Number	JDD456FS
Model	CELERIO 1.0 GL 5-DR [2022-ON]	Register Number	
VIN	MA3TFC62S00158009	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/06/2025
Color	WHITE	Power / Displacement	
Year Model	2022	Paint Finish	M - METALLIC
Km Reading	57,196 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Windscreen Wiper Worn	Replace
Front Bumper Paintwork • Scratched	Repair
Front Fender Left Residual Traces of Repair	Repair
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00158009



CONDITION REPORT

Report No: 2016866051

DATE
06/05/2025

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	2.4	2.0	-	
Rear	0.9	1.4	-	
Emergency / Parking	0.7	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/60R15	81H	Hilo	Genesys	V	4023	5 mm
Front Right	175/60R15	81H	Hilo	Genesys	V	4023	5 mm
Rear Left	175/60R15	81H	Hilo	Genesys	V	4023	5 mm
Rear Right	175/60R15	81H	Hilo	Genesys	V	4023	6 mm
Spare	165/70R14	81S	Bridgestone	Ecopia	V	//////	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1137-1C	STEERING ANGLE SENSOR POWER SUPPLY SYSTEM ERROR	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. SIGNS OF SPRAY WORK DONE ON SOME BODY PANELS

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00158009



CONDITION REPORT

Report No: 2016866051

DATE
06/05/2025

FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE RIGHT



90 DEGREE LEFT



90 DEGREE FRONT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00158009



CONDITION REPORT

Report No: 2016866051

DATE
06/05/2025


ODOMETER



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)

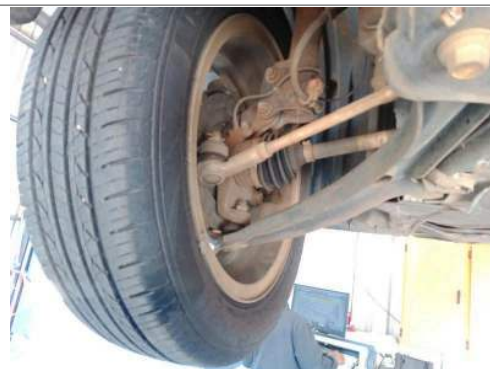

LF TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00158009



CONDITION REPORT

Report No: 2016866051

DATE
06/05/2025

LR TYRE TREAD



Manual



Coolant reservoir



Oil cap and dipstick



Rear end



Sparewheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00158009



CONDITION REPORT

Report No: 2016866051

DATE
06/05/2025

ENGINE 1



CHASSIS




ENGINE 2



VIN PLATE OR STICKER



LICENSE DISC

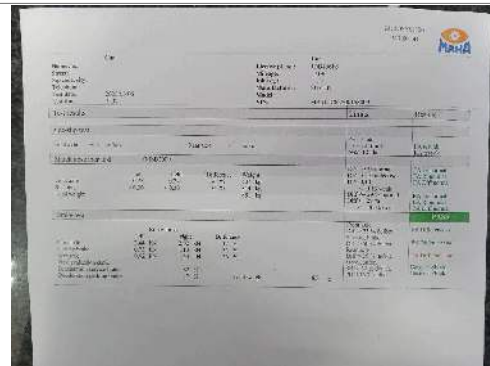

SHOCK & BRAKE REPORT


DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00158009




CONDITION REPORT

Report No: 2016866051

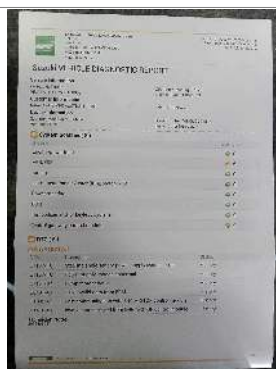DATE
06/05/2025


DIAGNOSTIC REPORT PAGE 1

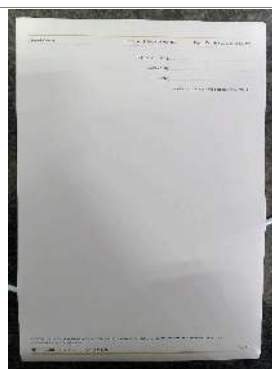


DIAGNOSTIC REPORT PAGE 2




Windscreen Wiper

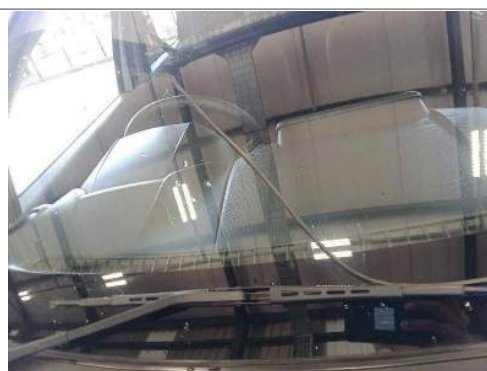

Windscreen Wiper

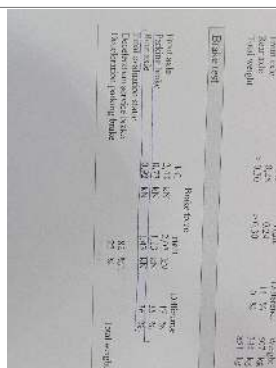

Parking Brake Performance

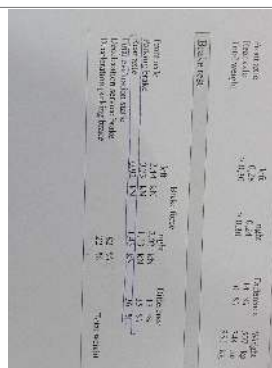

Service Brake Performance Rear Axle

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00158009



CONDITION REPORT

Report No: 2016866051

DATE
06/05/2025

Water level



Front Bumper



Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MA3TFC62S00158009