

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	21/12/2023		M57 Pretoria Road - 1619
Inspection Date	21/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	CL15VVGP
Model	FIGO	Register Number	
VIN	MAJ1XXMRJ1CY35347	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/01/2023
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	203,178 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

	Damage	Repair Way
	Engine Wiring Defective	Repair
	Caps Missing	Replace
	Hoses Defective	Replace
	Expansion Bottle Defective	Replace
	Battery clamps Defective	Replace
	Head Light Switch Damaged	Replace
	Center Console / Cubbyhole + Lid Defective	Repair
	Windscreen Wiper Defective	Replace
	Air Conditioner Insufficient	Replace
	Tail Light Right Cracked	Replace
	Headlight Left Defective	Replace
	Headlight Right Defective	Replace
	Seat Front Left Defective	Repair
	Seat Front Right Defective	Repair
	Seat Rear Damaged	Repair
	Hood Lining Defective	Repair
	Door Panel Front Left Defective	Repair
	Door Handle Rear Right Damaged	Replace
	Door Sealing Rubber Front Right Damaged	Replace
	Door Sealing Rubber Rear Left Damaged	Replace
	Door Sealing Rubber Rear Right Damaged	Replace
	Door Lock Front Left Defective	Replace
	Door Lock Front Right Defective	Replace
	Parcel Tray Missing	Replace
	Carpet Front Damaged	Repair
	Clutch Pedal Rubber Worn	Replace
	Brake Pedal Rubber Damaged	Replace
	Steering Wheel Trim Defective	Repair
	Number Plate Front Damaged	Repair

Damage	Repair Way
Number Plate Rear Defective	Repair
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Residual Traces of Repair	Repair
Front Fender Left Damaged	Repair
Front Fender Right Paintwork • Scratched	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Damaged	Repair
Door Rear Right Dented	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Paintwork • Scratched	Repair
Sill Panel Right Paintwork • Scratched	Repair
Rocker Panel Left Dented	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Service Brake Performance Rear Axle Left / Right	Repair
Difference out of legal range	
Parking Brake Performance Left / Right Difference out of legal range	Repair
Steering box Leak	Repair
Tie Rod End left Cracked	Replace
Tie Rod End right Cracked	Replace
Steering Rack Boot Left Leak	Replace
Steering Rack Boot Right Leak	Replace
Shock Absorber Front Left Leak	Replace
Shock Absorber Front Right Leak	Replace
Stabilizer Mounting Front Left Damaged	Replace
Stabilizer Mounting Front Right Damaged	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Defective	Replace
Tyre Rear Right Damaged	Replace
Chassis Scratched	Repair
Gearbox Mountings Cracked	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Radiator Cradle Dented	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.23	2.53	-	
Rear	1.59	2.15	-	
Emergency / Parking	0.4	1.35	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65 R14	82H	Firestone	Touring	V	1421	0 mm
Front Right	175/65 R14	82H	Tracmax	Radial	V	1419	0 mm
Rear Left	175/65 R14	82T	Firemax	FM601	V	3420	3 mm
Rear Right	175/65 R14	82T	Sumitomo	HTR	V	1217	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM(POWERTRAIN CONTROL MODULE)	P0562:60	SYSTEM VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO AGE AND MILEAGE OF VEHICLE NORMAL WEAR AND TEAR ON INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. SHOCK ABSORBER REPORT COULD NOT BE PERFORMED.

Engine Compartment: Engine bay dirty. Brake fluid level ok. Signs of oil sludge on oil cap. Radiator and Aircon condenser bend. Oil sump scratched. Fan Cowley loose. Wire fitted to bonnet release latch. Expansion bottle leaking water.

Electrical Components and Instruments: Vehicle electronics malfunctioning.

Lights: Number plate light holder loose. Front right headlight indicator light not working. Front left and right fog lights not working.

Interior: Vehicle interior dirty and some interior panels scratched. Gear knob damaged.

Body • Exterior: Dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels.

Signs of impact damage to front and rear of vehicle. Residual traces of repair on some body panels. Vehicle antenna missing and housing damaged.

Axle and Suspension: Excessive noise coming from front and rear suspension. Signs of vehicle grabbing.

Tyres and Rims: Steel rims scratched. Spare wheel missing.

Undercarriage: Vehicle undercarriage dirty.

Road Test: Vehicle struggles to start.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



Front chassis




Rear chassis

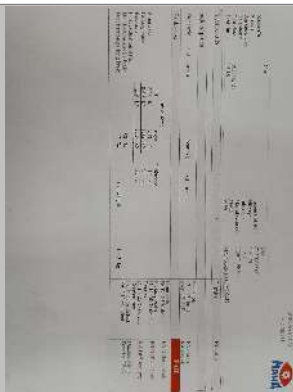

Brake test report



Diagnostic report page 1

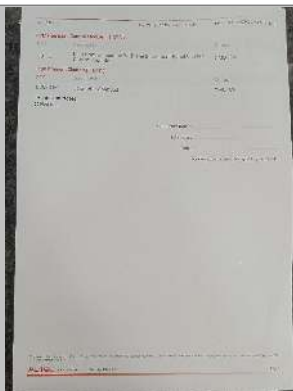

Diagnostic report page 2



Spare wheel Accessories



Oil cap and dipstick



Manual Transmission



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

VIN: MAJ1XXMRJ1CY35347

7 / 23



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD

VIN: MAJ1XXMRJ1CY35347

8 / 23



LR TYRE TREAD



RR TYRE TREAD



LF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1

VIN: MAJ1XXMRJ1CY35347

10 / 23



Caps



Battery clamps



Steering Wheel Trim



Center Console / Cubbyhole + Lid



Seat Front Right



Seat Rear

VIN: MAJ1XXMRJ1CY35347

12 / 23



Door Sealing Rubber Rear Right



Sill Panel Right



Sill Panel Right



Door Sealing Rubber Front Right



Door Handle Rear Right



Rear Fender Right

VIN: MAJ1XXMRJ1CY35347


14 / 23



Door Rear Right



Door Front Right

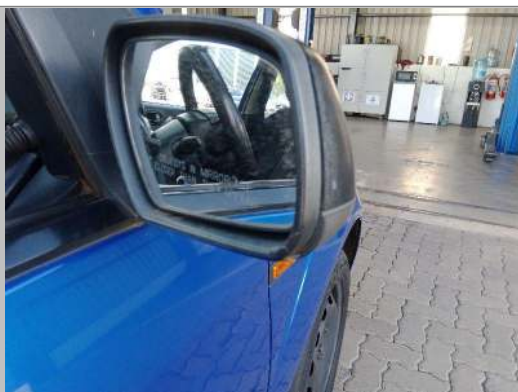


Side Mirror Right



Front Fender Right



Headlight Right

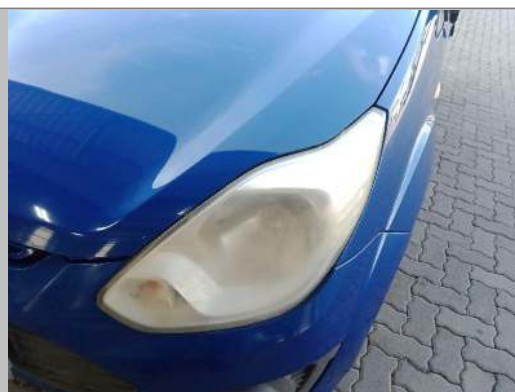

Headlight Left

VIN: MAJ1XXMRJ1CY35347

16 / 23



Number Plate Front



Bonnet

VIN: MA1TXXMRJ CY35347

17 / 23



Front Bumper



Front Bumper



Front Fender Left



Side Mirror Left

VIN: MAJ1XXMRJ1CY35347

18 / 23



Side Mirror Left



Windscreen

VIN: MAJ1XXMRJ1CY35347

19 / 23



Windscreen Wiper



Door Front Left



Door Rear Left




Rear Fender Left

VIN: MAJ1XXMRJ1CY35347
20 / 23



Door Panel Front Left

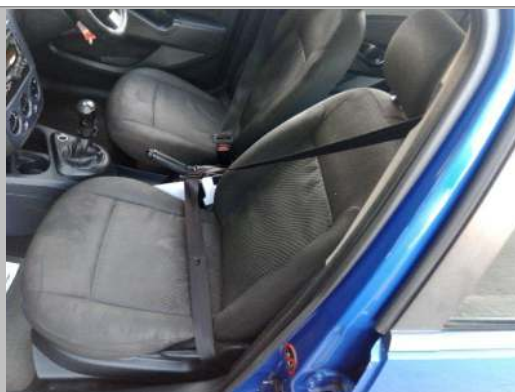


Seat Front Left



Seat Rear



Door Sealing Rubber Rear Left

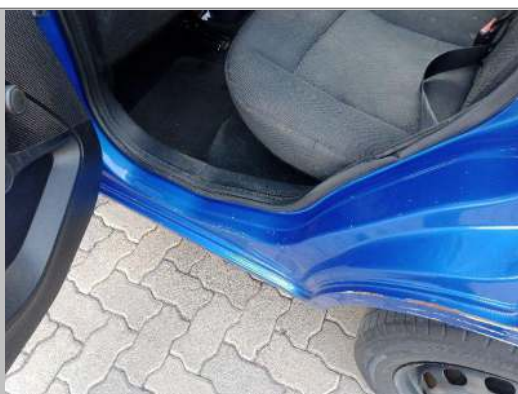

Sill Panel Left



Sill Panel Left

VIN: MAJ1XXMRJ1CY35347
22 / 23



Rear bumper



Rear bumper




Boot Lid / Hatch door



Tail Light Right



Carpet Front

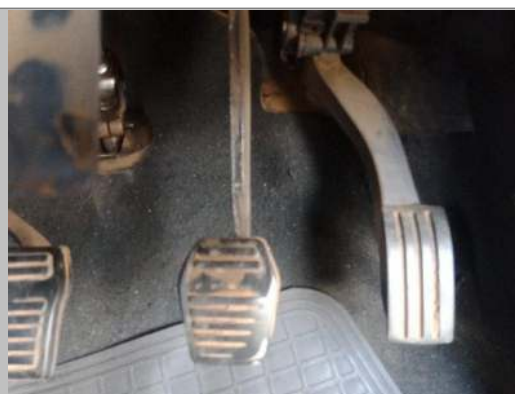


Brake Pedal Rubber


RJ1CV35347
23 / 23




Clutch Pedal Rubber

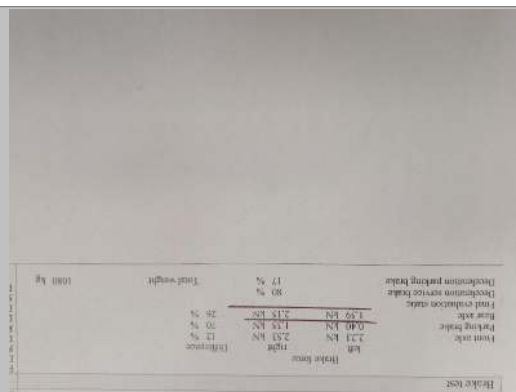

Parking Brake Performance

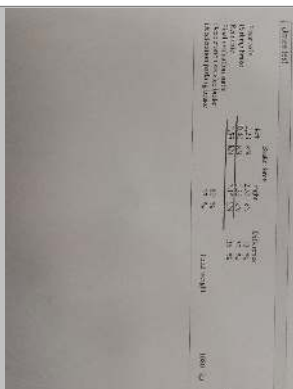

Service Brake Performance Rear Axle

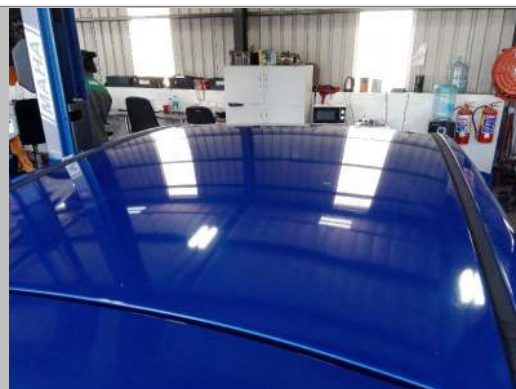

Roof



Inner Boot Floor Pan and Spare Wheel Well



Parcel Tray



Number Plate Rear



Shock Absorber Front Right



Tyre Front Right



Rocker Panel Left



Shock Absorber Front Left



Tyre Front Left



Tyre Front Right



CV Joint(s) Boot(s) Front Right (inner/outer)



Gearbox



Gearbox Mountings



Chassis



Stabilizer Mounting Front Left



Stabilizer Mounting Front Right



Radiator Cradle



Mounting Rubber(s) Rear Axle Right



Mounting Rubber(s) Rear Axle Left



Tyre Rear Right



Inner Boot Floor Pan and Spare Wheel Well



Inner Boot Floor Pan and Spare Wheel Well



Steering box



Tie Rod End left



Tie Rod End right



Steering Rack Boot Left



Engine Wiring



Steering Rack Boot Right



Water level




Expansion Bottle



Hoses



Engine Wiring

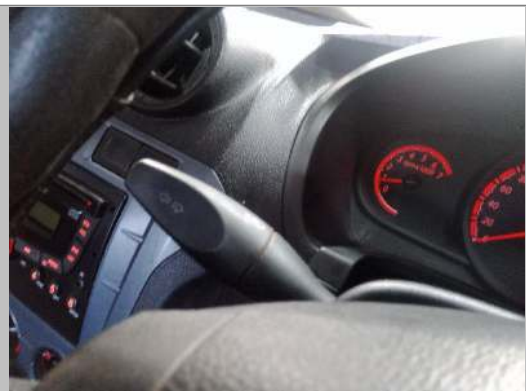

Head Light Switch



Hood Lining



Air Conditioner



Door Lock Front Left



Door Lock Front Right



CONDITION REPORT

Report No: 2016209466

DATE
21/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za