



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/12/2023		M57 Pretoria Road - 1619
Inspection Date	19/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	FORD	Registration Number	FB66MHGP
Model	FIGO	Register Number	
VIN	MAJ1XXMRJ1FE31579	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/08/2023
Color	GREEN	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	145,757 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Engine Wiring Defective	Repair
Caps Missing	Replace
Hoses Oil Leak	Repair
Expansion Bottle Defective	Replace
Battery clamps Defective	Repair
Air conditioner pipes Damaged	Replace
Central Air Vent Damaged	Replace
Head Light Switch Damaged	Replace
Center Console / Cubbyhole + Lid Defective	Repair
Switch Electrical Window Winder front right Malfunction	Repair
Indicator Light Front Right Damaged	Replace
Tail Light Left Damaged	Replace
Fog Light Front Left Defective	Repair
Fog Light Front Right Damaged	Replace
Headlight Left Scratched	Repair
Headlight Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Dirty	Repair
Seat Rear Dirty	Repair
Sun Visor Left Defective	Repair
Sun Visor Right Defective	Repair
Hood Lining Dirty	Repair
Door Panel Rear Right Defective	Repair
Door Sealing Rubber Front Left Damaged	Replace
Door Sealing Rubber Front Right Damaged	Replace
Door Sealing Rubber Rear Right Damaged	Replace
Door Lock Boot Lid Damaged	Replace
Parcel Tray Missing	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJ1XXMRJ1FE31579

1 / 25



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Damage	Repair Way
Window Winder rear right Missing	Replace
Boot Carpet Damaged	Repair
Steering Wheel Trim Defective	Repair
Number Plate Front Damaged	Replace
Side Mirror Left Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Replace
Grill Broken	Replace
Bonnet Residual Traces of Repair	Replace
A • Pillar Left Dented	Repair
B • Pillar Left Dented	Repair
C • Pillar Left Dented	Repair
Front Fender Left Damaged	Repair
Front Fender Right Residual Traces of Repair	Replace
Rear Fender Left Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Rear Fender Left / Inner Tray Dented	Repair
Rear Fender Right / Inner Tray Dented	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Paintwork • Scratched	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Paintwork • Scratched	Repair
Rocker Panel Left Dented	Repair
Rocker Panel Right Damaged	Repair
Roof Dented	Repair
Windscreen Chipped	Replace
Speed Sensor Damaged	Replace
Steering box Sweat	Repair
Tie Rod End left Damaged	Replace
Tie Rod End right Damaged	Replace
Steering Rack Boot Left Sweat	Replace
Shock Absorber Front Left Sweat	Replace
Stabilizer Mounting Front Left Defective	Replace
Stabilizer Mounting Front Right Damaged	Replace
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Spare Tyre Damaged	Replace
Rim Front Left Scratched	Repair
Rim Rear Left Dented	Repair
Bolt(s) / Nut(s) Front Wheel Left Missing	Replace
Main Beam Right Damaged	Repair
Chassis Dented	Repair
Sub Frame Scratched	Repair
Silencer Defective	Repair
Gearbox Mountings Cracked	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Radiator Cradle Dented	Repair
Jack Missing	Replace
Triangle Damaged	Replace
Warning lights illuminated on dashboard.	Repair
Key fob faulty.	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.44	1.85	-	
Rear	2.06	1.53	-	
Emergency / Parking	1.46	1.09	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No. 201620577

2 / 25
DATE

19/12/2023

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70 R14	81S	MRF	ZVTV	V	0320	1 mm
Front Right	175/65 R14	82T	Bridgestone	B250	V	4115	0 mm
Rear Left	165/65 R14	79T	Kumho	Solus	V	2713	0 mm
Rear Right	165/65 R14	79T	Falken	Sincera	V	0620	1 mm
Spare	175/65 R14	82H	Apollo	Alnac	V	1315	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	PCM(POWERTRAIN CONTROL MODULE)	P1000:70	CHECK OF ALL SYSTEMS IS NOT COMPLETE SINCE LAST ME	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.
Engine Compartment: Engine bay dirty. Brake fluid level low. Bonnet level strapped with cables. Rust inside expansion bottle.
Electrical Components and Instruments: Vehicle electronics malfunctioning.
Interior: Vehicle interior dirty and some interior panels scratched. Boot lid sealing rubber damaged. Handbrake lever button damaged.
Body • Exterior: Dents and scratches on some body panels. Spray work on some body panels. Some body panels misaligned. Stone chips on some body panels. Signs of hail damage on some body panels. Poor residual traces of repair on some body panels. Signs of impact damage to front and rear of vehicle. Boot does not close. Front left and right inner fender liners missing. Vehicle safety integrity comprised due to damaged front right main beam.
Brakes: Front left wheel binding. Front left and right speed sensors damaged. Front right brake piping loose and stay bracket missing.
Axle and Suspension: Abnormal noise coming from front and rear suspension. Signs of vehicle grabbing.
Tyres and Rims: Alloy rims scratched. Front left and rear right tyres have reached legal limit. Front left tyre deflated.
Undercarriage: Vehicle undercarriage dirty.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 2016205777

VIN: MAJ1XXMRJ1FE31579
DATE
3/25
19/12/2023

[illegible]

Brake and shock absorber repor

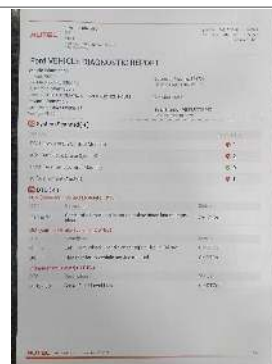

Diagnostic report page 1



Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
VIN: MAJ1XXM1911272023
4 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579

5 / 25



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
6 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579

7 / 25



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel



LICENSE DISC



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
8 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Wheel spanner



Oil cap and dipstick



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
10 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Manual Transmission



Boot Carpet



Spare Tyre



Triangle



Spare Tyre



Parcel Tray



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
12 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Door Lock Boot Lid



Tail Light Left

VIN: MAJ1XXMRJ1E31579
13 / 25

Boot Lid / Hatch door



Steering Wheel Trim



Sun Visor Left



Sun Visor Right



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
14 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Hood Lining



Central Air Vent

E31579
15 / 25

Side Mirror Right



Door Sealing Rubber Front Right



Seat Front Right



Door Front Right



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
16 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Door Rear Right



Front Fender Right

FE31579
17 / 25

Rear Fender Right



Window Winder rear right



Door Panel Rear Right



Seat Rear



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
18 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Door Sealing Rubber Rear Right



Rear bumper VIN: MAJ1XXMRJ1FE31579

19 / 25



Rear bumper



Rear Fender Left



Door Rear Left



C • Pillar Left



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
20 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Seat Rear



Door Front Left



Front Fender Left



Side Mirror Left



Side Mirror Left



Door Sealing Rubber Front Left



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
22 / 25



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Seat Front Left



Front Bumper



Front Bumper



Bonnet



Headlight Left



Headlight Right



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

VIN: MAJ1XXMRJ1FE31579
24 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Fog Light Front Right



Grill



Windscreen



Roof



A • Pillar Left



B • Pillar Left



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

C • Pillar Left



Head Light Switch



Indicator Light Front Right



Battery clamps



Caps



Side Mirror Right



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Main Beam Right



Engine Wiring



Rocker Panel Right



Tyre Rear Right



Tyre Rear Left



Rocker Panel Left



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Rim Front Left



Bolt(s) / Nut(s) Front Wheel Left



Shock Absorber Front Left



Fog Light Front Left



Number Plate Front



Speed Sensor



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Speed Sensor



Stabilizer Mounting Front Right



Stabilizer Mounting Front Left



Gearbox



Gearbox Mountings



CV Joint(s) Boot(s) Front Left (inner/outer)



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

CV Joint(s) Boot(s) Front Right (inner/outer)



Radiator Cradle



Steering box



Sub Frame



Chassis



Tyre Rear Left



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Rim Rear Left



Tyre Rear Right



Mounting Rubber(s) Rear Axle Right



Mounting Rubber(s) Rear Axle Left



Rear Fender Left / Inner Tray



Rear Fender Right / Inner Tray



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Hoses



Tie Rod End left



Tie Rod End right



Steering Rack Boot Left



Air conditioner pipes



CV Joint(s) Boot(s) Front Right (inner/outer)



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016205777

DATE
19/12/2023

Silencer



Water level



Expansion Bottle



Engine



Center Console / Cubbyhole + Lid



Switch Electrical Window Winder front right

**CONDITION REPORT****Report No: 2016205777****DATE**
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za