



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	20/03/2024		M57 Pretoria Road - 1619
Inspection Date	20/03/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	FORD	Registration Number	JG91TYGP
Model	FIGO	Register Number	
VIN	MAJFXXMTKFKS28415	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/04/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	102,823 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Expansion Bottle Defective	Replace
Battery box Damaged	Replace
Air cleaner Damaged	Replace
Hooter Damaged	Replace
Switch Electrical Window Winder front left Damaged	Replace
Indicator Light Front Right Missing	Replace
Tail Light Left Damaged	Replace
Tail Light Right Defective	Replace
Headlight Left Defective	Replace
Headlight Right Damaged	Replace
Seat Front Left Dirty	Repair
Seat Front Right Torn / Cut	Repair
Seat Rear Damaged	Repair
Hood Lining Dirty	Repair
Door Handle Front Right Damaged	Replace
Door Sealing Rubber Rear Left Damaged	Replace
Dash Padding Defective	Repair
Boot Carpet Damaged	Repair
Steering Wheel Trim Defective	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Replace
Bonnet Damaged	Replace
Bonnet slam plate (Shock tower/ Inner tray) Welded	Repair
A • Pillar Right Welded	Repair
B • Pillar Right Residual Traces of Repair	Repair
C • Pillar Left Dented	Repair
C • Pillar Right Residual Traces of Repair	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MAJFXXMTKFKS28415

1 / 23



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Damage	Repair Way
Front Fender Left Dented	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Right / Inner Tray Damaged	Replace
Rear Fender Left / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Damaged	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Damaged	Replace
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Fuel Flap Defective	Replace
Sill Panel Right Damaged	Repair
Windscreen Chipped	Repair
Brake disc 1. Axle left Damaged	Replace
Speed Sensor Damaged	Replace
Tie Rod right Damaged	Replace
Steering Rack Welded	Replace
Shock Absorber Front Left Defective	Repair
Control Arm(s) Front Axle Right Damaged	Replace
Tyre Rear Left Worn	Replace
Tyre Rear Right Damaged	Replace
Rim Front Right Dented	Repair
Rim Rear Left Dented	Repair
Rim Rear Right Scratched	Repair
Main Beam Right Welded	Repair
Chassis Dented	Repair
Sub Frame Welded	Replace
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Engine Noise Excessive	Repair
Gear Selections Malfunction	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Signs of vehicle airbags deployed	Replace
Warning lights illuminated on dashboard.	Repair
Axle and suspension	Front and rear suspension noisy
Road test	Play on gear lever
Interior	Bonnet release cable handle broken.
Engine	Engine bay dirty and battery loose
Axle and suspension	Front left stub axle welded
Tyres and rims	Spare wheel missing
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Vehicle is a cut and joint
Road test	Vehicle unsafe to drive
Interior	Vehicle interior dirty and some panels scratched
Body and Exterior	Impact damage to front and rear of vehicle
Tyres and Rims	Front and rear tyre sizes different

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.6	-	
Rear	1.65	1.73	-	
Emergency / Parking	1.3	1.19	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

VIN: MJA4FXXM75H16343016
Report No: 2016343016
2 / 23
DATE
20/03/2024

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/80 R14	85T	Goodyear	Duraplus	V	2917	2 mm
Front Right	165/80 R14	88T	Goodyear	Duraplus	V	2817	3 mm
Rear Left	175/65 R14	82T	Sumitomo	HTR T5	V	0820	0 mm
Rear Right	175/65 R14	82H	Apollo	Alnac	V	2619	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS(ANTI-LOCK BRAKE SYSTEM)	C0034:29-2B	RIGHT FRONT WHEEL SPEED SENSOR	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT

Report No: 2016313096


VIN: MAJFXXMTKFKS28415

DATE


20/03/2024



Brake and shock absorber repor

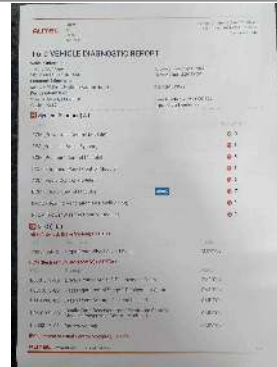

Diagnostic report page 1

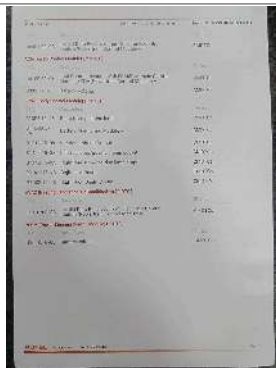

Diagnostic report page 2



Diagnostic report page 3



FRONT RIGHT CORNER



REAR LEFT CORNER



CONDITION REPORT

Report No: 2016313096

VIN: MAJFXMT556524024
DATE: 20/03/2024
4 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415

5 / 23



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415
6 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

90 DEGREE REAR



90 DEGREE LEFT

VIN: MAJFXXMTKFKS28415
7 / 23

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415
8 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024



LICENSE DISC



VIN PLATE OR STICKER




ENGINE 1



Front chassis



Rear chassis

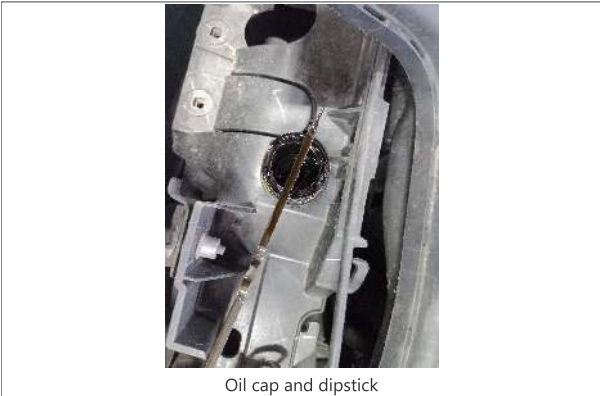

Oil cap and dipstick



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415
10 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Front left stub axle



Hooter



Steering Wheel Trim



Hood Lining



Gear Selections



Dash Padding

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415
12 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Sill Panel Right



Sill Panel Right



Seat Front Right



B • Pillar Right



Door Handle Front Right



Door Front Right



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415
14 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Door Rear Right



Rear Fender Right



Seat Rear



C • Pillar Right



Rear bumper



Rear bumper



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415

16 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Boot Lid / Hatch door



Tail Light Right

VIN: MAJFXXMTKFKS28415

17 / 23



Tail Light Left



Inner Boot Floor Pan and Spare Wheel Well



C • Pillar Right



Boot Carpet



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415
18 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Rear Fender Left



Fuel Flap



Fuel Flap



Door Rear Left



Door Front Left



Seat Rear

VIN: MAJFXXMTKFKS28415
19 / 23



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415
20 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

C • Pillar Left



Door Sealing Rubber Rear Left



Seat Front Left



Front Fender Left



Headlight Left



Headlight Right



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

VIN: MAJFXXMTKFKS28415
22 / 23

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Front Bumper



Front Bumper



Bonnet



Bonnet



Windscreen



Front Fender Right



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Side Mirror Right



Front Fender Right



Indicator Light Front Right



B • Pillar Right



Battery box



Air cleaner



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024


Water level



Expansion Bottle



Engine Wiring

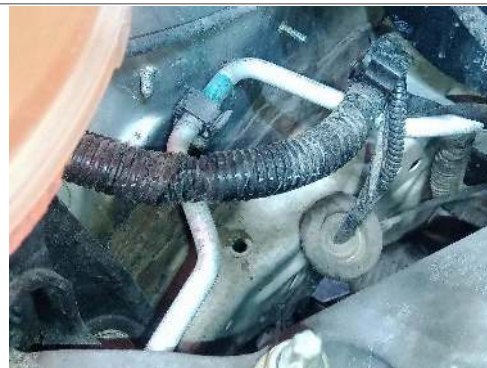

Bonnet slam plate (Shock tower/ Inner tray)



Main Beam Right



Bonnet slam plate (Shock tower/ Inner tray)



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Engine Wiring



Steering Rack



Sub Frame



Brake disc 1. Axle left



CV Joint(s) Boot(s) Front Left (inner/outer)



CV Joint(s) Boot(s) Front Right (inner/outer)



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Engine



Steering Rack



Rear Fender Left / Inner Tray



Tyre Rear Left



Tyre Rear Right



Tyre Rear Right



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Rim Rear Right




Chassis



Shock Absorber Front Left



Tie Rod right

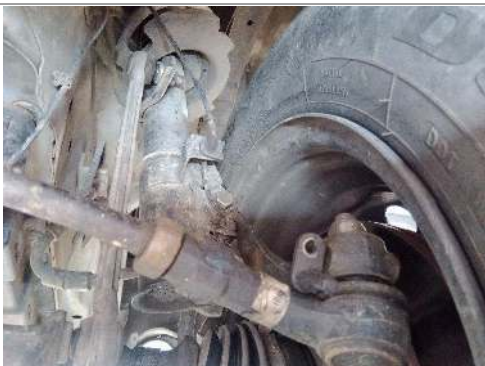

Speed Sensor



Bonnet slam plate (Shock tower/ Inner tray)



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

CV Joint(s) Boot(s) Front Right (inner/outer)



Control Arm(s) Front Axle Right



Chassis



Front Fender Right / Inner Tray



Rim Rear Left



Rim Rear Left



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

Rim Front Right



A • Pillar Right



Front Fender Right / Inner Tray



Engine Wiring



Switch Electrical Window Winder front left



CONDITION REPORT

Report No: 2016313096

DATE
20/03/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za