



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	23/04/2025		M57 Pretoria Road - 1619
Inspection Date	23/04/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	FL74VPGP
Model	GRAND I10 1.25 FLUID 5-DR [2014-2017]	Register Number	
VIN	MALA851CLGM457124	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	WHITE	Power / Displacement	
Year Model	2016	Paint Finish	TWO COAT UNI
Km Reading	166,461 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Sweat	Repair
Fan Belt Damaged	Replace
Air conditioner pipes Defective	Repair
Air cleaner Damaged	Replace
Indicator Light Front Left Damaged	Replace
Seat Front Right Defective	Repair
Seat Rear Torn / Cut	Repair
Seat Belt Front Right Damaged	Replace
Sun Visor Right Damaged	Repair
Hood Lining Dirty	Repair
Door Panel Rear Right Defective	Repair
Door Handle Front Right Damaged	Replace
Door Sealing Rubber Front Right Damaged	Replace
Parcel Tray Damaged	Replace
Carpet Front Damaged	Repair
Gear Lever Dust Boot Damaged	Replace
Clutch Pedal Rubber Damaged	Replace
Steering Wheel Trim Defective	Repair
Front Bumper Damaged	Repair
Bonnet Paintwork • Chipmarks	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124

Damage	Repair Way
Front Fender Left Damaged	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Paintwork • Scratched	Repair
Front Fender Left / Inner Tray Defective	Repair
Front Fender Right / Inner Tray Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Boot Lid / Hatch Door Rubbers Damaged	Replace
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Dented	Repair
Sill Panel Right Damaged	Repair
Windscreen Chipped	Replace
Shock Absorber Front Right Sweat	Replace
Spare Tyre Damaged	Replace
Rim Rear Left Scratched	Repair
Chassis Dented	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Radiator Cradle Damaged	Replace
Jack Missing	Replace
Triangle Missing	Replace
Interior	Vehicle interior dirty and some panels.
Interior	Front left panic handle missing
Body and Exterior	Vehicle license disk missing
Body and Exterior	Vehicle antenna missing
Electrical instruments and components	Interior fan blower blocked
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Dents and scratches on some body panels
Warning lights illuminated on dashboard	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s²]
Front	2.6	2.6	-	
Rear	1.32	1.25	-	
Emergency / Parking	1.02	1.11	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65 R14	82H	Xcent	EL601	V	4023	3 mm
Front Right	175/65 R14	82H	Xcent	EL601	V	3823	3 mm
Rear Left	175/65 R14	82H	Windforce	Catchfors	V	1024	4 mm
Rear Right	175/65 R14	82H	Windforce	Catchfors	V	0724	3 mm
Spare	165/80 R14	85T	Goodyear	Duraplus	V	1917	0 mm

* Tyre Legend: V=Virgin, R=Recap



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive
Rain at time of inspection
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124

[illegible]

Brake and shock absorber report

[illegible]

Diagnostic report page 1

[illegible]

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap And dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

Steering Wheel Trim



Sun Visor Right



Hood Lining



Carpet Front



Gear Lever Dust Boot



Clutch Pedal Rubber

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

Door Sealing Rubber Front Right



Seat Belt Front Right



Seat Front Right



Door Panel Rear Right



Seat Rear



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

Door Rear Right



Door Front Right



Door Handle Front Right



Front Fender Right



Front Bumper



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

Bonnet



Front Fender Left



Indicator Light Front Left



Door Front Left



Door Rear Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

Rear bumper



Rear bumper



Boot Lid / Hatch door



Parcel Tray



Spare Tyre



Inner Boot Floor Pan and Spare Wheel Well

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

Boot Lid / Hatch Door Rubbers



Windscreen



Air cleaner



Fan Belt



Front Fender Right / Inner Tray



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025


Shock Absorber Front Right



Rim Rear Left



Sill Panel Left

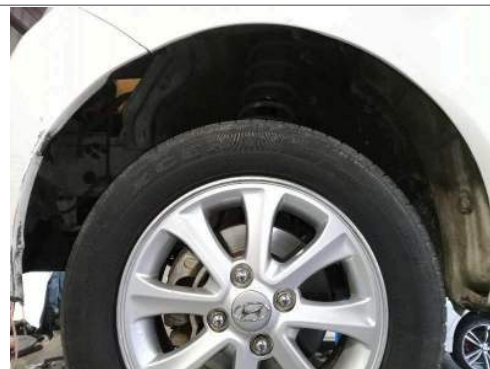

Front Fender Left / Inner Tray



CV Joint(s) Boot(s) Front Left (inner/outer)



Engine

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124



CONDITION REPORT

Report No: 2016852390

DATE
23/04/2025

Radiator Cradle



Air conditioner pipes



Chassis



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALA851CLGM457124