

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/05/2024		M57 Pretoria Road - 1619
Inspection Date	14/05/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	JZ86YSGP
Model	ATOS	Register Number	
VIN	MALAF51CLNM143944	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/10/2024
Color	SILVER	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	48,724 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Alternator Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Right Torn / Cut	Repair
Dash Padding Damaged	Repair
Front Bumper Damaged	Replace
Bonnet Residual Traces of Repair	Replace
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Right Damaged	Repair
Door Front Right Residual Traces of Repair	Repair
Rear bumper Paintwork • Scratched	Repair
Main Beam Right Residual Traces of Repair	Repair
Radiator Cradle Damaged	Replace
Engine Noise Excessive	Repair
Airbag warning lights illuminated	Repair.
Foreign substance on oil cap see additional 10	Repair
Rear tyre size differs	Replace
Signs of cut and joint on main beams	Replace.

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.3	2.3	-	
Rear	1.7	1.6	-	
Emergency / Parking	1.2	1.1	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70R14	81T	MRF	ZVTV	V	0421	3 mm
Front Right	165/70R14	81T	MRF	ZVTV	V	0421	2 mm
Rear Left	165/70R14	81T	MFR	ZVTV	V	0421	5 mm
Rear Right	155/80R13	79T	Hankook	Kinergy	V	6820	5 mm
Spare	165/70R17	81T	MRF	ZVTV	V	0000	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AIRBAG	B1650:00	CRASH RECORDED IN 1ST STAGE ONLY	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: RESIDUAL TRACES OF POOR REPAIR WORK & RESPRAY WORK DONE ON SOME BODY PANELS. SIGNS OF WELDING ON SOME BODY PANELS. NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE RIGHT



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016377847

VIN: MALAF51CLNM143944

DATE
3/13
14/05/2024



ODOMETER



Airbag warning lights illumina



DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual



Sparewheel

VIN: MALAF51CLNM143944

6 / 13




Coolant reservoir



Oil cap and dipstick




Rear end

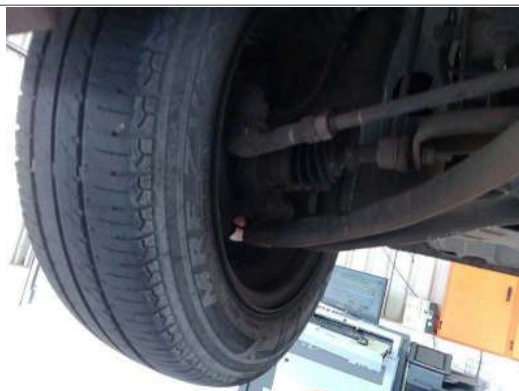

LF TYRE TREAD



LR TYRE TREAD

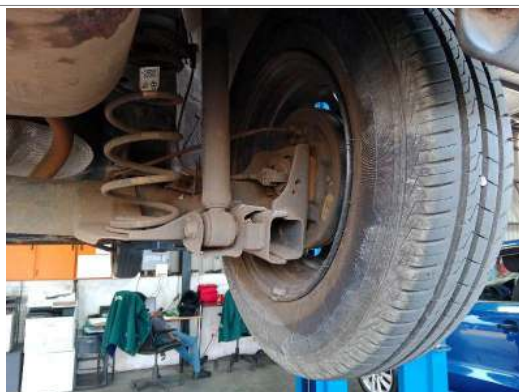

RR TYRE TREAD

VIN: MALAF51CLNM143944

7 / 13



RF TYRE TREAD



ENGINE 1

VIN: MALAF51CLNM143944

8 / 13



ENGINE 2



CHASSIS



VIN PLATE OR STICKER



LICENSE DISC

VIN: MALAF51CLNM143944

9 / 13

[illegible]

SHOCK & BRAKE REPORT


ALPHA

1. **NAME**
2. **ADDRESS**
3. **CITY**
4. **STATE**
5. **ZIP**

6. **PHONE**
7. **FAX**
8. **E-MAIL**
9. **WEBSITE**

10. **DATE**
11. **TIME**
12. **BY**
13. **FOR**
14. **TO**
15. **FROM**
16. **REMARKS**
17. **SIGNATURE**
18. **DATE**
19. **TIME**
20. **BY**
21. **FOR**
22. **TO**
23. **FROM**
24. **REMARKS**
25. **SIGNATURE**
26. **DATE**
27. **TIME**
28. **BY**
29. **FOR**
30. **TO**
31. **FROM**
32. **REMARKS**
33. **SIGNATURE**
34. **DATE**
35. **TIME**
36. **BY**
37. **FOR**
38. **TO**
39. **FROM**
40. **REMARKS**
41. **SIGNATURE**
42. **DATE**
43. **TIME**
44. **BY**
45. **FOR**
46. **TO**
47. **FROM**
48. **REMARKS**
49. **SIGNATURE**
50. **DATE**
51. **TIME**
52. **BY**
53. **FOR**
54. **TO**
55. **FROM**
56. **REMARKS**
57. **SIGNATURE**
58. **DATE**
59. **TIME**
60. **BY**
61. **FOR**
62. **TO**
63. **FROM**
64. **REMARKS**
65. **SIGNATURE**
66. **DATE**
67. **TIME**
68. **BY**
69. **FOR**
70. **TO**
71. **FROM**
72. **REMARKS**
73. **SIGNATURE**
74. **DATE**
75. **TIME**
76. **BY**
77. **FOR**
78. **TO**
79. **FROM**
80. **REMARKS**
81. **SIGNATURE**
82. **DATE**
83. **TIME**
84. **BY**
85. **FOR**
86. **TO**
87. **FROM**
88. **REMARKS**
89. **SIGNATURE**
90. **DATE**
91. **TIME**
92. **BY**
93. **FOR**
94. **TO**
95. **FROM**
96. **REMARKS**
97. **SIGNATURE**
98. **DATE**
99. **TIME**
100. **BY**
101. **FOR**
102. **TO**
103. **FROM**
104. **REMARKS**
105. **SIGNATURE**
106. **DATE**
107. **TIME**
108. **BY**
109. **FOR**
110. **TO**
111. **FROM**
112. **REMARKS**
113. **SIGNATURE**
114. **DATE**
115. **TIME**
116. **BY**
117. **FOR**
118. **TO**
119. **FROM**
120. **REMARKS**
121. **SIGNATURE**
122. **DATE**
123. **TIME**
124. **BY**
125. **FOR**
126. **TO**
127. **FROM**
128. **REMARKS**
129. **SIGNATURE**
130. **DATE**
131. **TIME**
132. **BY**
133. **FOR**
134. **TO**
135. **FROM**
136. **REMARKS**
137. **SIGNATURE**
138. **DATE**
139. **TIME**
140. **BY**
141. **FOR**
142. **TO**
143. **FROM**
144. **REMARKS**
145. **SIGNATURE**
146. **DATE**
147. **TIME**
148. **BY**
149. **FOR**
150. **TO**
151. **FROM**
152. **REMARKS**
153. **SIGNATURE**
154. **DATE**
155. **TIME**
156. **BY**
157. **FOR**
158. **TO**
159. **FROM**
160. **REMARKS**
161. **SIGNATURE**
162. **DATE**
163. **TIME**
164. **BY**
165. **FOR**
166. **TO**
167. **FROM**
168. **REMARKS**
169. **SIGNATURE**
170. **DATE**
171. **TIME**
172. **BY**
173. **FOR**
174. **TO**
175. **FROM**
176. **REMARKS**
177. **SIGNATURE**
178. **DATE**
179. **TIME**
180. **BY**
181. **FOR**
182. **TO**
183. **FROM**
184. **REMARKS**
185. **SIGNATURE**
186. **DATE**
187. **TIME**
188. **BY**
189. **FOR**
190. **TO**
191. **FROM**
192. **REMARKS**
193. **SIGNATURE**
194. **DATE**
195. **TIME**
196. **BY**
197. **FOR**
198. **TO**
199. **FROM**
200. **REMARKS**
201. **SIGNATURE**
202. **DATE**
203. **TIME**
204. **BY**
205. **FOR**
206. **TO**
207. **FROM**
208. **REMARKS**
209. **SIGNATURE**
210. **DATE**
211. **TIME**
212. **BY**
213. **FOR**
214. **TO**
215. **FROM**
216. **REMARKS**
217. **SIGNATURE**
218. **DATE**
219. **TIME**
220. **BY**
221. **FOR**
222. **TO**
223. **FROM**
224. **REMARKS**
225. **SIGNATURE**
226. **DATE**
227. **TIME**
228. **BY**
229. **FOR**
230. **TO**
231. **FROM**
232. **REMARKS**
233. **SIGNATURE**
234. **DATE**
235. **TIME**
236. **BY**
237. **FOR**
238. **TO**
239. **FROM**
240. **REMARKS**
241. **SIGNATURE**
242. **DATE**
243. **TIME**
244. **BY**
245. **FOR**
246. **TO**
247. **FROM**
248. **REMARKS**
249. **SIGNATURE**
250. **DATE**
251. **TIME**
252. **BY**
253. **FOR**
254. **TO**
255. **FROM**
256. **REMARKS**
257. **SIGNATURE**
258. **DATE**
259. **TIME**
260. **BY**
261. **FOR**
262. **TO**
263. **FROM**
264. **REMARKS**
265. **SIGNATURE**
266. **DATE**
267. **TIME**
268. **BY**
269. **FOR**
270. **TO**
271. **FROM**
272. **REMARKS**
273. **SIGNATURE**
274. **DATE**
275. **TIME**
276. **BY**
277. **FOR**
278. **TO**
279. **FROM**
280. **REMARKS**
281. **SIGNATURE**
282. **DATE**
283. **TIME**
284. **BY**
285. **FOR**
286. **TO**
287. **FROM**
288. **REMARKS**
289. **SIGNATURE**
290. **DATE**
291. **TIME**
292. **BY**
293. **FOR**
294. **TO**
295. **FROM**
296. **REMARKS**
297. **SIGNATURE**
298. **DATE**
299. **TIME**
300. **BY**
301. **FOR**
302. **TO**
303. **FROM**
304. **REMARKS**
305. **SIGNATURE**
306. **DATE**
307. **TIME**
308. **BY**
309. **FOR**
310. **TO**
311. **FROM**
312. **REMARKS**
313. **SIGNATURE**
31


DIAGNOSTIC REPORT PAGE 1

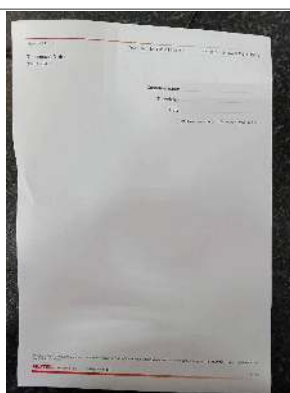

DIAGNOSTIC REPORT PAGE 2



Dash Padding

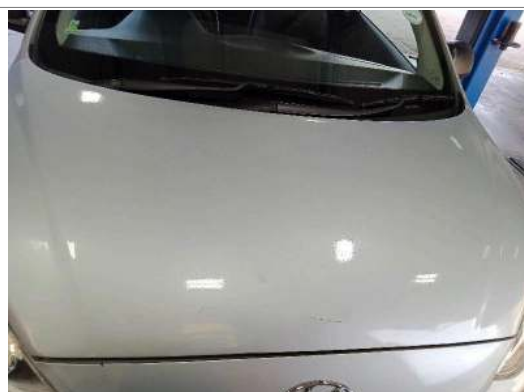

Bonnet



Bonnet

VIN: MALAF51CLNM143944

11 / 13



Bonnet



VIN: MALAF51CLNM143944

12 / 13

Front Fender Right



Door Front Right



Water level



Engine Wiring



Main Beam Right

VIN: MALAF51CLNM143944

13 / 13



Main Beam Right



Alternator



Main Beam Right



Radiator Cradle



Radiator Cradle



Headlight Left



Headlight Right



Front Bumper



Front Fender Left



Front Bumper



Rear bumper



Rear bumper



Rear bumper



Rear bumper



Rear Fender Right



Main Beam Right



Main Beam Right



Main Beam Right



Main Beam Right



Engine



Radiator Cradle



Seat Front Right



Rear Fender Right



CONDITION REPORT

Report No: 2016377847

DATE
14/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za