



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	16/05/2025		M57 Pretoria Road - 1619
Inspection Date	16/05/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	HYUNDAI	Registration Number	HN50CWGP
Model	I20	Register Number	
VIN	MALBM51BLKM523930	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2025
Color	GREY	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	229,904 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Wiring Defective	Repair
Radiator Defective	Repair
Air conditioner pipes Damaged	Replace
Center Console / Cubbyhole + Lid Damaged	Repair
Indicator Light Front Left Missing	Replace
Tail Light Left Damaged	Replace
Tail Light Right Damaged	Replace
Headlight Left Damaged	Replace
Headlight Right Damaged	Replace
Seat Front Left Dirty	Repair
Door Handle Front Left Damaged	Replace
Boot Carpet Damaged	Replace
Boot Panel Left Damaged	Repair
Boot Panel Right Damaged	Repair
Side Mirror Right Paintwork • Scratched	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Firewall Defective	Repair
A • Pillar Right Damaged	Repair
Front Fender Left Damaged	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Damage	Repair Way
Front Fender Right Dented	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Damaged	Repair
Front Fender Left / Inner Tray Damaged	Replace
Rear Fender Left / Inner Tray Damaged	Repair
Door Front Left Dented	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Paintwork • Scratched	Repair
Boot Lid / Hatch door Damaged	Replace
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Dented	Repair
Roof Dented	Repair
Windscreen Cracked	Replace
Control Arm(s) Front Axle Right Damaged	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace
Tyre Rear Left Damaged	Replace
Tyre Rear Right Damaged	Replace
Main Beam Left Dented	Repair
Main Beam Right Dented	Repair
Chassis Dented	Repair
Sub Frame Damaged	Repair
Fuel Tank Defective	Repair
Radiator Cradle Damaged	Replace
Engine Noise Excessive	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Warning light illuminated on dashboard.	Repair
Body and Exterior	Vehicle antenna missing
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Engine	Foreign substance on oil cap
Engine	Radiator and Aircon condenser loose
Engine	Engine oil sump dented
Body and Exterior	Signs of impact damage to front of vehicle
Body and Exterior	Signs of impact damage to rear of vehicle
Body and Exterior	Some body panels misaligned
Tyres and rims	Front and rear hubcaps scratched.
Body and Exterior	Rear emblem missing
Body and Exterior	Boot does not close properly.
Interior	Vehicle interior dirty and some panels scratched

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.87	2.71	-	
Rear	1.81	2.11	-	
Emergency / Parking	0.76	1.18	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/80 R14	85T	Apollo	Amazer	V	3122	0 mm
Front Right	165/80 R14	85T	Apollo	Amazer	V	3122	0 mm
Rear Left	165/80 R14	85T	Goodyear	Assurance	V	2317	1 mm
Rear Right	165/80 R14	85T	Apollo	Amazer	V	3821	1 mm
Spare	165/65 R14	79H	Hankook	Kinergy	V	4817	3 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930

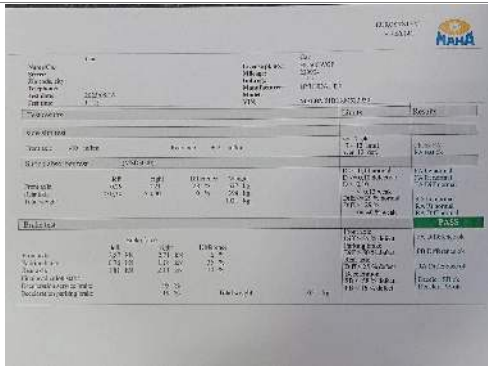

Brake and shock absorber report



Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories



LICENSE DISC

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

VIN PLATE OR STICKER



ENGINE 1




Front chassis



Rear chassis



Oil cap and dipstick

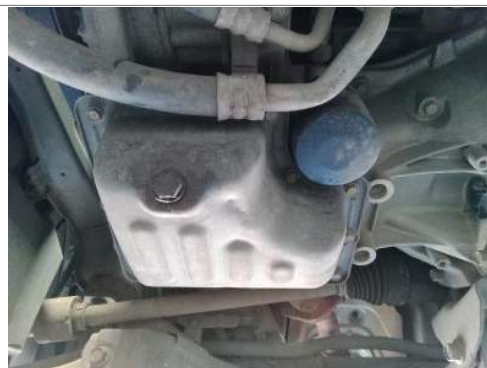

Engine oil sump

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Tail Light Right



Tail Light Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Inner Boot Floor Pan and Spare Wheel Well



Boot Carpet



Boot Panel Left



Boot Panel Right



Rear Fender Right



Door Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Door Front Right



Front Fender Right



A • Pillar Right



Center Console / Cubbyhole + Lid



Side Mirror Right



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Front Bumper



Bonnet




Windscreen



Headlight Left



Headlight Right

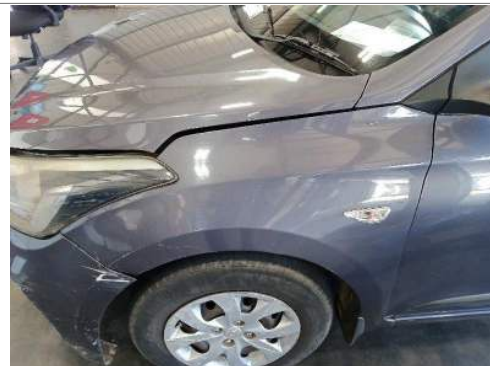

Front Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Door Front Left



Seat Front Left



Rear Fender Left



Door Rear Left



Water level



Sill Panel Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT


Report No: 2016880319

DATE
16/05/2025

Rear bumper



Sill Panel Left

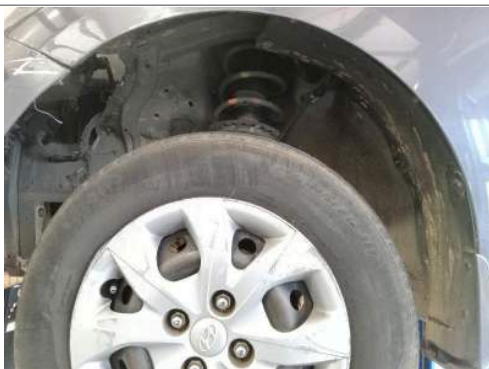

Front Fender Left / Inner Tray



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Right



Sub Frame

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Air conditioner pipes



Radiator Cradle



Engine Wiring



Tyre Rear Right



Tyre Front Left



Radiator

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Radiator Cradle



Main Beam Right



Firewall



Control Arm(s) Front Axle Right



Chassis



Fuel Tank

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Main Beam Left



Main Beam Right



Rear bumper



Tyre Front Right



Tyre Rear Left



Rear Fender Left / Inner Tray

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930



CONDITION REPORT

Report No: 2016880319

DATE
16/05/2025

Inner Boot Floor Pan and Spare Wheel Well



Water level



Door Handle Front Left



Sill Panel Left



Indicator Light Front Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALBM51BLKM523930