



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	28/08/2025		M57 Pretoria Road - 1619
Inspection Date	28/08/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	HYUNDAI	Registration Number	NONE
Model	CRETA 1.5 PREMIUM [2020-2022]	Register Number	
VIN	MALPB812LMM074060	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	
Color	RED	Power / Displacement	
Year Model	2020	Paint Finish	TWO COAT UNI
Km Reading	186,246 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025

	Damage	Repair Way
	Air Conditioner Insufficient	Replace
	Tail Light Left Damaged	Replace
	Fog Light Rear Right Cracked	Replace
	Seat Front Left Dirty	Repair
	Seat Rear Dirty	Repair
	Door Panel Rear Left Defective	Repair
	Door Handle Rear Right Damaged	Repair
	Door Sealing Rubber Front Right Damaged	Replace
	Door Sealing Rubber Rear Left Damaged	Replace
	Door Sealing Rubber Rear Right Damaged	Replace
	Parcel Tray Missing	Replace
	Boot Carpet Damaged	Replace
	Side Mirror Left Paintwork • Scratched	Repair
	Front Bumper Paintwork • Scratched	Repair
	Bonnet Paintwork • Scratched	Repair
	C • Pillar Left Dented	Repair
	C • Pillar Right Dented	Repair
	Front Fender Left Paintwork • Scratched	Repair
	Rear Fender Left Damaged	Repair
	Rear Fender Right Paintwork • Scratched	Repair
	Door Front Right Paintwork • Scratched	Repair
	Door Rear Left Paintwork • Scratched	Repair
	Door Rear Right Paintwork • Scratched	Repair
	Boot Lid / Hatch door Dented	Repair
	Rear bumper Damaged	Repair
	Inner Boot Floor Pan and Spare Wheel Well Welded	Repair
	Parking Brake Performance Left / Right Difference out of legal range	Repair
	Main Beam Left Dented	Repair
	Chassis Damaged	Repair
	License disc missing	Replace
	Loose wiring on rear of vehicle	Repair
	Warning lights illuminated on dashboard	Repair
	Body and Exterior	Some body panels misaligned
	Body and Exterior	Signs of impact damage to rear of vehicle

Brakes
Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.64	3.0	-	
Rear	2.19	2.3	-	
Emergency / Parking	1.14	2.39	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/65 R16C	107T	Pirelli	Carrier	V	0716	2 mm
Front Right	205/65 R16	95W	Hankook	Ventus	V	4323	2 mm
Rear Left	205/65 R16	95W	Hankook	Ventus	V	2223	3 mm
Rear Right	205/65 R16	95W	Hankook	Ventus	V	2223	3 mm
Spare	205/65 R16	95H	Apollo	Alnac	V	4120	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	AB(AIRBAG)	B1102:00	BATTERY VOLTAGE LOW	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Interior: Vehicle interior dirty and some panels scratched
Undercarriage: Vehicle undercarriage dirty. Bottom of engine and gearbox covered.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



FRONT RIGHT CORNER



REAR LEFT CORNER



90 DEGREE FRONT



90 DEGREE REAR



90 DEGREE LEFT



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



ODOMETER




DASHBOARD (W/ ENGINE RUNNING)



INTERIOR (FRONT DRIVER DOOR)



Manual Transmission

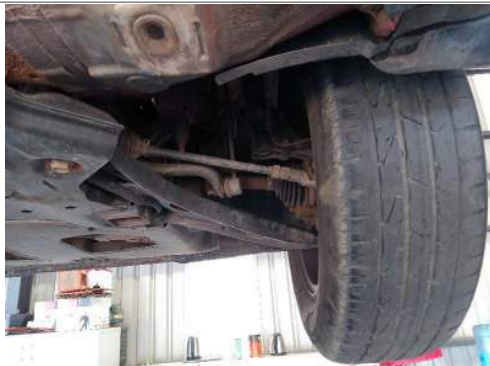

RF TYRE TREAD



RR TYRE TREAD

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



LR TYRE TREAD



LF TYRE TREAD



Spare wheel and Accessories



Oil cap and dipstick



Front chassis



Loose wiring

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



Rear chassis



ENGINE 1



VIN PLATE OR STICKER



LICENSE DISC MISSING

[illegible]

SHOCK AND BRAKE REPORT

[illegible]

DIAGNOSTIC REPORT PAGE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025

/mydekra/CRETA/8620/ALC4240/1570		
Test Time: 2025-08-28 17:22:32		
Report ID: MALPB20156828122250		
DTG	Description	Status
B1102.00	Battery voltage low	History
IBU-TPMS (Integrated Body Control Unit-Tire Pressure Monitoring System) (2 DTGs)		
DTG	Description	Status
C1313.00	Right front sensor radio frequency channel failure	Active
C1662.00	Auto learning failure	Active
Technician Notes 2016994558		
Customer name:		
Technician:		
Date:		
Note: Please retain a copy of this report for your records.		

DIAGNOSTIC REPORT PAGE 2



Door Sealing Rubber Front Right



Door Sealing Rubber Front Right



Door Sealing Rubber Rear Left



C • Pillar Right



C • Pillar Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



Door Panel Rear Left



Door Sealing Rubber Rear Left



Seat Rear



Seat Front Left



Air Conditioner



Door Front Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



Door Front Right



Door Rear Right



Door Rear Right



Rear Fender Right



Rear Fender Right



Door Handle Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



Door Sealing Rubber Rear Right



Rear bumper



Rear bumper



Rear bumper



Boot Lid / Hatch door



Boot Lid / Hatch door

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025

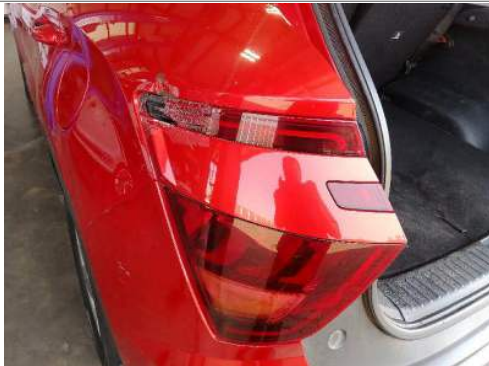

Tail Light Left



Parcel Tray




Boot Carpet



Rear Fender Left



Door Rear Left

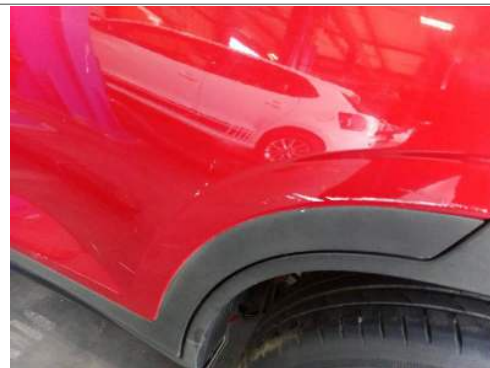

Door Rear Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060




CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



Side Mirror Left

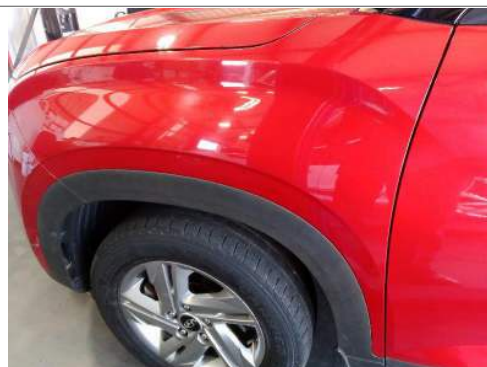


Front Fender Left



Front Fender Left



Bonnet

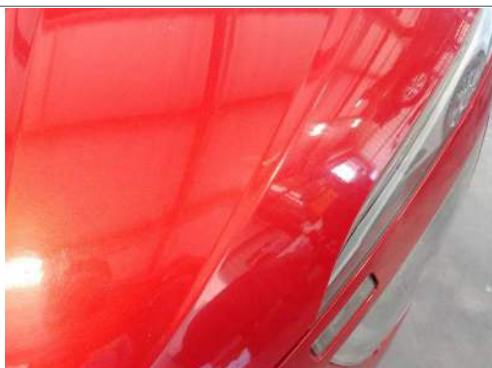

Bonnet



Front Bumper

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



Front Bumper



Front Bumper



Front Bumper



Fog Light Rear Right



Chassis



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060



CONDITION REPORT



Report No:
2016994558
DATE
28/08/2025



Main Beam Left



Inner Boot Floor Pan and Spare Wheel Well




Inner Boot Floor Pan and Spare Wheel Well



Water level



Water level

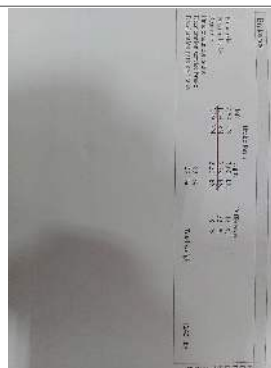

Parking Brake Performance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MALPB812LMM074060