



CONDITION REPORT



Report No:
2016946719
DATE
15/07/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	15/07/2025		M57 Pretoria Road - 1619
Inspection Date	15/07/2025		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	NO REG
Model	ALMERA 1.5 ACENTA AT [2016-2024]	Register Number	
VIN	MDHBBAN17Z0730313	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	30/06/2023
Color	SILVER	Power / Displacement	
Year Model	2020	Paint Finish	M - METALLIC
Km Reading	349,765 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	AUTOMATIC

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0730313



Damage	Repair Way
Engine Oil Leak	Repair
Caps Missing	Replace
Expansion Bottle Damaged	Repair
Door Handle Front Right Damaged	Replace
Door Handle Rear Right Damaged	Replace
Rear Lower Valance Damaged	Repair
Front Bumper Paintwork • Scratched	Repair
Bonnet Dented	Repair
Rear Fender Left Damaged	Repair
Rear Fender Left / Inner Tray Damaged	Repair
Door Front Right Damaged	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Damaged	Repair
Windscreen Cracked	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Front Left Smooth	Replace
Tyre Front Right Smooth	Replace
Tyre Rear Left Excessive Wear & Tear	Replace
Tyre Rear Right Excessive Wear & Tear	Replace
Spare Tyre Smooth	Replace
Gearbox Oil Leak	Repair
CV Joint(s) Boot(s) Front Left (inner/outer) Damaged	Replace
Excessive loud noise on suspension	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.4	2.5	-	
Rear	1.7	1.8	-	
Emergency / Parking	0.8	0.5	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	185/65R15	92T	Barum	Brillantis	V	3624	0 mm
Front Right	175/65R15	84H	Bridgestone	Ecopia	V	0000	0 mm
Rear Left	185/60R15	84H	Continental	Contact	V	3118	1 mm
Rear Right	195/65R15	91V	Dunlop	Sport	V	4417	0 mm
Spare	185/60R15	84H	Bridgestone	Turanza	V	0000	0 mm

* Tyre Legend: V=Virgin, R=Recap



Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: signs of spray work done on some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE


Technician

Trevino Julius


This document was created electronically and is valid without signature.

General Remarks:


The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

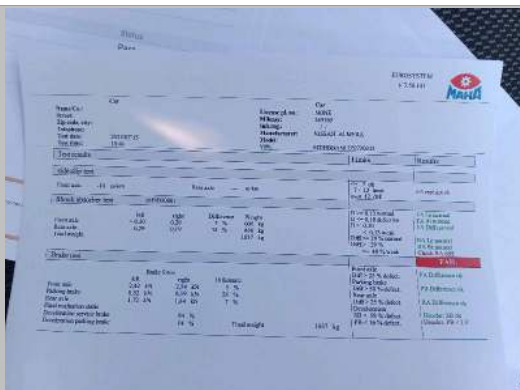

Shock and brake

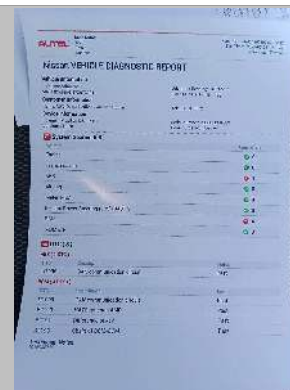

Diagnostic test

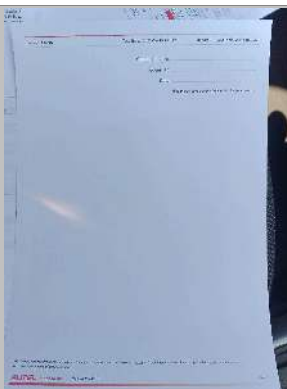

diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Automatic



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



Oil cap and dipstick



Coolant reservoir



Water level



Expansion Bottle



Caps



Windscreen



Door Handle Front Right



Door Handle Rear Right



Door Front Right



Boot Lid / Hatch door



Spare Tyre



Rear Fender Left



Bonnet




Tyre Front Right



Front Bumper



Front Bumper

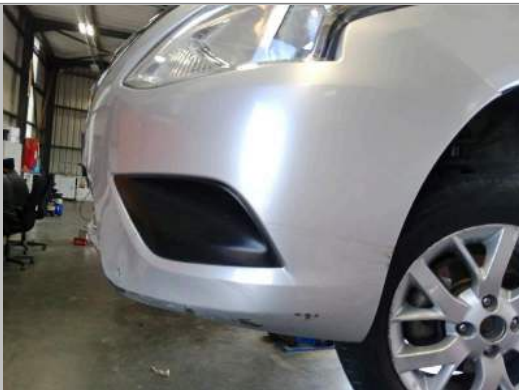

Front Bumper



Front Bumper



Front Bumper



Tyre Front Left



Control Arm Bush(es) Front Axle Left



Control Arm Bush(es) Front Axle Left



CV Joint(s) Boot(s) Front Left (inner/outer)



Tyre Rear Left



Rear bumper



Rear bumper



Rear bumper



Tyre Rear Right



Control Arm Bush(es) Front Axle Right




Control Arm Bush(es) Front Axle Right



Gearbox



Gearbox

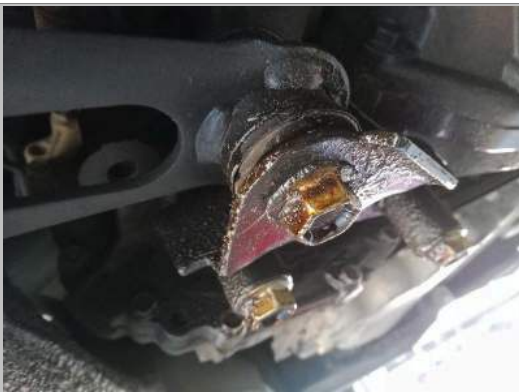

Gearbox



Engine



Engine



Rear Fender Left / Inner Tray



Rear Fender Left / Inner Tray



Rear Fender Left / Inner Tray



Rear Lower Valance

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHBBAN17Z0730313