



CONDITION REPORT

Report No: 2016400506

DATE
31/05/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	31/05/2024		M57 Pretoria Road - 1619
Inspection Date	31/05/2024		Kempton Park - GT


Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	DATSUN	Registration Number	CX62870
Model	GO	Register Number	
VIN	MDHZBAAD0Z0502158	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/11/2023
Color	BLUE	Power / Displacement	
Year Model		Paint Finish	C - COMMON
Km Reading	67,031 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

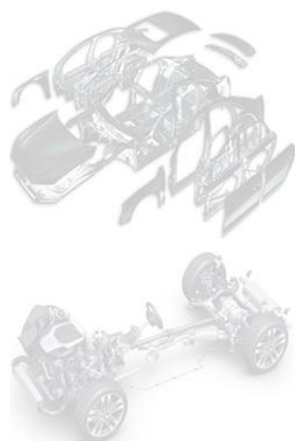

Damage	Repair Way
Seat Front Left Torn / Cut	Repair
Front Bumper Paintwork • Scratched	Repair
Windscreen Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Rim Rear Left Dented	Repair
Body exterior	Signs of spray work done on some body
Electronics malfunction.	Radio not working



CONDITION REPORT

Report No: 2016400506

 DATE
31/05/2024

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.0	2.0	-	
Rear	0.8	1.0	-	
Emergency / Parking	1.2	1.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	155/70R13	75T	Apollo	Amazer	V	4720	1 mm
Front Right	155/80R13	79T	Velocity	Reacta	V	4720	2 mm
Rear Left	155/80R13	79T	Velocity	Reacta	V	4720	5 mm
Rear Right	155/80R13	79T	Velocity	Reacta	V	4720	5 mm
Spare	155/80R13	79T	Velocity	Reacta	V	//////	5 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Vehicle doesn't start
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: MDHZAAB074503158

Report No: 2016400506


2 / 8

DATE

31/05/2024

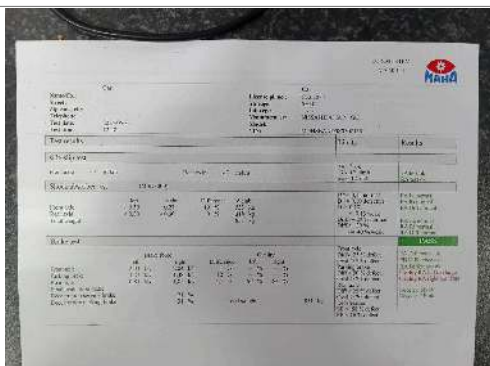

Shock and brake report to

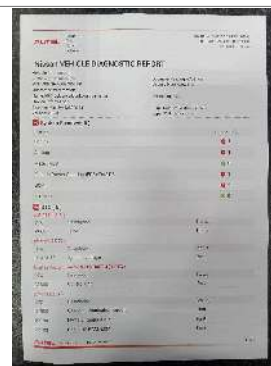

Diagnostic test



Diagnostic test results



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016400506
VIN: MDHZBAAD0Z0502158
DATE
31/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016400506

DATE
VIN: MDHZBAAD0Z0502158
31/05/2024
4/8



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016400506

DATE

31/05/2024

VIN: MDHZBAAD0Z0502158

5 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016400506

DATE
31/05/2024

VIN: MDHZBAAD0Z0502158

6 / 8



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



CONDITION REPORT

Report No: 2016400506

DATE
31/05/2024

VIN: MDHZBAAD0Z0502158
7 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016400506

DATE
31/05/2024



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear end



CONDITION REPORT

Report No: 2016400506

DATE
31/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016400506

DATE
31/05/2024


Oil cap and dipstick



Coolant reservoir



Windscreen

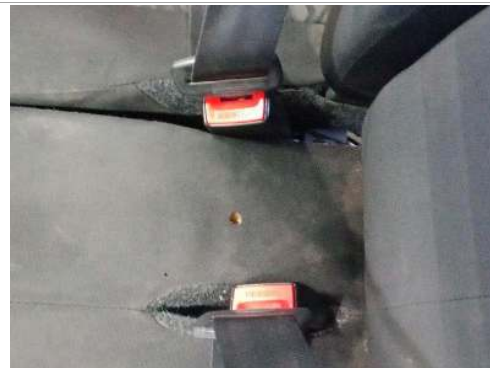

Seat Front Left



Control Arm Bush(es) Front Axle Right



Front Bumper



CONDITION REPORT

Report No: 2016400506

DATE
31/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT


Report No: 2016400506

DATE
31/05/2024

Front Bumper



Rim Rear Left

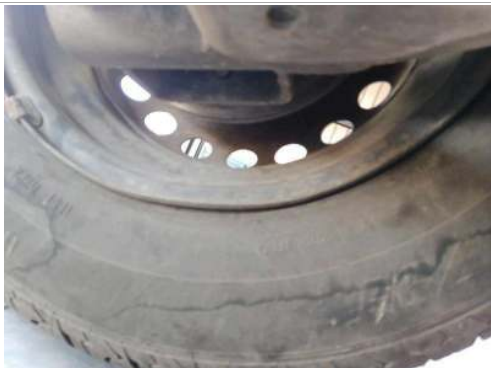

Rim Rear Left

**CONDITION REPORT****Report No: 2016400506****DATE**
31/05/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za