



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	29/08/2025		M57 Pretoria Road - 1619
Inspection Date	29/08/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	DATSUN	Registration Number	LY71NJGP
Model	GO	Register Number	
VIN	MDHZBAAD0Z0512704	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/09/2025
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	122,386 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025

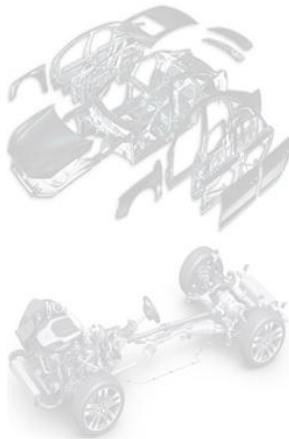

Damage

Repair Way

Battery box Damaged	Repair
Center Console / Cubbyhole + Lid Damaged	Repair
Air Conditioner Insufficient	Replace
Parcel Tray Cracked	Repair
Steering Wheel Trim Damaged	Replace
Bonnet Residual Traces of Repair	Repair
B • Pillar Right Residual Traces of Repair	Repair
C • Pillar Left Welded	Repair
C • Pillar Right Residual Traces of Repair	Repair
Front Fender Left Residual Traces of Repair	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Rear Fender Right / Inner Tray Damaged	Repair
Door Front Left Residual Traces of Repair	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Paintwork • Scratched	Repair
Door Rear Right Residual Traces of Repair	Repair
Boot Lid / Hatch door Hinge Left Welded	Replace
Boot Lid / Hatch door Hinge Right Welded	Replace
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Damaged	Repair
Roof Dented	Repair
Spring Front Left Defective	Replace
Spring Front Right Defective	Replace
Spring Rear Left Defective	Replace
Spring Rear Right Defective	Replace
Control Arm Bush(es) Front Axle Left Cracked	Replace
Control Arm Bush(es) Front Axle Right Cracked	Replace
Tyre Rear Right Damaged	Replace
Spare Tyre Damaged	Replace
Chassis Dented	Repair
Fuel Tank Damaged	Replace

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	2.34	2.39	-	
Rear	1.2	1.18	-	
Emergency / Parking	0.8	0.76	-	

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	165/70 R14	81S	MRF	ZVTV	V	0219	1 mm
Front Right	165/70 R14	81T	Hilo	Geneys	V	3623	4 mm
Rear Left	165/65 R14	79H	Nexen	CP661	V	4417	2 mm
Rear Right	175/65 R14	82T	Winrun	R380	V	2422	0 mm
Spare	175/65 R14	82T	Regal	RST-300	V	4313	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1109	BATTERY VOLTAGE(ABNORMAL)	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. REAR RIGHT TYRE REGROOVED. REAR LEFT AND RIGHT TYRE SIZES DIFFERENT. NON STANDARD DROP SPRINGS FITTED TO FRONT AND REAR OF VEHICLE. Engine Compartment: Engine bay dirty and battery loose

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



FRONT RIGHT CORNER



90 DEGREE FRONT



90 DEGREE LEFT



REAR LEFT CORNER



90 DEGREE REAR



90 DEGREE RIGHT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



Spare wheel and Accessories



ENGINE 1

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za


VIN: MDHZBAAD0Z0512704



CONDITION REPORT




Report No:
2016987079
DATE
29/08/2025

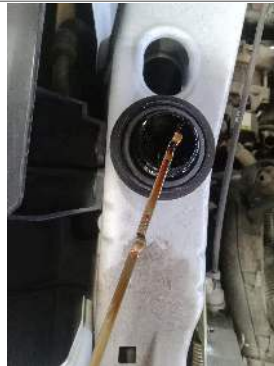


Oil cap and dipstick

[illegible]

Brake and shock absorber report

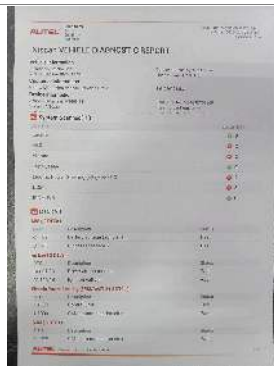

Diagnostic report page 1

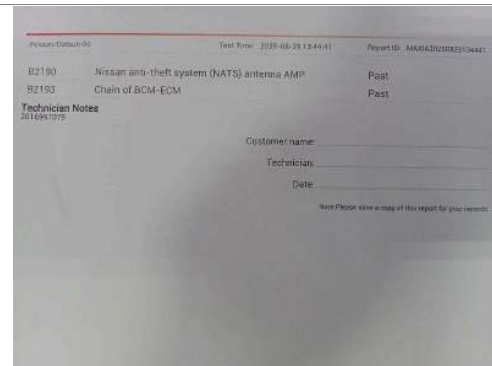

Diagnostic report page 2



Front Chassis



Rear chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



C • Pillar Right



B • Pillar Right



Sill Panel Right



Center Console / Cubbyhole + Lid



Steering Wheel Trim



Rear Fender Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



Door Rear Right



Door Front Right



Front Fender Right



Bonnet



Front Fender Left



Rear Fender Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



Door Rear Left



Door Rear Left



Door Front Left



Rear bumper



Rear bumper



Roof

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



Roof



C • Pillar Left



C • Pillar Right



Boot Lid / Hatch door Hinge Left



Boot Lid / Hatch door Hinge Right



Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



Parcel Tray



Air Conditioner



Battery box



Spring Front Right



Spring Front Left



Control Arm Bush(es) Front Axle Left

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



Sill Panel Left



Sill Panel Left



Sill Panel Right



Control Arm Bush(es) Front Axle Right



Chassis



Chassis

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



Chassis




Chassis



Fuel Tank



Spring Rear Left

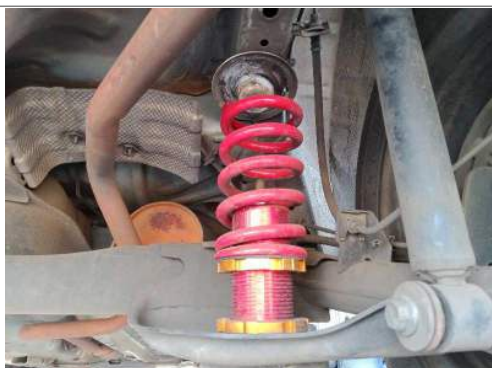

Spring Rear Right



Tyre Rear Right

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704



CONDITION REPORT



Report No:
2016987079
DATE
29/08/2025



Rear Fender Right / Inner Tray



Inner Boot Floor Pan and Spare Wheel Well



Chassis



Water level



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MDHZBAAD0Z0512704