



## CONDITION REPORT



Report No:  
2016903310  
DATE  
05/06/2025

MFC Auction House  
M57 Pretoria Rd, Glenmarais, KEMPTON PARK  
Gauteng

DEKRA MFC  
M57 Pretoria Rd - 1619  
KEMPTON PARK - GT  
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/06/2025		M57 Pretoria Road - 1619
Inspection Date	05/06/2025		Kempton Park - GT

**Vehicle Data**

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	DATSON	Registration Number	KHN006MP
Model	GO 1.2 LUX ULC 5-DR [2019-2021]	Register Number	
VIN	MDHZBAA0Z0519290	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	30/04/2026
Color	BLUE	Power / Displacement	
Year Model	2021	Paint Finish	TWO COAT UNI
Km Reading	56,122 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

**Vehicle Options & Accessories****Items****VEHICLE INSPECTION**

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksoord, Pretoria, 0200  
Phone: 012 542 4867  
www.dekraauto.co.za

VIN: MDHZBAA0Z0519290



## CONDITION REPORT



Report No:  
2016903310  
DATE  
05/06/2025



Damage	Repair Way
Seat Front Right Damaged	Repair
Parcel Tray Damaged	Repair
Steering Wheel Trim Defective	Repair
Front Bumper Paintwork • Scratched	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Paintwork • Scratched	Repair
Rear Fender Right Paintwork • Scratched	Repair
Door Front Left Paintwork • Scratched	Repair
Door Front Right Dented	Repair
Door Rear Left Paintwork • Scratched	Repair
Boot Lid / Hatch door Paintwork • Scratched	Repair
Rear bumper Paintwork • Scratched	Repair
Tyre Front Left Damaged	Replace
Spare Tyre Damaged	Replace
Chassis Dented	Repair
Brakes	Front L/R brake pipes strapped with cable ties
Body and Exterior	Dents and scratches on some body panels
Tyres and rims	Front left and right tyre sizes different
Engine	Engine bay dirty.

**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s <sup>2</sup> ]
	Braking Force [kN]	Braking Force [kN]		
Front	2.26	2.5	-	
Rear	1.31	1.42	-	
Emergency / Parking	0.97	1.12	-	

**Tyres and Rims****Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65 R14	82T	Sava	Effecta	V	0623	4 mm
Front Right	165/70 R14	81T	Apollo	Amazer	V	1121	5 mm
Rear Left	175/65 R14	82T	Sava	Effecta	V	0623	6 mm
Rear Right	175/65 R14	82T	Sava	Effecta	V	0623	5 mm
Spare	185/60 R14	82H	Dunlop	Sp-Sport	V	2121	0 mm

\* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHZBAAD0Z0519290



## CONDITION REPORT



Report No:  
2016903310  
DATE  
05/06/2025

### Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ENGINE	P0607	ECM	

### Inspection Conditions

No Test Drive  
 Battery Flat  
 Engine number – not possible to verify engine number (not visible without dismantling)  
 Inspection conditions for the vehicle inspection were sufficient

### Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

### Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

### Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.


DEKRA Automotive (PTY) Ltd.  
 97 Willem Cruywagen Ave  
 Klerksoord, Pretoria, 0200  
 Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHZBAAD0Z0519290




## CONDITION REPORT


Report No:  
2016903310  
DATE  
05/06/2025

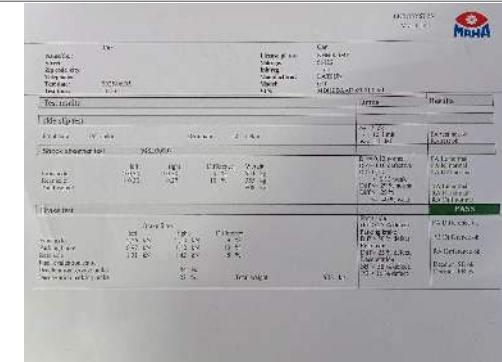

Brake and shock absorber report

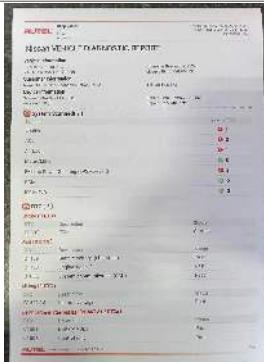

Diagnostic report page 1

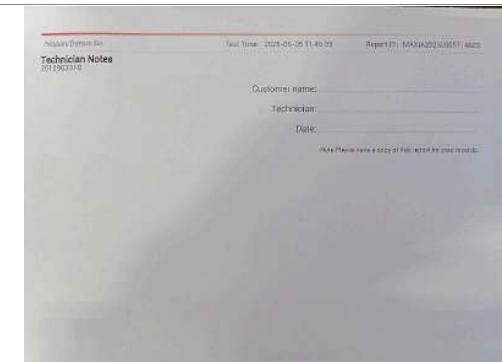

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHZBAAD0Z0519290



## CONDITION REPORT



Report No:  
2016903310  
DATE  
05/06/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHZBAAD0Z0519290



## CONDITION REPORT



Report No:  
2016903310  
DATE  
05/06/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHZBAAD0Z0519290



## CONDITION REPORT



Report No:  
2016903310  
DATE  
05/06/2025



LICENSE DISC



VIN PLATE OR STICKER



ENGINE 1



Front Chassis



Rear Chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHZBAAD0Z0519290



## CONDITION REPORT



Report No:  
2016903310  
DATE  
05/06/2025



Steering Wheel Trim



Seat Front Right



Front Fender Right



Door Front Right



Rear Fender Right



Rear bumper

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHZBAAD0Z0519290



## CONDITION REPORT



Report No:  
2016903310  
DATE  
05/06/2025



Rear bumper



Boot Lid / Hatch door



Door Rear Left



Rear Fender Left



Door Front Left



Spare Tyre

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHZBAAD0Z0519290



## CONDITION REPORT



Report No:  
2016903310  
DATE  
05/06/2025



Parcel Tray



Front Bumper



Front Bumper



Tyre Front Left



Chassis



Water level

DEKRA Automotive (PTY) Ltd.  
97 Willem Cruywagen Ave  
Klerksdorp, Pretoria, 0200  
Phone: 012 542 4867  
[www.dekraauto.co.za](http://www.dekraauto.co.za)

VIN: MDHZBAAD0Z0519290