



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	01/09/2025		M57 Pretoria Road - 1619
Inspection Date	01/09/2025		Kempton Park -

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	RENAULT	Registration Number	KC03KRGP
Model	KWID	Register Number	
VIN	MEEBBA00000759501	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/12/2025
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	91,073 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



Damage

Repair Way

Side Mirror Right Damaged	Replace
Bonnet Paintwork • Chipmarks	Repair
Front Fender Right Dented	Repair
Door Front Right Damaged	Repair
Boot Lid / Hatch door Dented	Repair
Rear bumper Paintwork • Scratched	Repair
Inner Boot Floor Pan and Spare Wheel Well Dented	Repair
Sill Panel Right Damaged	Repair
Rear Axle Damaged	Repair
Control Arm Bush(es) Front Axle Left Damaged	Replace
Control Arm Bush(es) Front Axle Right Damaged	Replace
Tyre Rear Right Worn	Replace
Spare Tyre Damaged	Replace
Chassis Damaged	Repair
Engine to silencer pipe Damaged	Repair
Silencer Damaged	Repair
Gearbox Damaged	Repair
Fuel Tank Damaged	Repair
Fuel Lines Defective	Repair

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	1.81	1.7	-	
Rear	1.2	1.23	-	
Emergency / Parking	0.92	1.18	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	175/65 R14	82H	Windforce	Catchfors	V	0824	2 mm
Front Right	175/65 R14	82H	Windforce	Catchfors	V	0724	1 mm
Rear Left	165/70 R14	81T	Apollo	Amazer	V	0821	2 mm
Rear Right	165/70 R14	81T	Apollo	Amazer	V	0621	0 mm
Spare	165/70 R14	81T	Apollo	Amazer	V	0621	0 mm

* Tyre Legend: V=Virgin, R=Recap

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	INJ(INJECTION)	DTC033531	ENGINE SPEED SENSOR SIGNAL NO SIGNAL	

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.Engine Compartment: Engine bay dirty.

Interior: Vehicle interior dirty and some panels scratched

Body • Exterior: Dents and scratches on some body panels

Tyres and Rims: Front and rear tyre sizes different.Rear hubcaps missing.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025

[illegible]

Brake and shock absorber report

[illegible]

Diagnostic report page 1

Name		Address	City	State	Zip
101	Agnew, John	1401 E. 1st St.	Albany	NY	12212
102	Albright, John	2001 E. 1st St.	Albany	NY	12212
103	Allen, J. E.	1001 E. 1st St.	Albany	NY	12212
104	Anderson, J. E.	1001 E. 1st St.	Albany	NY	12212
105	Armstrong, J. E.	1001 E. 1st St.	Albany	NY	12212
106	Barber, J. E.	1001 E. 1st St.	Albany	NY	12212
107	Barnes, J. E.	1001 E. 1st St.	Albany	NY	12212
108	Bell, J. E.	1001 E. 1st St.	Albany	NY	12212
109	Bennett, J. E.	1001 E. 1st St.	Albany	NY	12212
110	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
111	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
112	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
113	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
114	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
115	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
116	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
117	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
118	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
119	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212
120	Bishop, J. E.	1001 E. 1st St.	Albany	NY	12212

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual Transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Spare wheel and Accessories

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501




CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



LICENSE DISC

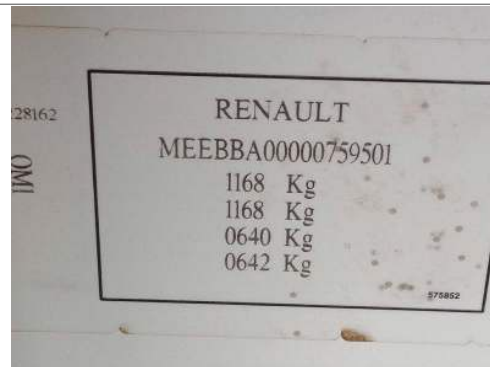

VIN PLATE OR STICKER



ENGINE 1



Front chassis



Rear chassis



Oil cap and dipstick

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



Side Mirror Right



Door Front Right



Front Fender Right



Front Fender Right



Bonnet



Bonnet

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



Rear bumper



Rear bumper



Rear bumper



Boot Lid / Hatch door



Boot Lid / Hatch door



Spare Tyre

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501




CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



Spare Tyre

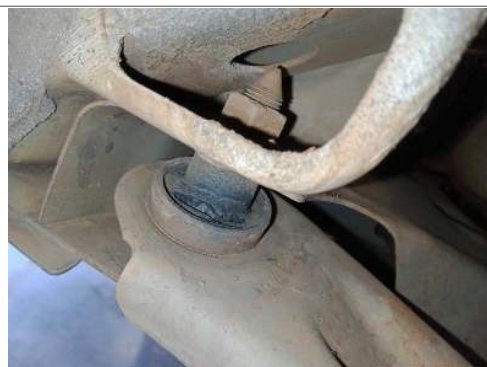

Control Arm Bush(es) Front Axle Right



Control Arm Bush(es) Front Axle Left



Sill Panel Right



Sill Panel Right



Gearbox

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



Chassis



Chassis



Chassis



Chassis



Fuel Lines



Fuel Tank

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



Tyre Rear Right



Rear Axle



Inner Boot Floor Pan and Spare Wheel Well



Silencer



Engine to silencer pipe



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501



CONDITION REPORT



Report No:
2016998625
DATE
01/09/2025



Water level

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MEEBBA00000759501