

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	22/04/2024		M57 Pretoria Road - 1619
Inspection Date	22/04/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC AUCTION HOUSE
Manufacturer	RENAULT	Registration Number	JS14GDGP
Model	KWID	Register Number	
VIN	MEEBBA00800722583	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	62,281 KM	Fuel	PETROL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Headlight Left Defective	Repair
Headlight Right Damaged	Replace
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
A • Pillar Left Damaged	Repair
A • Pillar Right Damaged	Repair
B • Pillar Left Damaged	Repair
B • Pillar Right Damaged	Repair
C • Pillar Left Damaged	Repair
C • Pillar Right Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Front Right Damaged	Repair
Door Rear Left Damaged	Repair
Door Rear Right Damaged	Repair
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Roof Damaged	Repair
Gearbox Oil Leak	Repair

Brakes

Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [KN]	Braking Force [KN]		
Front	1.87	1.81	-	
Rear	1.21	1.28	-	
Emergency / Parking	0.99	1.28	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	155/80R13	79T	JKTyre	Radial	V	1417	1 mm
Front Right	165/70R14	81T	Apollo	Radial	V	1020	1 mm
Rear Left	155/80R13	79T	Ceat	Radial	V	4718	3 mm
Rear Right	165/80R13	83T	Goodyear	Duragrip	V	2915	1 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: SIGNS OF REPAIR WORK DONE TO SOMEBODY PANELS. POOR ALIGNMENT TO SOMEBODY PANELS. VEHICLE BODY IN POOR CONDITION. SIGNS OF HAIL DAMAGE TO SOMEBODY PANELS. REPAIR WORK DONE TO VEHICLE BELOW STANDARD.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician


Werner Laubscher

This document was created electronically and is valid without signature.


General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



dipstick.

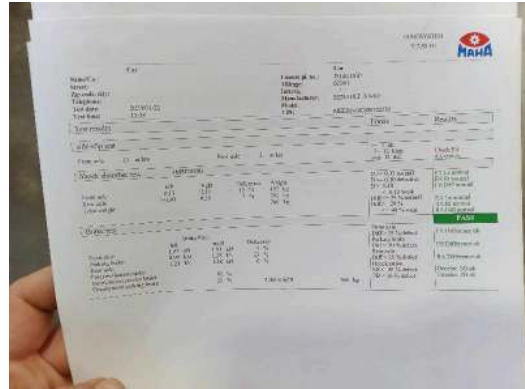


Brake test.

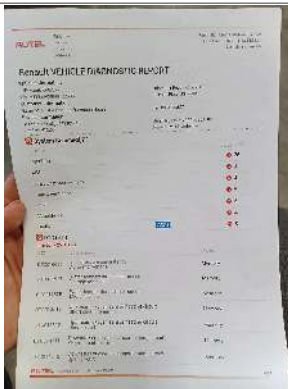


Diagnostics.



Diagnostics.

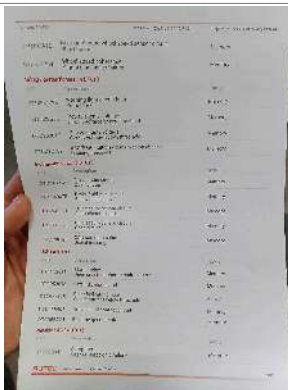

Diagnostics.

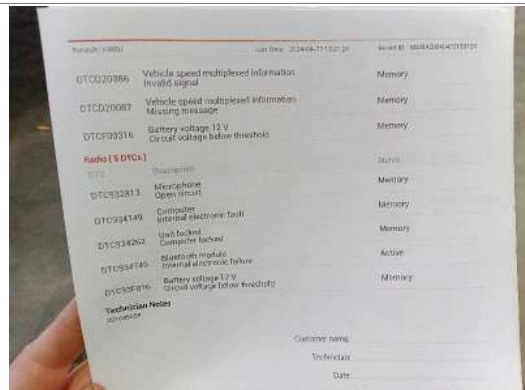

Diagnostics.



Manual.



Undercarriage front.



Undercarriage rear.



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

VIN: MEEBBA00800722583

7 / 12



LF TYRE TREAD



LR TYRE TREAD

VIN: MEEBBA00800722583

8 / 12



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER

VIN: MEEBBA00800722583

9 / 12



ENGINE 1



Water level

VIN: MEEBBA00800722583

10 / 12



Headlight Right



Headlight Left



Front Bumper



Front Bumper

VIN: MEEBBA00800722583

11 / 12




Front Fender Left



Bonnet



Door Front Left

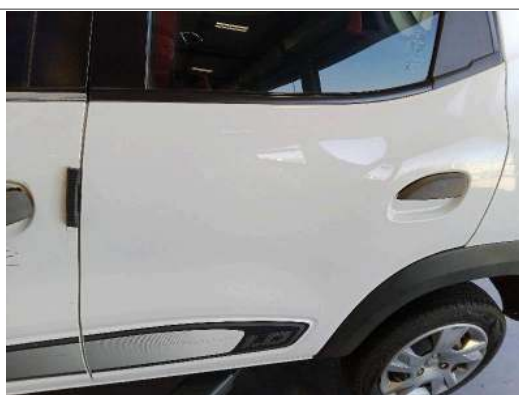

Door Rear Left



Rear bumper




Rear bumper



Boot Lid / Hatch door



Door Rear Right

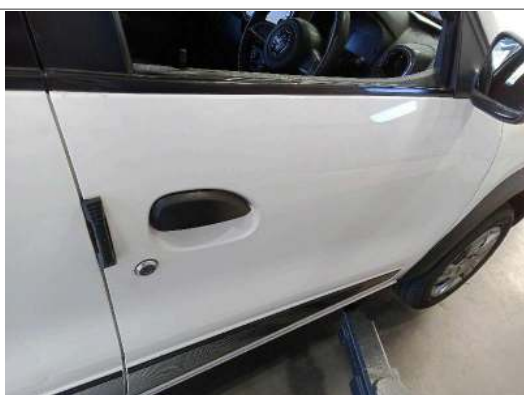

Door Front Right



Front Fender Right



Rear Fender Right



Rear Fender Left



Roof



C • Pillar Right



B • Pillar Right



A • Pillar Right



C • Pillar Left



B • Pillar Left



A • Pillar Left



Engine



Gearbox



CONDITION REPORT

Report No: 2016350585

DATE
22/04/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za