



CONDITION REPORT

Report No: 2016201503

DATE
14/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	14/12/2023		M57 Pretoria Road - 1619
Inspection Date	14/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	LIGHT LOAD VEHICLE	Registered Owner	MFC
Manufacturer	MAZDA	Registration Number	FJK005L
Model	PRO BT-50	Register Number	
VIN	MM6UR0YD1L0017661	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/03/2024
Color	GREY	Power / Displacement	
Year Model		Paint Finish	M - METALLIC
Km Reading	191,139 KM	Fuel	DIESEL
Cab / Body Type	DOUBLE CAB	Transmission	MANUAL

Vehicle Options & Accessories

Items


VEHICLE INSPECTION

Damage

Repair Way

Seat Front Right Torn / Cut
Front Bumper Residual Traces of Repair
Load Body Dented
Gearbox Oil Sweat

Repair
Repair
Repair
Repair

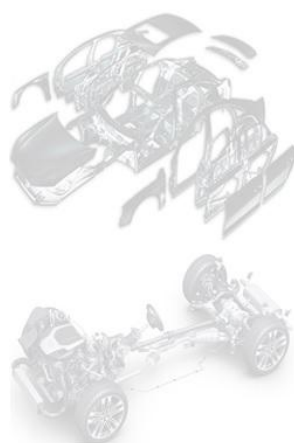

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MM6UR0YD1L0017661

1 / 8



CONDITION REPORT

Report No: 2016201503

 DATE
14/12/2023

Brakes

Brake Test Results

	Left	Right		
	Braking Force [KN]	Braking Force [KN]	Axle Weight [KG]	Deceleration [m/s ²]
Front	4.2	4.6	-	
Rear	3.3	4.1	-	
Emergency / Parking	2.3	3.3	-	

Tyres and Rims

Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	265/65R17	112S	Dunlop	Grandtrek	V	1821	3 mm
Front Right	265/65R17	112S	Dunlop	Grandtrek	V	1821	3 mm
Rear Left	265/65R17	112S	Dunlop	Grandtrek	V	1821	3 mm
Rear Right	265/65R17	112S	Dunlop	Grandtrek	V	1821	2 mm
Spare	265/65R17	112T	Bridgestone	Dueler	V	///////	7 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive
 Battery Flat
 Engine number – not possible to verify engine number (not visible without dismantling)
 Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS. Body • Exterior: Minor dents scratches and stone chips on some body panels. Signs of spray work done on

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Trevino Julius

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

VIN: MJA4U00Y2010207503


2 / 8

DATE

14/12/2023

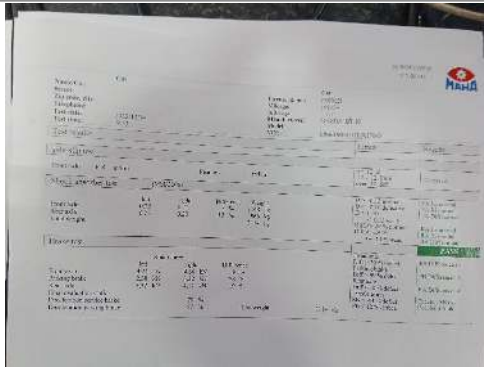

Shock and brake report

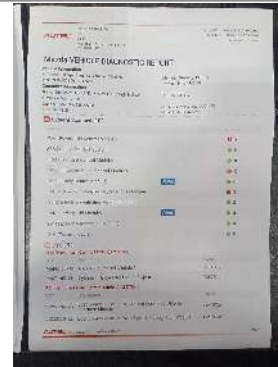

Diagnostic test



Diagnostic test



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

**CONDITION REPORT****Report No: 2016201503**

VIN: MM6UR0YD1L0017661

DATE**14/12/2023**

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016201503

DATE
14/02/2023
VIN: MM6UR0Y1402023
4/8



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

**CONDITION REPORT****Report No: 2016201503****DATE**
14/12/2023

VIN: MM6UR0YD1L0017661

5 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za




CONDITION REPORT

Report No: 2016201503

DATE
14/12/2023

VIN: MM6UR0YD1L0017661

6 / 8

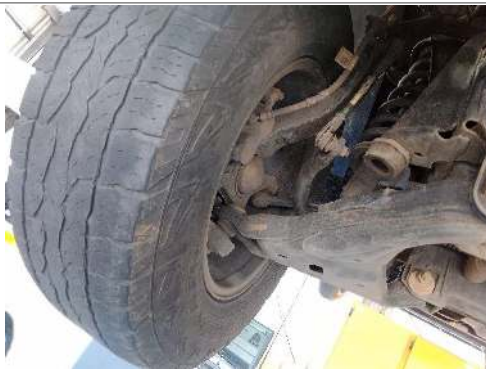

LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



Sparewheel



LICENSE DISC



CONDITION REPORT

Report No: 2016201503

DATE
14/12/2023

VIN: MM6UR0YD1L0017661

7 / 8

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016201503

DATE
14/12/2023

VIN PLATE OR STICKER



ENGINE 1



ENGINE 2



CHASSIS



Rear chassis



Manual



CONDITION REPORT

Report No: 2016201503

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016201503

DATE
14/12/2023

Expansion bottle



Oil cap and dipstick



Water level



Front Bumper



Front Bumper



Front Bumper



CONDITION REPORT

Report No: 2016201503

DATE
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016201503

DATE
14/12/2023

Front Bumper



Gearbox



Gearbox



Gearbox



Load Body



Seat Front Right

**CONDITION REPORT****Report No: 2016201503****DATE**
14/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za