



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572



Assignment

Client	MFC Auction House	Inspection Location	MFC
Requested Date	05/11/2024		M57 Pretoria Road - 1619
Inspection Date	05/11/2024		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	
Manufacturer	NISSAN	Registration Number	CS47JJGP
Model	SENTRA 1.6 ACENTA [2013-2016]	Register Number	
VIN	MNTBBAB17Z0010859	Date Of First Licensing	
Engine Number		Last COR	
Doors	4	License Expiry Date	31/07/2025
Color	SILVER	Power / Displacement	
Year Model	2013	Paint Finish	TWO COAT UNI
Km Reading	335,811 KM	Fuel	PETROL
Cab / Body Type	SEDAN	Transmission	MANUAL

Vehicle Options & Accessories

Items

VEHICLE INSPECTION

Damage	Repair Way
Engine Oil Leak	Repair
Engine Wiring Defective	Repair
Fan Belt Missing	Replace
Air conditioner pipes Damaged	Replace
Alternator Defective	Repair
Bonnet safety caps Damaged	Replace
Bonnet stay and shocks Damaged	Repair
Hooter Damaged	Replace
Switch Electrical Window Winder rear left Malfunction	Replace
Windscreen Washer Missing	Replace
Tail Light Right Damaged	Replace
Headlight Left Damaged	Replace
Seat Front Left Damaged	Repair
Seat Front Right Damaged	Repair
Seat Rear Damaged	Repair
Interior Mirror Missing	Replace
Door Sealing Rubber Rear Left Damaged	Replace
Door Lock Front Right Damaged	Replace
Dash Padding Damaged	Repair
Steering Wheel Trim Damaged	Replace
Side Mirror Right Damaged	Replace
Front Bumper Damaged	Repair
Grill Damaged	Replace
Bonnet Welded	Replace
Bonnet slam plate (Shock tower/ Inner tray) Damaged	Repair
A • Pillar Right Damaged	Repair
B • Pillar Right Dented	Repair
C • Pillar Left Dented	Repair
C • Pillar Right Dented	Repair

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: MNTBBAB17Z0010859

1 / 25



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Damage	Repair Way
Front Fender Left Damaged	Repair
Front Fender Right Residual Traces of Repair	Repair
Rear Fender Left Residual Traces of Repair	Repair
Rear Fender Right Residual Traces of Repair	Repair
Front Fender Left / Inner Tray Damaged	Repair
Front Fender Right / Inner Tray Damaged	Repair
Rear Fender Right / Inner Tray Damaged	Repair
Door Front Left Dented	Repair
Door Front Right Residual Traces of Repair	Repair
Door Rear Left Dented	Repair
Door Rear Right Residual Traces of Repair	Repair
Doorstopper Front Right Damaged	Replace
Boot Lid / Hatch door Damaged	Repair
Rear bumper Damaged	Repair
Inner Boot Floor Pan and Spare Wheel Well Damaged	Repair
Sill Panel Left Damaged	Repair
Sill Panel Right Dented	Repair
Roof Damaged	Repair
Steering Rack Boot Right Damaged	Replace
Shock Absorber Rear Right Leak	Replace
Shock Absorber Mounting Front Right Cracked	Replace
Alignment Poor Alignment	Repair
Mounting Rubber(s) Rear Axle Left Cracked	Replace
Mounting Rubber(s) Rear Axle Right Cracked	Replace
Tyre Front Right Damaged	Replace
Tyre Rear Right Worn	Replace
Rim Front Right Dented	Repair
Rim Rear Left Scratched	Repair
Rim Rear Right Scratched	Repair
Main Beam Left Damaged	Replace
Main Beam Right Damaged	Repair
Chassis Damaged	Repair
Sub Frame Dented	Repair
Silencer Damaged	Replace
Belly plates Damaged	Replace
Fuel Lines Defective	Repair
CV Joint(s) Boot(s) Front Right (inner/outer) Damaged	Replace
Radiator Cradle Damaged	Replace
Steering Noisy	Repair
Gear Selections Malfunction	Repair
Jack Missing	Replace
Wheel Spanner Missing	Replace
Triangle Missing	Replace
Signs of vehicle airbags deployed.	Replace
Engine	Engine bay dirty and battery loose.
Engine	Aircon condenser missing.
Body and Exterior	Signs of hail damage on some body panels
Engine	Fan Cowley damaged
Undercarriage	Rear exhaust cross member bracket damaged
Body and Exterior	Dents and scratches on some body panels
Body and Exterior	Signs of impact damage to front of vehicle.
Body and Exterior	Signs of impact damage to rear of vehicle.
Body and Exterior	Poor residual traces of repair on some body panels
Body and Exterior	Stone chips and spray work on some body panels
Body and Exterior	Some body panels misaligned
Body and Exterior	Bonnet does not close.
Road test	Vehicle unsafe to drive.
Alex and suspension	Signs of vehicle grabbing.
Axle and suspension	Front suspension noisy.
Tyres and rims	Rear left and right tyre sizes different.



CONDITION REPORT

VIN: MNTBRAB1770010850
Report No: 2016598816
2 / 25
DATE
05/11/2024

Brakes
Brake Test Results

	Left	Right	Axle Weight [KG]	Deceleration [m/s²]
	Braking Force [KN]	Braking Force [KN]		
Front	3.1	3.33	-	
Rear	1.93	2.13	-	
Emergency / Parking	1.59	1.7	-	

Tyres and Rims
Tyre Specification & Measurement

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	205/55 R16	91V	Bridgestone	Turanza	V	0513	5 mm
Front Right	205/55 R16	91V	Xecent	EL601	V	4520	4 mm
Rear Left	205/55 R16	91V	Continental	Contipremuim	V	3222	6 mm
Rear Right	195/55 R16	87V	Dunlop	Sp-Sport	V	2318	0 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic the following error messages were detected: (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

No	System	Code	Description	Status
1	ABS	C1109	BATTERY VOLTAGE(ABNORMAL)	

Inspection Conditions

No Test Drive
Battery Flat
Engine number – not possible to verify engine number (not visible without dismantling)
Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Sibusiso Mokase

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.




CONDITION REPORT

Report No: 2016598816


VIN: MNTBBAB17Z0010859

DATE
3/25


05/11/2024

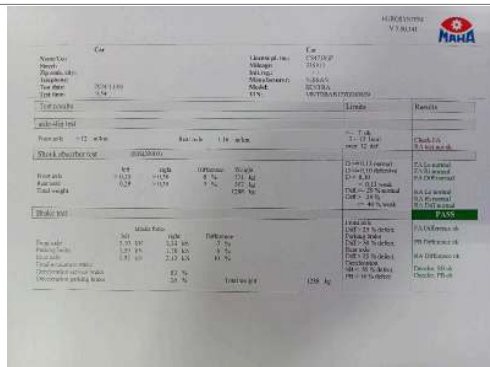

Brake and shock absorber report

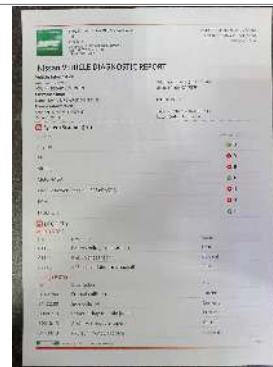

Diagnostic report page 1

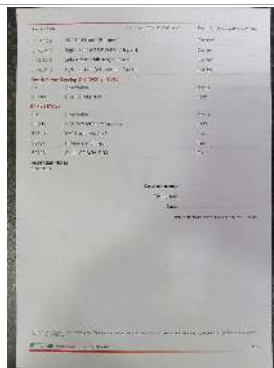

Diagnostic report page 2



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)



CONDITION REPORT

Report No: 2016598816

VIN: MNTBBAB17Z0010859
DATE 05/11/2024
4 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE

05/11/2024

VIN: MNTBBAB17Z0010859

5 / 25



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



Manual transmission



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR

DEKRA Automotive (PTY) Ltd.
 97 Willem Cruywagen Ave
 Klerksord, Pretoria, 0200
 Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859
6 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

90 DEGREE LEFT



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC

VIN: MNTBBAB17Z0010859

7 / 25



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859
8 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN PLATE OR STICKER




ENGINE 1



Front chassis



Rear chassis

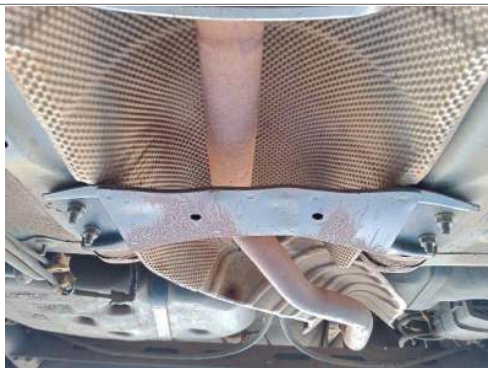

Rear exhaust cross member brace



Oil cap and dipstick



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859
10 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Fan Cowley



Dash Padding



Steering Wheel Trim



Side Mirror Right



Doorstopper Front Right



A • Pillar Right



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859
12 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Sill Panel Right



Seat Front Right



Seat Rear



Rear Fender Right



Door Rear Right



Door Front Right



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859
14 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Front Fender Right



Front Fender Right

VIN: MNTBBAB17Z0010859

15 / 25



Front Bumper



Front Bumper



Grill



Bonnet



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859
16 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Headlight Left



Front Fender Left

17 / 25



Door Front Left



Seat Front Left



Switch Electrical Window Winder rear left



Door Sealing Rubber Rear Left



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859
18 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

C • Pillar Left



Rear bumper



Rear bumper



Boot Lid / Hatch door



Roof



Tail Light Right

VIN: MNTBBAB17Z0010859

19 / 25



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859
20 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024


C • Pillar Right



B • Pillar Right



Inner Boot Floor Pan and Spare Wheel Well

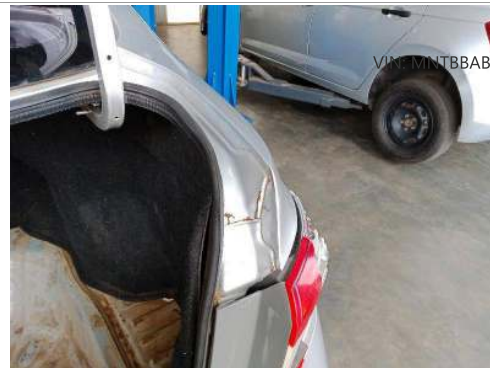

C • Pillar Right



Bonnet



Bonnet slam plate (Shock tower/ Inner tray)



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859

22 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Alternator



Main Beam Right



Main Beam Right



Air conditioner pipes



Air conditioner pipes



Main Beam Left

VIN: MNTBBAB17Z0010859

23 / 25



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

VIN: MNTBBAB17Z0010859
24 / 25

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Bonnet slam plate (Shock tower/ Inner tray)



Front Fender Left / Inner Tray



Rim Front Right



Front Fender Right / Inner Tray



Engine Wiring



Front Fender Right / Inner Tray



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Front Fender Left / Inner Tray



Sill Panel Left



Rim Rear Left



Rim Rear Right



Rear Fender Right / Inner Tray



Sill Panel Right



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Door Rear Left



Rear Fender Left



Belly plates



CV Joint(s) Boot(s) Front Right (inner/outer)



CV Joint(s) Boot(s) Front Right (inner/outer)



Rim Front Right

**CONDITION REPORT**

Report No: 2016598816

DATE
05/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Tyre Front Right



Engine Wiring



Radiator Cradle



Engine



Main Beam Right



Front Bumper



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Fan Belt



Chassis



Silencer



Fuel Lines



Mounting Rubber(s) Rear Axle Left



Mounting Rubber(s) Rear Axle Right



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Fuel Lines



Shock Absorber Rear Right



Tyre Rear Right



Rear Fender Right / Inner Tray



Inner Boot Floor Pan and Spare Wheel Well



Steering Rack Boot Right

**CONDITION REPORT**

Report No: 2016598816

DATE
05/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Sub Frame



Water level



Water level



Front Bumper



Shock Absorber Mounting Front Right



Bonnet stay and shocks



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Bonnet slam plate (Shock tower/ Inner tray)



Bonnet safety caps



Gear Selections



Hooter



Interior Mirror



Door Lock Front Right



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016598816

DATE
05/11/2024

Windscreen Washer



Radiator Cradle



Radiator Cradle

**CONDITION REPORT****Report No: 2016598816****DATE**
05/11/2024

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za