



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

MFC Auction House
M57 Pretoria Rd, Glenmarais, KEMPTON PARK
Gauteng

DEKRA MFC
M57 Pretoria Rd - 1619
KEMPTON PARK - GT
08610 33572

**Assignment**

Client	MFC Auction House	Inspection Location	MFC
Requested Date	19/12/2023		M57 Pretoria Road - 1619
Inspection Date	19/12/2023		Kempton Park - GT

Vehicle Data

Vehicle Type	PASSENGER VEHICLE	Registered Owner	MFC
Manufacturer	NISSAN	Registration Number	HZ59XHGP
Model	QASHQAI	Register Number	
VIN	SJNFCAJ10Z2666252	Date Of First Licensing	
Engine Number		Last COR	
Doors	5	License Expiry Date	31/03/2024
Color	WHITE	Power / Displacement	
Year Model		Paint Finish	TWO COAT UNI
Km Reading	119,216 KM	Fuel	DIESEL
Cab / Body Type	HATCHBACK	Transmission	MANUAL

Vehicle Options & Accessories**Items**

VEHICLE INSPECTION



Damage	Repair Way
Seat Front Right Damaged	Repair
Front Bumper Damaged	Repair
Bonnet Damaged	Repair
Front Fender Left Damaged	Repair
Front Fender Right Damaged	Repair
Rear Fender Left Damaged	Repair
Rear Fender Right Damaged	Repair
Door Front Left Damaged	Repair
Door Rear Left Damaged	Repair
Rear bumper Damaged	Repair
Tyre Front Left Worn	Replace
Tyre Front Right Worn	Replace

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za

VIN: SJNFCAJ10Z2666252

1 / 9



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023**Brakes****Brake Test Results**

	Left	Right	Axle Weight [KG]	Deceleration [m/s ²]
	Braking Force [kN]	Braking Force [kN]		
Front	3.14	2.81	-	
Rear	2.44	2.37	-	
Emergency / Parking	1.6	2.11	-	

Tyres and Rims**Tyre Specification & Measurement**

	Size	Load/Speed Index	Manufacture	Model	Type*	Production Date	Tread Depth (mm)
Front Left	215/65R16	98H	Powertrac	Radial	V	0117	0 mm
Front Right	215/65R16	98H	Powertrac	Radial	V	0217	0 mm
Rear Left	215/65R16	98H	Windforce	Radial	V	3918	2 mm
Rear Right	215/65R16	98H	Windforce	Radial	V	3918	2 mm

* Tyre Legend: V=Virgin, R=Recap

Diagnostic

During the diagnostic no active error messages were detected. (See also attached Diagnostic Report. For more information regarding the Fault Codes (DTC) and the recommended rectifications please contact the workshops of the vehicle manufacture).

Inspection Conditions

No Test Drive

Battery Flat

Engine number – not possible to verify engine number (not visible without dismantling)

Inspection conditions for the vehicle inspection were sufficient

Comments

General Comments: ACCORDING TO THE AGE AND MILEAGE OF THE VEHICLE, NORMAL WEAR AND TEAR MARKS ARE VISIBLE ON THE INTERIOR, EXTERIOR, ELECTRICAL AND MECHANICAL PARTS.

Body • Exterior: Minor dents and scratches and stone chips to some body panels. Signs of repair work done to some body panels. Poor alignment to some body panels.

Concluding Remarks

THIS REPORT HAS BEEN DRAWN UP IMPARTIALLY AND TO THE BEST OF OUR KNOWLEDGE

Technician

Werner Laubscher

This document was created electronically and is valid without signature.

General Remarks: The DEKRA Condition Report Inspection is a visual and functional check of all the items listed inside the report. DEKRA is not liable for concealed and hidden defects. DEKRA doesn't check: oil and fuel consumption, source of a leak if the area is dirty, oil pump strainer for any build-up of sludge, operation of cassette players or compact disc players, sound or radio reception, alarm systems, cylinder compression. We don't dismantle, remove or strip any part of the vehicle. Road testing is carried out within the immediate confines of the inspection location. This condition report is valid only for the described vehicle and the described condition at the time of inspection. DEKRA Terms & Conditions apply.



CONDITION REPORT


VIN: SUJAU2076200512

Report No: 2076200512


2 / 9

DATE


19/12/2023

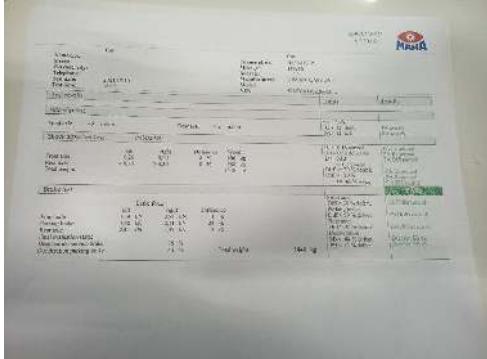

Brake test

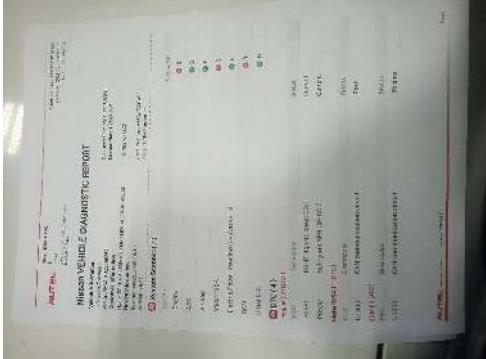

Diagnostic report

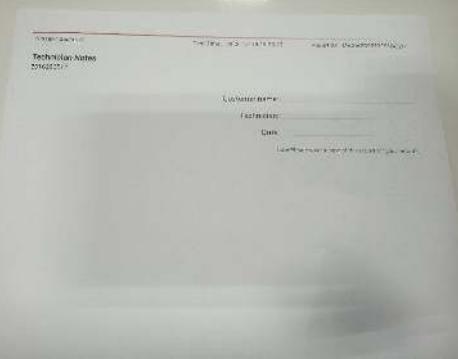

Diagnostic report



FRONT RIGHT CORNER



REAR LEFT CORNER



INTERIOR (FRONT DRIVER DOOR)

**CONDITION REPORT****Report No:** 2016206512

VIN: SJNFCAJ10Z2666252

DATE

19/12/2023

3/9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206512

DATE

VIN: SJNFCAJ1074692023

4 / 9



DASHBOARD (W/ ENGINE RUNNING)



ODOMETER



90 DEGREE FRONT



90 DEGREE RIGHT



90 DEGREE REAR



90 DEGREE LEFT



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

VIN: SJNFCAJ10Z2666252

5 / 9

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

VIN: SJNFCAJ10Z2666252

6 / 9



LF TYRE TREAD



LR TYRE TREAD



RR TYRE TREAD



RF TYRE TREAD



LICENSE DISC



VIN PLATE OR STICKER



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

VIN: SJNFCAJ10Z2666252

7 / 9



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

ENGINE 1



ADDITIONAL 4



ADDITIONAL 5



ADDITIONAL 10



Water level



Front Bumper



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

VIN: SJNFCAJ10Z2666252

9 / 9



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

Front Bumper



Bonnet



Front Fender Left



Door Front Left



Door Rear Left



Rear Fender Left



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

Rear bumper



Rear bumper



Front Fender Right



Rear Fender Right



Seat Front Right



Tyre Front Left



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

Tyre Front Right



CONDITION REPORT

Report No: 2016206512

DATE
19/12/2023

DEKRA Automotive (PTY) Ltd.
97 Willem Cruywagen Ave
Klerksoord, Pretoria, 0200
Phone: 012 542 4867
www.dekraauto.co.za